



COPY

中国船级社

Form RA

CHINA CLASSIFICATION SOCIETY

REPORT OF SURVEY

No. [REDACTED]

Name of Ship	CHIPOLBROK MOON	Class No.	[REDACTED]
--------------	-----------------	-----------	------------

Alteration(s)	<input type="checkbox"/>	Renewal(s)	<input type="checkbox"/>	Damage(s) and Repair(s)	<input type="checkbox"/>	Others	<input checked="" type="checkbox"/>
---------------	--------------------------	------------	--------------------------	-------------------------	--------------------------	--------	-------------------------------------

Others:

THIS IS TO CERTIFY That at the request of Chinese-Polish Joint Stock Shipping Company- the operator of the captioned vessel, the undersigned surveyor to this society did attend on board the vessel at Industrial Terminal of Houston, USA on May 25, 2018, for the purpose of carrying out an additional survey to Safety Construction, Safety Equipment Certificates and Class Certificate about the deficiency found during a PSC inspection with MISLE Activity No. 6421282. The details were reported as follows:

1. PSC deficiency 1: Action Taken: 60ac

Vessel suffered a fire in port side cargo hold #3, crew closed ventilation to cargo hold #3 and discharged 59(out of total 126) CO2 bottles from the ship's fixed CO2 system. The extent of the damage caused by the fire is unknown.

After the undersigned surveyor boarded, stated by master that when crew carried out stopper cutting job, around 0012 of May 23, 2018, found dense smoke and trigged fire alarm. Around 0020LT, started released 59 bottles of CO2 to hold No.3. The fire was extinguished and after crew inspected, no structure damage were found.

The undersigned surveyor did inspect Cargo Hold #3P&S after affected cargo was unloaded. No obvious structure damage was found. 60 affected bottles were refilled to 45kg and re-installed by Fire Protection Service, Inc., and the installation quality was visual inspected by the undersigned and found in order. The fixed CO2 system resumed fully operational.

2. PSC deficiency 2: Action Taken: 50ac

In refer to ship & shore contingency plan, 33CFR 160.216. and the below deficiency, the vessel failed to immediately report or cause to be immediately reported a hazardous condition had occurred on board.

The ISM cert. was issued by Lloyd's Registe(LR). LR will deal with this deficiency in due time.

3. PSC deficiency 3: Action Taken: 10c

Vessel suffered a fire in cargo hold #3 on 23rd May 2018 at 0012 , no notification was made until 0800.failing to immediately report or cause to be reported.

The PSCO has confirmed deficiency being rectified on spot, no further action is needed.

Place Houston, USA



[REDACTED]  
(Zhang Qingsong)

Date May 25, 2018

Surveyor to CHINA CLASSIFICATION SOCIETY

Marks to be used: Applicable  Not Applicable

Ver. 2.0 201606