

AC WFJK.21240  
XU 894  
TO tneeson [REDACTED]  
CC bweinbecker [REDACTED]  
CC jfisker [REDACTED]  
FM cheng.WFJK  
DT 201507291946

SB Walashek Boiler Inspection  
Good Afternoon,

As you are aware the Port Boiler Front Wall needs to be addressed in the Shipyard. We inspected/cleaned the Port Boiler 7/11/15 and the brickwork is getting worse bowing the front water wall tubes out even further. We inspected/cleaned the Starboard Boiler 7/25/15 and found the front wall brick work starting to fail and bowing out the front wall water wall tubes. The boilers need the front wall brick work repaired/replaced, burner throats renewed, floor brick replaced, and all fire stops repaired. There is extensive work that needs to be completed inside the furnace in both boilers. I recommend to have Walashek complete a boiler survey to determine the scope of work which needs to be completed in the Shipyard. With the short time frame permitted for the yard and the amount of work that needs to be completed a survey should be completed as soon as possible. Let me know what you think.

Jim, C/E EL FARO