



Welcome Chantal Couture

Help | My Info | **Todo** | Today | Logout



View Task

new task

new file



Tasks List : [View this Aircraft](#) : [Edit this Task](#)



delete task

Details

Aircraft: N338AX
 Task: **Aileron trim indication**
 Task Type: Discrepancy
 Task Creator: baniel
 Task Originator: baniel
 Priority: Low/Info Only
 Location: Pt. Mugu
 AOG?: No
 Progress: 100%
 TTAF: 3230.50

Dates and Targets

Opening Date: 15/08/2017 08:30:00
 Expected Finish Date/Closing Date: 15/08/2017 17:00:00
 Time Worked: 0

Assigned Users



Dependencies

none

Tasks depending on this Task

none

Description

Aileron trim indication found inoperative during pre-flight checks.

No aileron trim indication troubleshoot to broken position transmitter cable inside L/H aileron. Position transmitter cable, trim motor bellcrank, and trim operating rod replaced as per AP101B-1307-1, Section 3, Chapter 4, Paragraph 56, 57, 59, and Figure 16. Aileron trim rigged IAW with same and Figure 11 of same chapter. Aileron reinstalled as per AP101B-1307-1, Section 3, Chapter 2, Paragraph 16, and Figures 11-14. Aileron travels checked IAW AP101B-1307-1, Section 3, Chapter 4, Figure 11.

Transmitter cable:

Part #: F.187794
 Tracking #: 75273

Bellcrank:

Part #: F.217360-S1
 Tracking #: 75276

Operating rod:

Part #: A.218102
 Tracking #: 39700

Task Logs

New Log

Files

Parts

Date	Summary	Location	User	Comments
------	---------	----------	------	----------

new log

Key: =Normal Log =Problem Reported