Factual Report – Attachment 2 Mandatory Occurrence Report

AIR TRAFFIC CONTROL

OPS17IA010

SCT-M-2016/12/16-0002

1. Reporting FAC ID 2. Date UTC (dd/mm/yyyy)										3. Time UTC				4. Significant Occurrence?			
s	С	Т	1	6	1	2	2	0	1	6	0	9	2	0	Yes O No		
O CIC O Air									LM ircraft Owner/Operator lotline (Describe in summary)				у)		O Internal Facility Review O Electronically Detected O Other (Describe in summary)		
	Brasher warning given? Yes No Training in progress? Yes No																
TERRAIN/OBSTRUCTION MORS																	
M/	C1. MOR type - improper/unexpected operation of MVA							_	O MOCA O MCA					n involving (select one): Other (describe in summary)			
C2. Aircraft information:																	
Aircraft	Aircraft ID Aircraft Ty			Туре/	Type/Suffix IFR/			com		icility immunicating th A/C			Positio with A/	n communicating C	Frequency		
	EVA01	5			B77\	N		0	VFR		SC	Т			MANRR		
C3. Occurrence location:				С	C4. Required altitude:						C5. Observed altitude:						
LAX 035/021											4900						
Describe where the occurrence occurred in relation to a navigational aid or fix (VOR, insersection, localizer, etc.)					Only include observed altitude if provided by the reporting person												

SCT-M-2016/12/16-0002

 SUMMARY
J1. Summary – provide a brief summary for all MORs in this section that will provide enough information for QA to understand what occurred. Include information about items that require additional information in the specific MOR you are reporting.
EVA015 DEPARTED LAX HDG 070. ATCS MISTAKENLY TURNED A/C 'LEFT HEADING 180' RATHER THAN RIGHT. A/C TURNED INTO POTENTIAL CONFLICT WITH ACA788 AND ATCS STOPPED A/C AT 050. FURTHER MISCOMMUNICATION OCCURRED AND A/C FLEW INTO HIGH TERRAIN AT 050.

SCT-M-2016/12/16-0002

	SEPARATION												
	Was this a loss of separation?												
		Applicable Separation Rule:											
	Yes O No	5-6-1											
	Separation Used: Course Divergence	MARSA Mode C Interlace	Opposite	e Course (Report	Passing) Other Facility								
	O Procedure/Waiver	Report/Observe Leaving Altitude	O Terminal Transition O Tower Visual Separation										
	O VFR Aircraft	O Visual Approach	O Visual S	Separation	O Other								
	RISK ANALYSIS												
	Was this a Risk Analysis Event?												
	O Yes No	RAE Score:											
		PILOT DEV	IATION										
	Was this a possible pilot de	is a possible pilot deviation?											
	O Yes No	Preliminary Number:											
	SURFACE EVENT												
	Was this a possible Surface Event?												
	O Yes O No	Classification:											
	VEHICLE/PEDESTRIAN DEVIATION												
	Was this a possible Vehicle/Pedestrian Deviation?												
	O Yes O No	Preliminary Number:											
	NMAC												
	Was this a NMAC?												
	O Yes O No	NMAC Number:											

SCT-M-2016/12/16-0002								
QA SUMMARY								
An analysis of the event was completed by reviewing the Voice Data and Falcon Playback. Separation was lost with MVA/terrain.								
EVA015 departed LAX in an east flow configuration and contacted SCT MANR departure sector. SCT MANR controller issued EVA015 an initial turn to the right heading 090 followed by a left turn to a heading of 180. The pilot acknowledged the wrong direction turn and the readback was not caught by the controller.								
An approval for a high speed climb was given by the SCT MANR controller. FALCON replay indicates the ground speed of the aircraft increased approximately 70 knots. It is unknown if the crew accelerated the aircraft above 250kts as strong winds were noted in the area.								
The controller observed EVA015 tracking northbound and issued alternative heading and altitude instructions to prevent a loss with an Air Canada departure. The instructions were confusing to the EVA015 crew who made a number of attempts to clarify but went unanswered. The MSAW software triggered an alarm as EVA015 entered an area of high terrain well below the depicted MVA altitude. An adjacent sector made an effort to raise the MANR controllers attention to the higher MVA's without success. EVA015 entered a 7800 MVA at 5000 with the MSAW alarm triggered.								
EVA015 eventually exited the 7800 MVA on a southerly heading and continued on course without further incident.								
B. Johnson 12/22/2016								