

AERONEF - AIRCRAFT

1. Marques de nationalité et d'immatriculation

N328GG
N701TB

1. Nationality and Registration Marks

2. Classification

Catégorie
Category :

See Airworthiness Certificate

2. Classification

Annotations - Mentions d'emploi : None
Subdivision :

3. Type de l'aéronef :
Aircraft type :

SOCATA TB 21

N° de série
Serial No

: 2025

4. Construction par
4. Maker, place and date of construction

: SOCATA

le on à at TARBES

Livret établi à
Log Book established at
(Place and Date)

TARBES

le on 22 DEC. 2000

SOCATA
DIRECTION QUALITE
QUALITY DIRECTOR

Signature et Cachet
Stamp and Signature



SERVICE DE L'ARONEF - AIRCRAFT RECORD

Détails vérif

The New AVEX, Inc.

Particulars

205 Dunley Avenue, Suite A, Camarillo, CA 93010 (805) 399-1188 FAX (805) 399-3323

Work Order: 3455

Schema TS-21

Tech: 123.4

Hobbs:

TSN:

TLSN:

1. Complied with SP-10-124 by replacement of sea door hinge screws with new P/N: TB10 091210000.

2-4/01
Date

utc réparateur

utrice en service

art of overhaul

ce release

N707TB BEGoodrich WX500 Stormscope displayed on KMD590. See 937 dated July 30, 2001 for details. Equipment installed and ground checked in accordance with manufacturer's installation manual and AC43-13-1B and AC43-13-2A.

This aircraft was inspected in accordance with applicable maintenance rules and current FAA Regulations. With regards to this work performed, this aircraft is approved for return to service.

FAA Repair Station YA2R312L

ABLE AVIONICS
16844 Roscoe Blvd,
Pico Rivera, CA
(818) 779-4

Paul B. By

Date

7/30/01

N707TB Panasonic CX-DV1900E/C DVD Player in co-pilot's panel. Installed 2 as per work order 2001 for details. Equipment installed and ground checked in accordance with manufacturer's installation manual and AC43-13-1B and AC43-13-2A.

This aircraft was inspected in accordance with applicable maintenance rules and current FAA Regulations. With regards to this work performed, this aircraft is approved for return to service.

FAA Repair Station YA2R312L

ABLE AVIONICS
16844 Roscoe Blvd,
Pico Rivera, CA
(818) 779-4

Paul B. By

7/30/01

SERVICE DE L'ÂÉRONEF - AIRCRAFT RECORD

Dates	Temps de vol depuis la précédente opération d'entretien Duration of flight since last maintenance operation	Heures totales Hours since manufacture	Heures depuis l'entretien majeur Hours since major maintenance	Nombre d'atterrissages Number of landings	Moif de l'entretien Maintenance motive
	<p>The New AVEX, Inc. C.R.S. X11R595Y 205 Durley Avenue, Suite A, Camarillo, CA 93010 (805) 389-1188 FAX (805) 389-3323 AIRFRAME Socata TB-21 S/N: 2025 N328CG Work Order: 3520 Date: 4/5/02 Tachs: 144.5 Hobbs: TTSN: 144.5 TLSN:</p> <ol style="list-style-type: none">1. Accomplished annual inspection in accordance with Socata maintenance manual.2. Complied with AD 2001-23-04 by inspection of rudder hinge fitting. No defects noted at this time.3. Previously complied with AD 2001-23-05. No further action is required.4. Complied with S.B. 10-124 by replacement of upper door hinge screws with 2ea. new PN: TB10 0911210000 & 6ea. new PN: TB10 0911210100.5. Complied with S.B. 10-126 Exhaust pipe modification.6. Complied with S.B. 10-119 by replacing nose gear fork with new PN: TB20 42024100 & new locknuts PN: 200.N5401458376, 200.N5402453376 & 200.N5413221080.7. Accomplished 12 Month certification of the E.L.T. per FAR 91.207(d). Model ELT 200, S.N. E02380.8. Replaced landing light bulb with new PN: 200.N603407223. <p>This aircraft, airframe, aircraft engine, propeller or appliance was repaired/inspected in accordance with the current Federal Aviation Regulations and is approved for return to service. Pertinent details of the repair are on file at this Repair Station under Work Order No. 3520.</p> <p>[Redacted] 4-5-02 Date</p> <p>For: FAA Approved Repair Station # X11R595Y</p>				

Détails véri

Particulars

SERVICE DE L'AÉRONEF - AIRCRAFT RECORD

Détails vérifications et travaux entretien - Révisions partielles ou générales

Modifications - Essais en vol

Particulars of inspections and maintenance - Minor or major overhauls

Modifications - Test flights

Cachet - Signature réparateur

Approbation pour remise en service

Stamp and signature of overhauler

Maintenance release

The New AVEX, Inc. C.R.S. X11R595Y

205 Durley Avenue, Suite A, Camarillo, CA 93010 (805) 389-1188 FAX (805) 389-3323

AIRFRAME

Socata TB-21

S/N: 2025

N328CG

Work Order: 3651

Date: 5/3/02

Tach: 178.05

Hobbs:

TTSN: 178.1

TLSN:

1. Replaced L/H main tire with new PN: 301-249-420 SN: 12111178.

2. Replaced R/H & L/H brake linings with new PN: 066-10600 & H/Vets PN: 105-00200 in accordance with Socata maintenance manual.

This aircraft, airframe, aircraft engine, propeller or appliance was repaired/inspected in accordance with the current Federal Aviation Regulations and is approved for return to service. Pertinent details of the repair are on file at this Repair Station under Work Order No. 3651.

For: FAA Approved Repair Station # X11R595Y

Date

5-3-02

Numero - Number

L - 10523 - 61A

Marque - Make

LYCOMING

Type

TIO-540-AB1AD

Construit par :
Maker

LYCOMING

le : 2000
the

Documents présentés :
Records submitted

EXPORT CERTIFICATE OF AIRWORTHINESS N° E 358776 DU 29 04.2000
FEUILLE D'ESSAIS AU BANC DU 14.03.2000

Rappel des heures de fonctionnement
Record or running time

Depuis fabrication : 1 H 25
Since manufacture


Depuis révision : S R
Since Overhaul

Livret établi à : **TARBES**
Log Book established at
(Place and Date)

le : **22 DEC. 2000**
the

SOCATA
DIRECTION QUALITE
QUALITY DIRECTOR

Signature et Cache
Stamp and Signatu

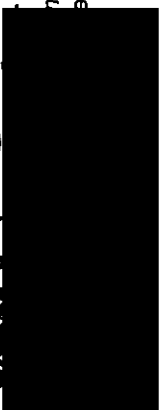

AGREEMENT PRODUCTION JAR 21 N° F.G.027. - MANUFACTURING AGREEMENT JAR 21 N° F.G.027.



ard-
ries,
and
tion
ms.
ing
and
r of
e of

per-
ver-
page



TYPE ET N° (Aéronef) - Type and Serial Number of Aircraft :

<p>Dates Date</p>	<p>Détail travaux entreteien - Dégroupages - Revisions parties ou générales - Modifications - Stockage moteur et accessoires Particulars of maintenance, Top or Complete Overhaul, Repairs, Replacements, Modifications, including records of periods when engine and accessories are inhibited</p>	<p>Cachets - Signature - Réparateur Organisme de contrôle Commercial Stamp and Signature of Overhauler and Controlling Authority</p>
-----------------------	---	--

The New AVEX, Inc.

 
205 Durlay Avenue, Suite A, Camarillo, CA 93010 (805) 389-1188 FAX (805) 389-3323

ENGINE Lycoming TIO-540-AB1AD S/N L-10523-61A N328CG

Work Order: 3520 TTSN: Date:

Tach: Hobbs: 141.5 TCSN: TSO: CSO:

1. Removed engine, Model # TIO-540-AB1AD, S/N L-10523-61A from N328CG & shipped to Lycoming for repair.





Date

TEXTRON Lycoming

652 Oliver Street
Williamsport, PA 17701

03/12/02 Engine s/n L-10523-61A was removed from service with 141.5 TT and returned to Textron Lycoming for inspection/repair due to the paint peeling. Engine was disassembled, cleaned, paint removed, and inspected. Cylinders #1, 2, 3, & 5 were honed replacing exhaust valves. Engine was reassembled replacing the #4 and 6 cylinders including valves, springs, and (7) tappets. Also replaced were all crankshaft bearings, piston rings, hardware necessary for the repair, and all perishable items. Engine was tested in accordance with Textron Lycoming specifications and is determined to be in an airworthy and safe operating condition. Additional service bulletins and instructions compiled with 240R, 342D (93-02-05), 475B (91-14-22), SI 1267G, 1410, 1424, 1487. All pertinent data relating to this work is on file at Textron Lycoming under work-order CR02031

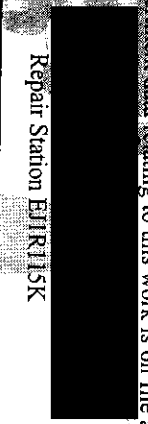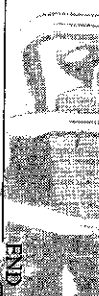


Repair Station EIRISK

Dates Date	Fonctionnement Time run				Observations sur le fonctionnement du moteur et accessoires Observations on the running of Engine and Accessories
	Partiel / Partial	Total depuis neu Total since new	Depuis R.G. Since last O/H		
H	Cycles*	H	Cycles*	H	Cycles*
Report Brought forward	<p>The New AVEX, Inc. C.R.S. X11R595Y 205 Durley Avenue, Suite A, Camarillo, CA 93010 (805) 389-1188 FAX (805) 389-3323</p> <p>ENGINE Lycoming T1O-540-AB1AD S/N L-10523-61A N328CG Work Order: 3520 TTSN: 144.5 Date: 4/5/02 Tach: 144.5 Hobbs: TCSN: TSO: CSO:</p>				
					<ol style="list-style-type: none"> Removed engine, Model # T1O-540-AB1AD, S/N L-10523-61A from N328CG & shipped to Lycoming for repair. Re-installed engine model T1O-540-AB1AD SN: L-10523-61A after repair by Lycoming factory. Ran, leak checked, all Ops good. Accomplished annual inspection in accordance with Socata maintenance manual. Changed engine oil & oil filter. Serviced with Aeroshell 100W50 & CH48104 filter. Complied with AD 93-02-05 by inspection of engine fuel injector lines. No defects noted at this time. <p>This aircraft, airframe, aircraft engine, propeller or appliance was repaired/inspected in accordance with the current Federal Aviation Regulations and is approved for return to service. Pertinent details of the repair are on file at this Repair Station under Work Order No. 3520.</p> <p style="text-align: right;">Date: <u>4-5-02</u></p>
	<p>The New AVEX, Inc. C.R.S. X11R595Y 205 Durley Avenue, Suite A, Camarillo, CA 93010 (805) 389-1188 FAX (805) 389-3323</p> <p>ENGINE Lycoming T1O-540-AB1AD S/N L-10523-61A N328CG Work Order: 3666 TTSN: 191.6 Date: 5/16/02 Tach: 191.6 Hobbs: TCSN: TSO: CSO:</p>				
	<ol style="list-style-type: none"> Changed engine oil & oil filter. Serviced with Aeroshell 100W50 & CH48104 filter. <p>This aircraft, airframe, aircraft engine, propeller or appliance was repaired/inspected in accordance with the current Federal Aviation Regulations and is approved for return to service. Pertinent details of the repair are on file at this Repair Station under Work Order No. 3666.</p> <p style="text-align: right;">Date: <u>5-16-02</u></p>				
A reporter Carried forward					Dates Date

* Cycles : voir définition Constructe

For: FAA Approved Repair Station # X11R595Y

Date

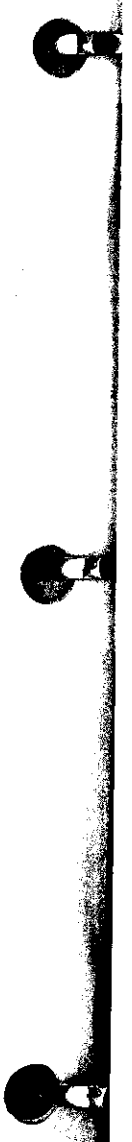

HARTZELL

PROPELLER LOGBOOK

PROPELLER MODEL HC-3YR-1-RF

PROPELLER S/N DY 4751B

LOGBOOK # 1

PROPELLER MAINTENANCE RECORD

Position _____

Propeller Model HC-83YR-1-RF

Propeller S/N DY4751B

Blade Design F7693F

Blade S/N's

No. 1 J50305

No. 2 J50306

No. 3 J50310

No. 4 _____

No. 5 _____

No. 6 _____

Spinner Assembly Part No. _____

PITCH RANGE

High/Feather _____

Start Lock _____

Low _____

Reverse _____

Aircraft Manufacturer _____

Aircraft Model _____

S/N _____

Registration _____

CHECK
SECTION AND

MAINTENANCE
PRACTICES

ANTI-ICE AND DE-ICE
SYSTEMS

RECORDS

Description of all operations pertaining to Airworthiness Directives,
Service Documents, Overhaul, Major or Minor Repair, and Inspections.

Date
Propeller TSN TSO AC Hrs

The New AVEX, Inc. C.R.S. X1IR595Y

205 Durley Avenue, Suite A, Camarillo, CA 93010 (805) 389-1188 FAX (805) 389-3323

PROPELLER Hartzell HC-C3YR-1RF

S/N DY4751B N328CG

Work Order: 3520

Date: 4/8/02

Tach: 144.5

Hobbs:

TTSN:

TSO:

5 RM

1. Accomplished annual inspection in accordance with Socata maintenance manual.

This aircraft, airframe, aircraft engine, propeller or appliance was repaired/inspected in accordance with the current Federal Aviation Regulations and is approved for return to service. Pertinent details of the repair are on file at this Repair Station under Work Order No. 3520.

For: FAA Approved Repair Station # X1IR595Y

Date

4-5-02

Date	Propeller TSN	TSO	AC Hrs	Description of all operations pertaining to Airworthiness Directives, Service Documents, Overhaul, Major or Minor Repair, and Inspections.

