## INSPECTION RECORD F.A.R. 43.11-91.409

DATE	AIRCRAFT TIME IN SERVICE SIGNATURE — CERT. NO. OF PERSON APPROVING OR DISAPPROVING AIRCRAFT FOR SERVICE		5 & DISCREPANCY LIST OR DISAPPROVING AIRCRAFT FOR SERVICE
12.00			
Service Control	MAKE: Cirrus Design Corp MODEL: Sr22 S/N: 2863	Lone Mountain Aircraft Maintenance	DATE: 12/20/2017 A/C TSN: 875.1 TACH: 847.6
	REG. NO: N670SR WORK ORDER: 1616-10-2017	Lebanon, Ohio 45036 Phone:	
	Airframe Entries		
	(1) Complied with the airframe annual inspection according to the manufacturers maintenance manual. Serviced all wheel bearings Serviced fuel gaskolator. Comply with FAR 91.207 ELT inspection. Inspected fire bottle. Serviced hydraulic fluid. Serviced tire pressures. Serviced #1 ship battery. Serviced #2 ship battery. Installed new induction air filter. Researched S8I's and complied with all applicable ADs (4) Complied with TAT S8109-01, inspected exhaust for cracks (5) TAT S810-01 alternate air inspection has been previously complied with, hinge pin is welded and requires no action (6) TAT S810-02 has been previously complied with, no cracks noted in tailpipe hangers at this time (8) Complied with TAT SI08-04 leak check of cabin heat augmenters, no leaks note at this time (12) Removed and replaced intake air filter (14) Removed rod assembly connecting wastegates and replaced with cable assembly IAW Tornado Alley Turbo report 22-6460007. Ran engine turbo sys. operating correctly at this time (15) Removed and replaced with new, rubber aft NLG seal (16) Resecured heat blanket on R/H lower engine cowl (18) Oxygen bottle Hydrostatic Test and Regulator Test by Precise flight on work order 99555. Next due on 12/2022 (19) Complied with S82X-27-16R2 mod to prevent asymmetric flap and flap over extension (20) Removed and replaced pilots cup holder (21) Removed and replaced #2 batteries. Next replacement due 10/2019 (22) Removed and replaced TKS filter, Leak checked good (23) Complied with pilot static 24 month recertification (25) Complied with S82X-95-24. CAPS rocket shelf ground wire installation (26) Performed S82X-28-12R Electric Fuel Pump Inspection, No defects noted at this time (27) Performed S82X-95-12 CAPS line cutter rigging illustration error (29) Performed S82X-28-11R3. Fuel line replacement (31) Removed and replaced sale an antennas (32) Removed and replaced adel clamps (34) Removed and replaced TKS tank drain valve (35)		cable ADs (4) Complied with TAT SB109-01, with, hinge pin is welded and requires no action (8) Complied with TAT SIO8-04 leak check of cabin wed rod assembly connecting wastegates and ting correctly at this time (15) Removed and (15) Oxygen bottle Hydrostatic Test and Regulator mod to prevent asymmetric flap and flap over Next replacement due 10/2019 (22) Removed (25) Complied with SB2X-95-24, CAPS rocket is noted at this time (27) Performed his time (28) Performed SB2X-95-12 CAPS line old sealant and resealed 3 ea antennas (32) (3) Removed and replaced slave waste gate (36) ess Manual Report 22-6460004, None at this formed compass swing (39) Ran TKS system
-	regulations and has been de	termined to be in an airworthy condition. END	anufacturers maintenance manual and current FAA
	DATE: 12/20/2017	SIGNED?	Work Order: 1616-10-2017
1 /2		Tony McBer	Printed by EBis 3 (datcomedia.com)
1,52%	1		
	1000 1000 20	THE RESERVE TO A PROPERTY OF THE	The state of the s
			The second secon

zy old-id-