





New Reciprocating Engine Certificate

This is to certify that the engine as described hereinafter has been manufactured and ground operation tested as prescribed by Lycoming specification and Federal Aviation Regulations. All applicable Federal Aviation Airworthiness Directives applicable Lycoming Service Publications have been complied with at time of manufacture. Refer to enclosed Form ET001 for applicable accessory part numbers and serial numbers.

Part Number:	ENPL-RT10477
Serial Number	L-20559-39E
Engine Model	0-320-D3G
Work Order	AR568832
Total Time	0 New

Form 777C Rev 05/13

Authorized Representative

Production Certificate #3 652 Oliver Street Williamsport, PA 17701 U.S.A Lycoming Engines is a division of Avco Corporation Form FAAR (REV.02/11)

652 Oliver Street

Page 1 of 1

Airworthiness Directive Compliance List

s been Lycoming 2 Federal 2 Publications 4 Publications 4 Publications 4 Publications 4 Publications 4 Publications

Engine Model No: 0-320-D3G

(HOMANG

Williamsport, PA 17701 U.S.A.

Sign for AD's Coded 1 (Applicable to Engine Model)

AD No. / Rev	SB / rev	Description /	L-20559-39E	Jun 24, 2	013
55-02-02		IMPROPER ACCY ADAPTER GASKET	Method of Compliance	Next Due	Code
59-10-07	254 / A-Ina	CYLINDER BAFFLE CLAMPS	PROPER GASKET INSTALLED	N/A-Once	1
63-23-02	293 / B		BAFFLE HOOKS INSTALLED	N/A-Once	1
		INSP EXHAUST VALVES, INSTALL NEW CAMSHAFTS	INSTALLED NEW PARTS	N/A-Once	1
64-16-05	298 / Inacti	AC FUEL PUMP OIL SEAL	NEW CONF. FUEL PUMP INSTALLED		
66-20-04	307	OIL FILTER ADAPTER GASKET	NEW CONF. GASKET INSTALLED	N/A-Once	1
87-10-06 / R1	477 / A	INSPECTION AND REWORK OF LW-18790 ROCKER ARM ASSY	NEW CONFIGURATION P/N INST.	N/A-Once N/A-Once	1
92-12-05	501 / B	LW-14077 PISTON PIN	NEW PARTS INSTALLED		-
93-19-04	504	CARBURETOR O/H BY CONSOLIDATED	NEW PARTS INSTALLED	N/A-Once	1
94-06-09	517	INCOMPLETE INTERNAL GROUNDING ON MAG	NEW CARB. / PRECISION FLOAT	N/A-Once	1
	and the second	CAPACITORS	NEW CONF. CAPACITORS INSTALLED	N/A-Once	1
96-09-10		REPLACEMENT OF OIL PUMP IMPELLERS	STEEL IMPELLERS INSTALLED	N/A-Once	1
97-15-11	527 / C	RECALL OF PISTON PIN P/N LW-14077	NEW CONFIGURATION P/N INST.	N/A-Once	1
98-01-06	498 / B	ONE PIECE VENTURI	NEW CONFIGURATION CARBURETOR		1
98-02-08	530 / B	INSPECTION OF CRANKSHAFT ID FOR CORROSION	MAG INSP./APPLY URETHABOND 104	N/A-Once	1
2004-10-14	475 / C	CRANKSHAFT GEAR MODIFICATION AND ASSY PROCEDURES	NEW P/N INSTALLED	N/A-Once	1
73-23-01	367 / F	INSP FOR CRACKS IN PISTON PINS	INST NEW PARTS	N/A-Once	2
77-07-07		OIL LEVEL GAGE ASSEMBLIES	INSTALLED PERFORATED SLEEVE	N/A-Once	2
7-20-07	424 1	HYDRAULIC TAPPET REPLACEMENT	NEW P/N INSTALLED	N/A-Once	2
78-12-08	423	OIL PUMP INSPECTION AND IMPELLER REPLACEMENT	NEW P/N INSTALLED	N/A-Once	2
78-12-09	422 / A	CRANKSHAFT ASSEMBLY REPLACEMENT	NEW P/N INSTALLED	N/A-Once	2
78-23-10	428	BENDIX FUEL INJ. BULLETIN RS-42	NEW P/N INSTALLED	N/A-Once	2
79-04-05		BENDIX FUEL INJ. BULLETIN RS-57	NEW P/N INSTALLED	N/A-Once	2
79-10-03 / R2	Care and an	ENGINE MOUNT TORQUE	FIELD COMPLIANCE	N/A-Once	2
80-04-03 / R2		DIL ADDITIVE	DRY SUMP DELIVERED	WHEN OIL INST.	2
80-04-03 / R2	435 F	REPLACEMENT OF UPPER EXH. SPRING SEAT &	NEW P/N'S INSTALLED	N/A-Once	2
80-14-07	447 / B I	NSPECTION OF UPPER EXH. VALVE SPRING SEATS	PART W/CURVED P/N INSTALLED	N/A-Once	2
90-04-06 / R1	488/A F	PROPELLER GOVERNOR LINE SUPPORT	NEW LINE W/STEEL CON. NUTS INS	N/A-Once	2
95-26-02		ENGINES OPERATED WITH LOW OCTANE FUEL	ENGINE IS NEW OR HAS BEEN REBUILT AT MANUFACTURER	N/A-Once	2
2002-12-07		DIL FILTER CONVERTER PLATE GASKET	NEW P/N CONVERTER PLATE	N/A-Once	2

ate #3 A 17701 U.S.A Co Corporation OWNER

NAME	ADDRESS	Installed in Aircraft No. Date
1		N706GS
2		GEP 1"
3		
4		
·		


If this book is found, please return it to the owner.


ENGINE DESCRIPTION	
Manufacturer: LYCOMING, WILLIAMSPORT, PA	Serial No. <u>L-20559-39E</u>
	Horsepower: 160
Model: 0-320-D3G	FAA T. C. No. E274

Engine Accessories	Serial No.	Weight
		1

٠٧٥

ty.

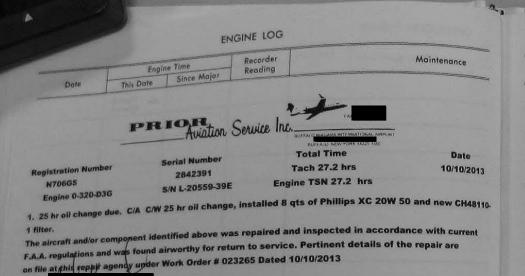

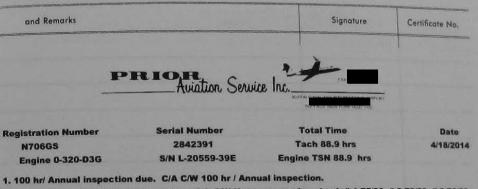

2. Hot cylinder compression check due. C/A C/W Hot compression check # 1 75/80, # 2 78/80, # 3 76/80 and # 4 74/80.

3. Oil change due. C/A Inspected oil filter, installed new CH48110-1 filter and 8 gts of Phillips XC 20W-50. The aircraft and/or component identified above was repaired and inspected in accordance with current F.A.A. regulations and was found airworthy for return to service. Pertinent details of the repair are on file at this repair agency under Work Order # 023591 Dated 4/18/2014

Signed

V For Prior Aviation Service Inc. Certificate No. BIOR473C 50 N. Airport Drive. Buffalo NY

For Prior Aviation Service Inc. Certificate No. BIOR473C

Signed

Total To Carry Forward

50 N. Airport Drive. Buffalo NY

NIA-On

1813 2

