


PRODUCT CODE	QTY.	PART NO.	DESCRIPTION	PRICE	TOTAL
013235	1	AN900-10	Gasket		
170030	11	M674	Gasket		
012445	10	MS24693550	Screw		
012200	9	AN526-832RB	Screw		
012980	4	MS203922C33	Clens Pin		
012290	1	AN507-10RB	Screw		
012050	1	MS35214-H2	Screw Brass		
1100035	1	CH48109-1	Filter		
153303	1		oil analysis kit		
016050	1	MS24693550	S/S screw		
355000	11	20W50	Phillips oil		
012235	2	AN526-832RB	Screw		
010405	1	QS200-M2BH	Clamp		
100036	4	66-105	Wings		
100005	8	105-00200	Rivets		
013445	1	MS15002-1	Grease Zerk		
910022	1	BP1020	ELT Battery		
012220	3	AN526-832RB	Screw		
011685	3	AN4-5A	Bolt		
010790	3	AN970-4	Washer		
010785	2	AN970-3	Washer		
910028	1	BA7112	Bracket filter		
910029	2	W42502	Gasket		
013185	2	AN960-416	Washer		
010468	6"	3/8 spiral cut	cable wrap (w/ft.)		
210095	2	6g BT	Oxygen		
910012	1	BT 24/3	Battery Tender		
350000	1	Gal	Solvent		
001615	1		Sleep Supplies		
freight:					
		ELT Battery			
		Battery Tender			
		Bracket filter			
		gaskets			

DAVID

FLYING SERVICE INC.
 10800 Airport Road • Dubuque, IA 52003 • (563) 582-1293

WORK ORDER NUMBER
No 71943

DATE **1/24/2006**

N **30799**

AIRCRAFT TIME **505.5** Holds

MODEL # **B36TC**

SERIAL # **EA469**

AIRCRAFT TYPE **Beechcraft**

CUSTOMER **Newt Marine Service /**

ADDRESS **Gary Newt**

CITY _____

STATE _____ ZIP _____

CODE **Charge** R **(NR)** B

HOURS	SERVICE PERFORMED	AMOUNT
	1 Complied with Annual Inspection	
	2 Changed oil & filter, added 11 Qt. Phillips 20W-50 oil.	
	3 Inspected oil filter for metal.	
	4 Took engine oil analysis sample.	
	5 Secured exhaust shield on #2 intake tube.	
	6 Secured clamp on exhaust shroud.	
	7 Removed muffler assy. Insp for leaks with air press.	
	8 Reinstalled with new exhaust flange gaskets.	
	9 Removed Engine driven alternator, greased shaft bearing	
	10 with Chevron SRI #2 grease and reinstalled.	
	11 Replaced left Brake Linings.	
	12 Replaced ELT Battery. Clw YAK 91.207(d) Insp. ELT Kadir	
	13 Secured right elevator trim Tab Rod Bolt.	
	14 Secured left MLG door rod bolt.	
	15 Secured right MLG up-lock return spring.	
	16 Secured Oseal on baggage door.	
	17 Un-plugged right outboard fuel vent tube.	
	18 Secured shroud damper attach bolt.	
	19 Serviced both oxygen bottles to 1800 psi.	
	20 Charged up aircraft battery.	
	21 Replaced battery box attach bolts.	
	22 Installed battery charger wiring harness to battery posts.	
	23 91W AD 76-7-12 Insp. ignition switch.	
48.8	TOTAL HOURS @ 54.00	PER HOUR

*Thank you!
Don*

LABOR	
PARTS	
SUBTOTAL	
TAX	
FREIGHT	
TOTAL	

INSP.

HIDDEN

DAMAGE

PROG.

INSP

FINAL INSP

I CERTIFY THAT THIS HAS BEEN REPAIRED AND INSPECTED IN ACCORDANCE WITH CURRENT FAA REGULATIONS AND IS APPROVED FOR RETURN FOR SERVICE WITH RESPECT TO THE WORK PERFORMED.

DETAILS OF THIS REPAIRS ARE ON FILE UNDER WORK ORDER

DATE **1/24**

INSPECTED BY _____ FAA CERT. _____

Cliff's Printing Sales - Dubuque, IA 52003 - Ph. 563-566-1318 303064-DR

12/21/2006 THU 14:05 FAX 563 582 1294