

ANC06FA018

Photo 13



View of inlet fan. Note damage to leading edges.