

ANC06FA018

Photo 14



Closer view of damaged inlet fan.