Page No. ———————————————————————————————————	FORMED - N PERFORMING WORK
2615 Lantana Rd. Suite A. Lantana, Fla. 33462 561-304-1491 Date: 10/27/2014; Aircraft: N771MM; Type: ROBINSON R22; S/N: 2644; Tach: 1878.60; Total	
Time: 4062.80; Engine - Type: O-320-J2A, S/N: L-35128-36A, Time: 4062.80 1. 50/100 hour inspections per Robinson and Lycoming maintenance manuals and Lycoming SI-1080C, SI-1129B, SI-1191A. Completed compression check #1 70/80 #2 79/80 #3 80/80 #4 80/80 Cleaned, gapped, tested and rotated all spark plugs. Checked magneto timing.	
#4 80/80 Cleaned, gapped, tested and rotated all spark plugs. Checked magneto triming. Cleaned engine air filter. 2. Lycoming SB-301B, Inspected rockers covers for evidence of wear and damage, rotated engine by hand inspecting all cylinders for normal valve lift and rocker arms operate freely.	
Next inspection due at engine total time: 4362.8, and tach time: 2178.6. 3. Lycoming SB-388C exhaust valve inspection. Next due at engine total time: 4362.8 and tach time: 2178.6.	
 Lycoming MSB-366B Dated 4/18/2008 Carburetor Throttle body Screw Inspection. No defects found, Next Due Tach: 1978.6. C/W Lycoming SB480E Oil Change and screen cleaning. Serviced with 5 quarts Phillips 	
100AW oil. Next Due aircraft total time: 4112.8. 6. FAA AD Bi-weekly check through 2014-21 dated 10/19/2014 & Robinson Service Bulletins through SB-110 checked online.	
Next 100 hour Engine inspection due at Tach: 1978.6. Operation and leak checks satisfactory. Tasks performed by John Evans & Casey Rice. I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH THE MANUFACTURERS 100/300 HOUR INSPECTIONS AND WAS DETERMINED TO BE IN	
AIRWORTHY CONDITION. Palm Beach Helicopters, 2615 Lantana Rd, Suite A, Lantana Fl. 33462	
Palm Beach Helicopters Robinson Authorized Service Center 2615 Lantana Rd. Suite A. Lantana, Fla. 33462 561-304-1491	·
Date: 11/15/2014; Aircraft: N771MM; Type: ROBINSON R22; S/N: 2644; Tach: 1925.10; Total Time: 4109.30; Engine - Type: O-320-J2A, S/N: L-35128-36A, Time: 4109.30	
SN: E12KA040R & PN 10-600644-201 SN: E12k 4364 T3123 due to LH Mag failure. 2. installed TSi: 0.0 Mags PN 10-600614-1 SN: E08AA221 & PN 10-600644-201 SN: 2. installed TSi: 0.0 Mags PN 10-30484 10/31/2014 WO# T3526 provided by Tropic Airpower.	
Next 500 hour inspection due at 2200 floor engine of order and the second secon	
Date: 11/17/2014; Aircraft: N771MM; Type: ROBINSON R22; S/N: 2644; Date: 0.320-Jan. Telel Time: 4113 20: Engine - Type: O-320-J2A, S/N: L-	
Tach: 1929.00; Total Time: 4113.20	
C/W Lycoming 50 hour engine inspectation. C/W Lycoming SB480E Oil & Filter Change. Serviced with 5 quarts C/W Lycoming SB480E Oil & Filter Change. Serviced with 5 quarts C/W Lycoming 50 hour engine inspectation. Phillips 100AW. Next Due Aircraft total time (AFTT): 4163.2 Operation.	
Phillips 100AW. Next Due Aircraft total time (APT1). The state of the	
· · · · · · · · · · · · · · · · · · ·	· ·

			Page No.
DATE	TACH OR RECORDING METER TIME	DESCRIPTION C SIGNATURE & CERTIFICATE	
			manuals and Lycoming SI-1080C, SI-1129B, SI-1191A. Completed compression check #1 70/80 #2 76/80 #3 80/80 #4 80/80 Cleaned, gapped, tested and rotated all spark plugs. Checked and adjusted magneto timing. Cleaned engine air filter. 2. Lycoming MSB-366B Dated 4/18/2008 Carburetor Throttle body
			Screw Inspection. No defects found, Next Due Tach: 2078.6. 3. C/W Lycoming SB480E Oil Change and screen cleaning. Serviced with 5 quarts Phillips 100AW oil. Next Due aircraft total time: 4212.9. 4. C/W FAA AD Bi-weekly check through 2014-24 dated 11/30/2014 & Robinson Service Bulletins Through SB-110 checked online. 5. Removed RH Magneto PN 600644-201 SN: E071A084 TSI: 53.6 6. Installed RH MAgneto PN 600644-201 SN: E07CA360 TSO: 0.0 from N474AT OH Engine,. Next 100 hour Engine inspection due at Tach2078.6.
			Operation and leak checks satisfactory. Tasks performed by John Evans & Casey Rice. I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH THE MANUFACTURERS 100 HOUR INSPECTION AND WAS DEFERMINED TO BE IN AIRWORTHY CONDITION. Luis F. Aviles AP Palm Beach Helicopters, 2615 Lantana Rd, Suite A, Lantana FI. 33462
			Date: 12/12/2014; Aircraft: N771MM; Type: ROBINSON R22; S/N: 2644 Tach: 2028.40; Total Time: 4212.60; Engine - Type: O-360-J2A, S/N: L- 35128-36A, Time: 4212.60 C/W Lycoming 50 hour engine inspection. Lower plugs cleaned, tested. C/W Lycoming SB480E Oil & Filter Change. Serviced with 5 quarts Phillips 100AW. Next Due Aircraft total time (AFTT): 4266.6. Operation and leak checks satisfactory. Task performed by Casey Rice. Ronald M. Geiser: AP Palm Beach Helicopters, 2615 Lantana Rd, Suite A, Lantana Fl. 33462
			Rd, Suite A, Lantana Fl. 33462
	1	j	ı