## Factual Report – Attachment 8 N933DC Maintenance Log Page

## OPERATIONAL FACTORS

CEN17FA168

## AIRCRAFT MAINTENANCE LOG

No: DISCREPANCY	CORRECTIVE ACTION
By: Koby Shaw Date: 12-20-11 MEL ATA: 34	Mechanic: Cert. No.:
Location: KAMA Aircraft Time: 3681.0	Date: /2-22-/6 Work Order: —
Detened LAW MEL 34-2	Found pitot line fell behind 2nd out board
RIH AIRSPERD INDP	flop block. Resecuted line with Ziptics away
REDZIR CATE B	from block. Hobbs : 3687.9
	Personal Republication of the Control of the Contro
	RVSM Status: Co. No. Sec. No. Applicables
No: DISCREPANCY	CORRECTIVE ACTION
By: Rober 5/4W Date: 12-21-16 MEL ATA: 22-	Mechanic: Cert. No.:
Location: KIBB Airoraft Time: 3687.5	Date: 12-22-16 Work Order:
AID ENOP	Inspected Inverter conections, cleaned & resecuted
	no further Problem Observed. Hobbs: 3682,9
RSPZIR CAT: C	
	RVSM Status: No GO No Not Applicable
No: DISCREPANCY	CORRECTIVE ACTION
By: Scott Atwood Date: 4-26-17 MELATA: 22	Mechanic: Cert. No.:
Location: KAMA Aircraft Time: 3810.5	Date: 4/27/17   Work Order: 7667
AIP. INOD: Autopolot Kicks OFF IN	Romared trim adapter PN: 065-00164-0100 S/N: 1745
Flight	Installed trim adapter PN: 065-00164-0100 SN: 1794
BEDair Cot & C	Functional check good at this time in Accordance
Expris 5-6-17	with Pilatus Pciz MM 22-10-07
	RVSM Status: GO No. GO Not Applicable
	Date A/C Serial No. A/C M/M A/C Registry
RICO AVIATION Date: November 10 2000	5 Date No. Obttat No. No totally