

Attachment 9

To Operations/Human Performance Group Factual Report

DCA11IA040

Aircraft Log History In Crew Documents

LOG HISTORY FOR AIRPLANE 4709 AS OF 04APR11 1013-Z

2362001 02APR CUN

GRIPE: C6-T18-Y19-D5-D6-F1-Q7 SAMC TEXT: CREW CYCLED CB'S TO
CLEAR CARGO SMOKE DET FAULT AT S AMC DIRECTION. OPBLM
MEYER

ACTION:02APR HIS- :NO FURTHER MAINTENANCE ACTION NEEDED PER
OPBLM - MJ MEYER

1902004 30MAR LAX MEL:2450A

GRIPE: ECAM- CB TRIPPED ON OVHD PANEL - ALL CB-S ARE IN ACTION:30MAR RPL- REF
TSM TASK 31-54-00-810- 925 REPLACED SDAC
1 (1WV1) PER MM31-55-34-401

1852001 29MAR CUN

GRIPE: AEVC FAULT ON ECAM.

ACTION:29MAR ACP- :AVIONICS SMOKE ECAM WAS DISPLAYED . CYCLED
CB'S T18, C06, F1, AND Q7, FAULT CLEARED. OPBLM-FLAMINI -

1812009 29MAR LAX MEL:2450A

GRIPE: HAVE OVERHEAD CB TRIPPED ON OVERHEAD PANEL MEMO
DISPLAYED WITH ALL CB'S IN. SAMC TEXT: CREW COMPLIED WITH

MEL 2450A. OPBLM-FLAMINI

ACTION:29MAR OK - NO MESSAGES ON GND AT LAX, ACCOMPLISHED TSM
31-54-00-810-925,UNABLE TO DUPLICATE,CYCLED ALL CIRCUIT
BREAKERS ON OVERHEAD PANEL ON ATA A TIME,NO MESSAGES.

1772003 28MAR CUN

GRIPE: HAVE OVERHEAD CB TRIPPED MEMO DISPLAY ED WITH ALL CB'S
IN.

ACTION:28MAR ACP- :POWERED DOWN ACFT FOR 5 MIN FAULT STAYED
CLEAR UPON POWER UP. OPBLM-FLAMINI - OPBLM FLAMINI
DOMINIC C

1772002 28MAR CUN

GRIPE: CREW REPORT: AVIONICS SMOKE ECAM NO MRM AVAILABLE ACTION:28MAR ACP-
:CYCLED C6,T18,F1,Q7 FAULT CLEARED .

OPBLM-FLAMINI - OPBLM FLAMINI DOMINIC C

1772001 28MAR CUN MRM:21265

GRIPE: EXTRACT FAULT DISPLAYED ON UPPER ECAM SCREEN. - VENT
CREW COMMENTS: AVINOICS VENT EXTRACTFAULT ON

PARKING.INDICATES CB TRIPPEDON OHEAD-CANNOT FIND ACTION:28MAR ACP-
:DID NOT FIND ANY POPPED CB'S, CYC LED CB'S

D5,D6,Y17,C6,T18,F1,Q7, FAULT CLEARED. RAN TEST OF AEVC
THROUGH CFDS-TEST PASSED. OPBLM-FLAMINI - OPBLM FLAMINI