

Aircraft Components, Inc.



FAA Repair Station K14R311M

SERVICEABLE

Part HEATER Mfg. SOUTH WIND

Part No. 8259GL-1 Serial 388

Remarks MAJOR OVERHAUL AND TESTED

W.O. No. 4655

Date 02-11-94

Inspector

MAINTENANCE RELEASE

The component/accessory identified hereon was repaired and inspected in accordance with current Civil Air Regulations and was found to be acceptable for return to normal service.

Pertinent details of the repair are on file at this agency under:

Work order No. 4655

Date 02-11-94 Signed

Aircraft Components, Inc.



FAA Repair Station K14R311M

AIRFRAME ENTRY N 9DM MAKE: CESSNA
DATE: 10-17-96 HM: 1891.8 MDL: 401
W/O: 76153 TT: 4268.8 SN: 401-0123

29. (67). C/W AD 72-14-08R1 ENG. HOSE INSP. INSTALLED SPIRAL WRAP, REPOSITIONED HOSES AND SECURED.
30. (68). C/W AD 75-23-08R5 ENG. EXHAUST INSP. INSTALLED NEW NUTS (AN310C3), BOLTS (AN3C13), SPRINGS (C21832-2, 1298119-4), AND V CLAMPS (MTV64832).
31. (69). C/W AD 76-02-07 PRESTOLITE ALT.
32. (70). C/W AD 76-13-07. INSTALL. NEW RT & LT MLG FORK BOLTS P/N:5243518-3.
33. (71). C/W AD 78-11-05. N/A BY MODEL & S/N.
34. (72). C/W AD 78-13-05. N/A BY MODEL & S/N.
35. (73). C/W AD 81-09-09. INSTALLED OVH HEATER P/N:8259GL-1, S/N:388. HEATER HOBBS-126.4.
36. (74). AD 87-23-08 N/A. TO BE ACCOMPLISHED AT NEXT CRANKSHAFT REMOVAL.
37. (75). C/W AD 88-03-06. TCM OIL FILTERS NOT INSTALL.
38. (76). C/W AD 89-02-05. N/A EQUIP. NOT INSTALL.
39. (77). AD 89-24-01R1 DUE AT ENG. OVH.
40. (78). C/W AD 96-12-07. N/A IMPULSE COUPLINGS NOT INSTALLED.

END

THE MAINTENANCE IDENTIFIED ABOVE HAS BEEN INSPECTED AND THE ITEM IS APPROVED FOR RETURN TO SERVICE.

WORK ORDER #76153

PAGE 3

SIGNED _____ FOR



EAGLE AVIATION, INC.

EAGLE AVIATION

FAA APPROVED REPAIR STATION # FEHR859D

RATIONS
E NUMBER OF
IFIC ENTRIES)

OR
DING

DESCRIPTION OF WORK PERFORMED—
SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK

brought forward from previous page

9 N9DM Hobbs: 2452.70

side, new upper torque link bushings, P/N 5041017-2, into the right and left main gear
D. Barry Garen A&P/IA

Date: 1/20/2010

N9DM

Hobbs: 2452.9

Removed all panels and uncowl engines, performed a prebuy inspection, installed all panels and cowlings.

Steven Duncan

Date: 2/6/2011

N9DM

Hobbs: 2452.9

Installed a new Gill G244 battery, serviced with electrolyte and charged.

Steven Duncan

15 Jan 2012 N9DM S/N: 401-0123 Hobbs: 2455.5

Performed an annual inspection IAW Cessna Annual/100 hr inspection checklist. Janitrol heater is inop. AD's C/W to this date. All panels removed and reinstalled.

I certify that this airframe has been inspected IAW an annual inspection and was found to be in airworthy condition.

Mike Wilson

SUB-TOTAL this page

TOTAL—Carry forward to next page

South Delta Aviation



Work Order

Date	Work Order#
2/9/2012	M10176

Bill To
Bill Austin [Redacted]

Ship To

Make/Model	S/N	Reg. Number	Tach/Hobbs
C-401	401-0123	N9DM	2457.3

Quantity	Item Code	Description	Price Each	Amount
8.25	LBR	Troubleshoot cabin heater. Found that cause of no fuel to fuel pump was due to no electrical power to fuel safety valve. Found stuck airflow switch, cleaned and heater operated normally. Installed new RH EGT probe (furnished by customer). Checked and found main fuel gauge connection is secure. Sales Tax	[Redacted]	[Redacted]
			[Redacted]	[Redacted]
			Total	[Redacted]