



Photo 12. Stepper motor shaft with the crack visible.