



Photo 2. Cross section of hole #2B, quite close to the location of the drill breakdown, showing similar microstructure as JT8-hub failure. Hardness impressions on the photo represent 53 HRC, 37 HRC and 31 HRC, almost identical hardness as failed hub.