



Photograph showing a view of the ruptured pipe piece with an NTSB investigator examining the fracture surfaces