


PRATT & WHITNEY CANADA
MAINTENANCE MANUAL
MANUAL PART NO. 3021242

- AREA A** 1. DETERMINE AND CORRECT CAUSE OF OVERTEMPERATURE.
2. PERFORM VISUAL INSPECTION.
3. RECORD IN ENGINE LOG BOOK.
- AREA B** 1. PERFORM HOT SECTION INSPECTION.
- AREA C** 1. PERFORM HOT SECTION INSPECTION.
2. RETURN COMPRESSOR TURBINE DISK AND BLADE ASSEMBLY
TO AN OVERHAUL FACILITY FOR STRETCH CHECK AND FLOURESCENT
PENETRANT INSPECTION.

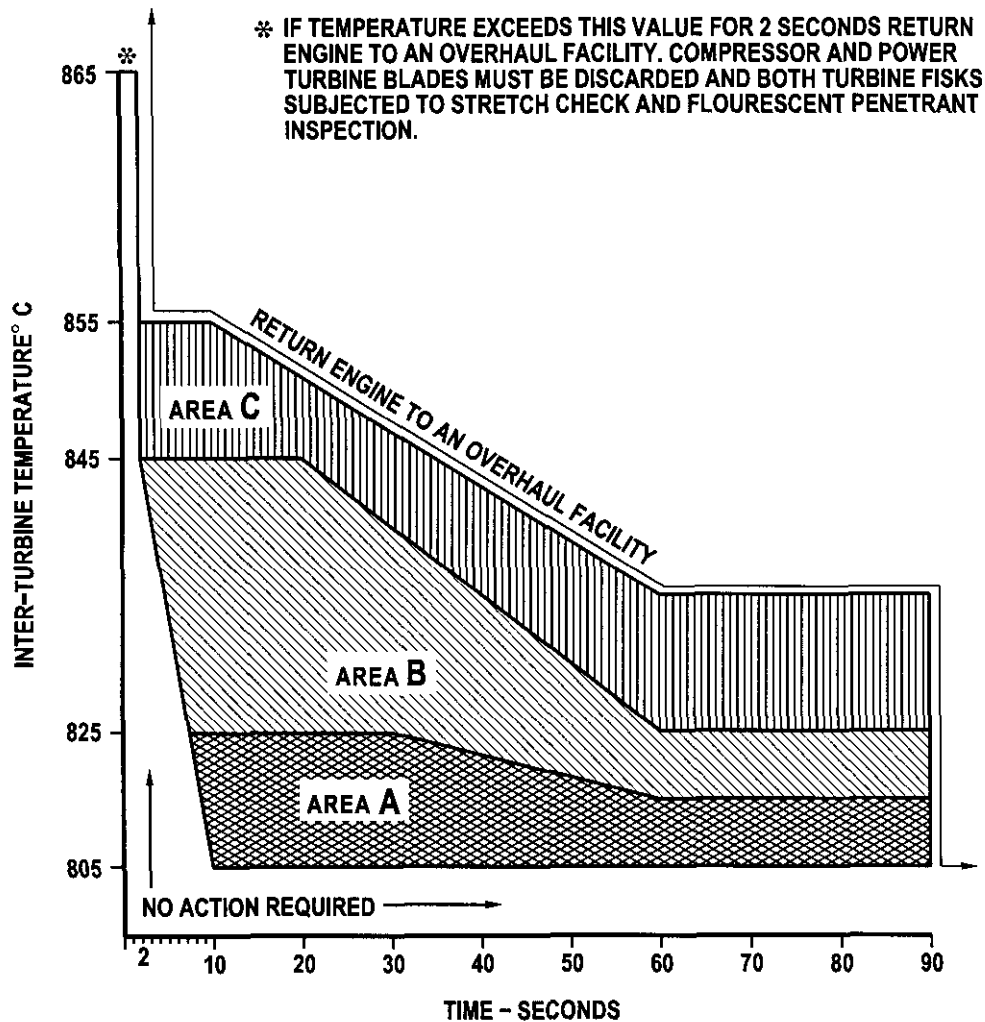

PT6A-36

C5975B

Overtemperature Limits (All Conditions Except Starting)
Figure 501 (Sheet 2)

71-00-00

POWER PLANT - ADJUSTMENT/TEST

Page 507
Aug 16/2002