


WING CENTER SECTION

LOWER PANEL STRINGER S-3

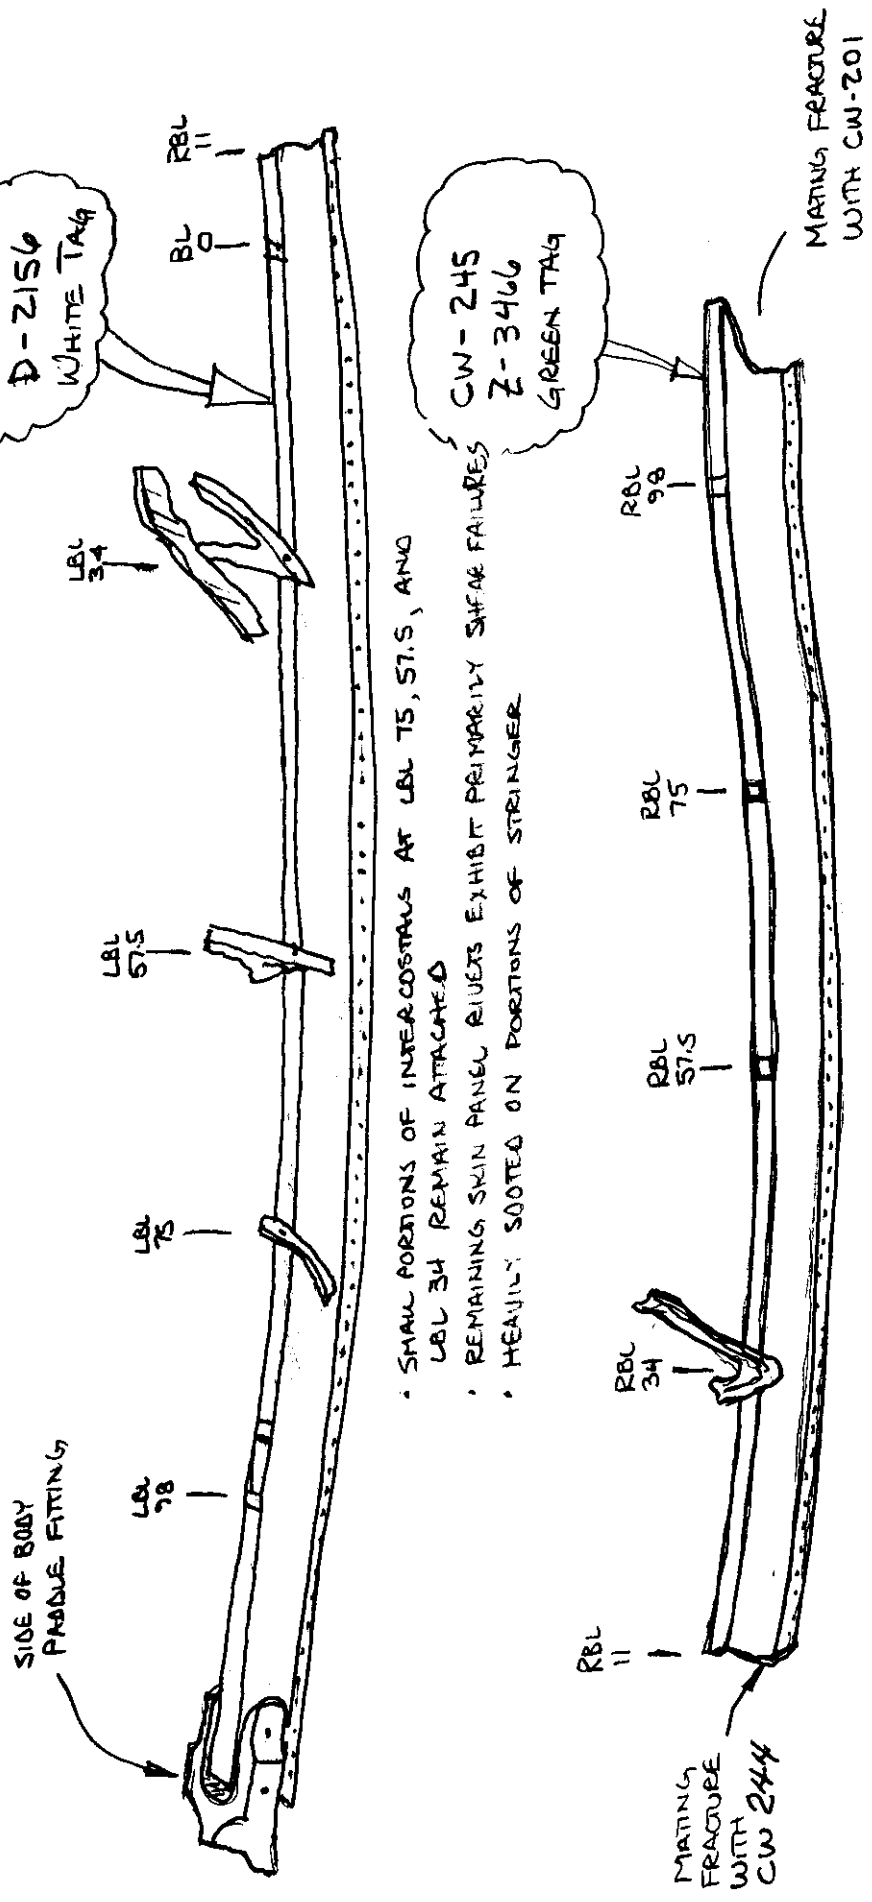

SMALL PORTIONS OF INTERCOSTALS AT LBL 75, 57.5, AND LBL 34 REMAIN ATTACHED
 REMAINING SKIN PANEL RIVETS EXHIBIT PRIMARILY SHEAR FAILURES
 HEAVILY SOOTED ON PORTIONS OF STRINGER

- SMALL PORTION OF INTERCOSTAL AT RBL 34
- REMAINING RIVETS COMMON TO SKIN EXHIBIT PRIMARILY SHEAR FAILURES
- HEAVILY SOOTED ON PORTIONS OF STRINGER

W. Stewart 3/26/97 BOEING
 J. [unclear] 4-4-97
 Tom [unclear]
 PHA 328-97

Demidov I AM
 3-27-97

V. [unclear]
 3/27/97

MATING FRACTURE WITH CW 244

MATING FRACTURE WITH CW-201