

DOUBLE PLUS CHORD FREE FLANGE ON OUTBD SIDE REMAINS INTACT. FASTENER HOLES FOR STRINGER END FITTINGS AT S-1, S-2, S-3 EXHIBIT BEARING FAILURE APPROXIMATELY ALONG SWEEP ANGLE. FREE FLANGE BROKEN OFF ON INBD SIDE

BENT INBD APPROX 10°

STIFFENER FREE FLANGE MISSING

PORTIONS OF STABILIZATION INTERCOSTAL

REMAINING FASTENERS EXHIBIT TENSION FAILURE

33'

CW-411
E-2547
GREEN TAG

STIFFENER FREE FLANGE MISSING

CW-412
C-2283
GREEN TAG

SLIGHT CURL OUTBD

CW-408
C-2282
GREEN TAG

LEFT SIDE OF BODY RIB

VIEW LOOKING INBD

↑
UP

← FWD →

W. Stewart 9/16/96

Leigh D. Johnson - ALPA
3-22-97
Shanderkukin
TARP 3/23/97
Tom Toth
FAA 3-27-97
Demicheli
3-28-97

- NO SOOT DEPOSITS ON INBD OR OUTBD FACE
- ALL DUCTILE FRACTURES