

CW-506
C-2135
GREEN

FRONT SPAR

This is a part of the left side front spar terminal fitting. This piece attaches to CW-509 at the bottom and CW-505 on the right side.

The front spar web is torn along the terminal fitting. Some fasteners remain attached to this fitting and exhibit inboard bending. The direction of failure of this fitting could not be determined from looking at this piece.

There is no evidence of any pre-existing cracking or corrosion on this section.

SD GREEN ALPHA
12-06-96

BA Reilly Boeing 12/7/96

W. Nephthys 12-6-96 TWA

Stephen F. Klupnick

FAN 12-06-96

R. Buckleth IAM 12-6-96