

SPANWISE BEAM # 3

CW-606  
Z-3045  
GREEN

This panel extend from LBL 100 to 127.5, and WL 140 to 156. The inboard 10" is bent forward 90 degrees. An intercostal is damaged and a horizontal end panel stiffener is intact.

See FIRE AND EXPLOSION FIELD NOTES. TCT.  
~~No fire damage or sooting is observed.~~

At Remey 10/21/96

RISING

Tom Tudino  
FAA-10-29-96

SD GREEN 11/29/96

ALPA


D. Mello 11-26-96 TWA

C. J. Hal. 11-27-96 IAM

CW-606

Z-3045

GREEN DEBRIS FIELD

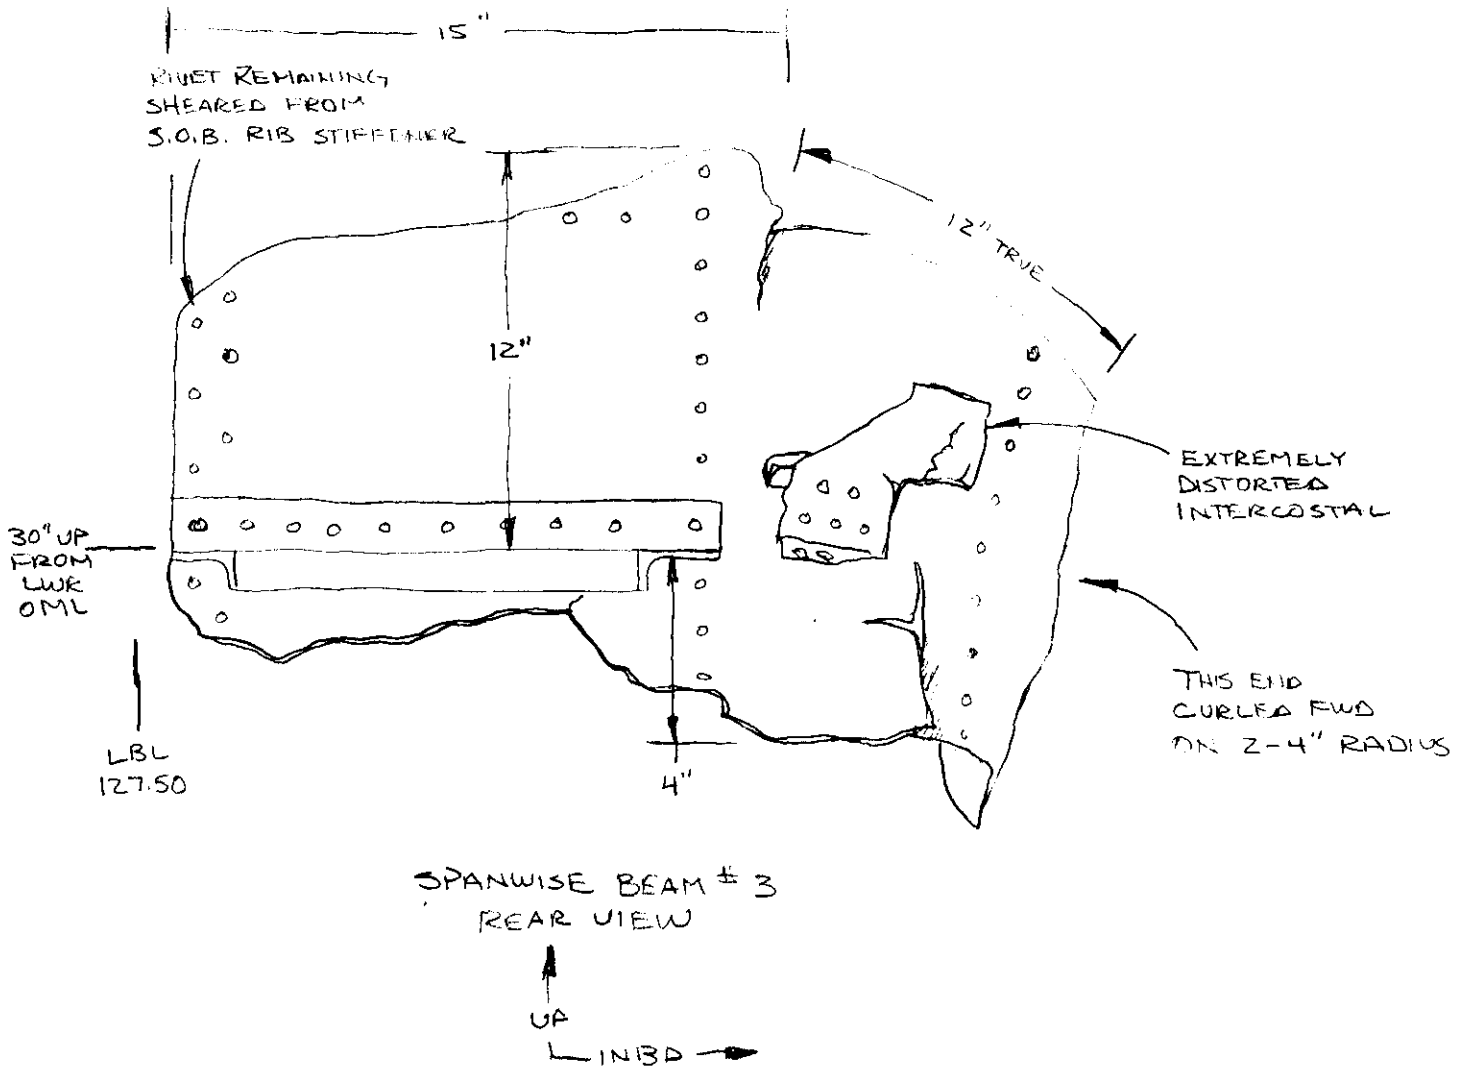

PART HAS VERY LIGHT SOOT ON FWD AND AFT SIDE. ONLY ONE HORIZONTAL STIFFENER AND MOST OF ONE INTERCOSTAL REMAIN ATTACHED. REMAINDER OF RIVETS COMMON TO S.O.B. RIB STIFFENER AND SPANWISE BEAM ARE SHEARED WITH THE REMAINDER OF THE RIVET IN THE HOLE.

WHEN PART IS MOUNTED IN RECONSTRUCTION, THE INBD END THAT IS CURLED FWD ALIGNS FAIRLY WELL WITH LARGE DISTORTED HOLE IN LEFT LOWER FRONT SPAR

*Wanted to get photo*