

LOG # FBM-19

TARGET # _____


COORD: LAT _____

LONG _____

DEBRIS FIELD REQ

TAG A202 *Pjiaz*

See Additional Comments

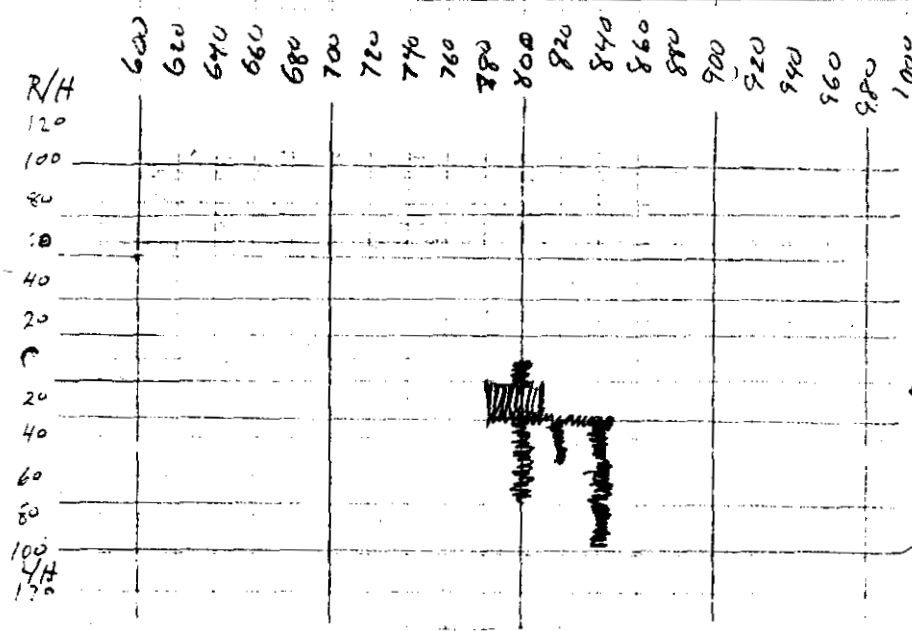

FLOOR ASSY STA 780 - STA 840, RBL 3 TO LBL 94

FLOOR PANEL # 93 CONNECTOR TO LBL 1133 S/C FROM STA 790 TO 810; LBL 33.99 S/C FROM STA 780 TO STA 943. STA 800 F/B FROM RBL 3 TO LBL 74, STA 820 F/B UPPER CHORD FROM LBL 33 TO LBL 51 AND STA 840 F/B UPPER CHORD FROM LBL 33 TO LBL 94.

(SEE F/B DWG) 2 OXYGEN MASKS WRAPPED UP @ 840 & BL 33.99 S/C BL 11.33 S/C MATES UP WITH FBM-11B @ STA 810 FRACTURE HAS TWISTING DISTORTION WHERE LOWER FLANGE IS $\approx 45^\circ$ ROTATED WITH INBD SIDE UP. FWD FRACTURE @ 790 HAS SOME TWIST (LESS THAN 15°) IN SAME DIRECTION

BL 33.99 S/C DOESN'T HAVE ANY TORSIONAL DISTORTION, @ STA 810 THE LOWER FLANGE IS BOWED INBD $\approx 1/4"$

STA 800 F/B HAS LOWER CHORD FWD/AFT ROTATION ABOUT BL 33.99 STIFFENER, INBD IS CLOTTED FWD AND OUTBD AFT $\approx 15^\circ$

F/P HAS ONLY FWD AND INBD 10" OF INSERTS WITH TEAR OUT DAMAGE.

D. Santiago
11/23/96

TIDA 10-2596

[Signature]

STEPHEN F. KLUPP

BARRY SMITH BOLING
10/20/96

Additional Comments

pg 242

FBM -19


R. T. STETTNER 11-9-96

1) S/T AT LBL 33.99 IS ACTUALLY CONNECTED
FROM STATION 780 TO STATION 843.

Rob Harauer TBC
12/4/96

Dennis Santiago IAM
12/4/96
Tom Tidino FAA
12/4/96

Neil Seville - TWA
12.4.96

 - ACDA
12-4-96

9