



LOG # FBM-5
 TARGET # _____
 COORD: LAT _____
 LONG _____

DEBRIS FIELD RED
 5A - TAG A144 RED
 5B - RED NO TAG
 5C - NO TAG FLOATING
 5D - SOURCE TAG A423
 5E - NO TAG (NO DATE)
 -B
 -A

STA 960 FLOOR BEAM PIECES

✓ -5A 3 FLOOR BEAM AND FRAME INTERSECTION LBL 110 TO SOB, FRAME \$ 25 & FRACTURE THRU FASTENERS IN FRAME CLIP \$ 29 FRACTURED 1" BELOW STRINGER &

✓ -5B; 15" LONG UPPER CHORD & 2 1/2" STRIP & WEB. FOR MATING TO -A FRACTURE, -B WOULD ANGLE UP ≈ 45°. INBD END FRACTURE ANGLES UP ≈ 20°

✓ -5C: 14" LONG UPPER CHORD, RBL 65 TO RBL 79 WITH PIECE OF F/P # 115, STA 940 TO 960, RBL 55 TO RBL 76 INBD & FWD INSERTS HAVE TEAR OUT FRACTURE OUTBD HAS S/T ATTACHED STA 940 TO STA 960

✓ -5D 5 1/2 LONG UPPER FLANGE, RBL 8,5 TO RBL 14 WITH S/T FROM STA 941 TO STA 960 ATTACHED. FROM 953 TO 959 S/T TAKE ABOUT 30° OF TWIST (AFT IS CCW WITH RESPECT TO FRONT). SEVERAL INCHES OF FLANGE CT F/P IS MISSING.

✓ -5E ✓ UPPER CHORD LBL 78 TO LBL 98 (SEE F/B DWG)

Handwritten notes:
 10-24-96
 11-8-96

Dennis Hartige
 11/23/96

Barry Smith Boeing
 10/23/96
 Lou Zullo FAA
 10-24-96