



LOG # FBM-9

TARGET # _____

COORD: LAT _____

LONG _____

DEBRIS FIELD _____

↑ LOADING

PORTION OF FLOOR PANEL # 110 WITH STA
 880 F/B UPPER CHORD LBL 30 TO LBL 75
 AND STA 900 F/B LBL 25 TO LBL 75
 S/H LBL 33,99 FROM STA 880 TO 900 AND
 S/H LBL 75,92 FROM STA 920 TO STA 940

F/P UPPER FACE PLYS FRACTURED @ STA 900
 AND JUST AFT OF 920. AFT FRACTURE
 IS AT STA 930 FROM LBL 34 TO LBL 60 THEN
 AFT TO STA 940 AND THEN OUT BD TO
 LBL 75. PERIMETER FASTENERS WHICH FAILED
 HAVE TEAROUT WITH MOST FIBER STILL
 THERE, JUST FRACTURED.

Truck
 TWX 10-27-96
 [Signature]
 AFA 11-8-96

Dennis Santiago
 11-23-96

Barry Smith
 10/23/96 Boeing
 [Signature] FAA
 10-25-96