

LOG # LF 123


TAG TARGET # 2 2880

COORD: LAT \_\_\_\_\_

LONG \_\_\_\_\_

LBL 48.58 LONGITUDINAL FLOOR BEAM  
STA 1321 TO STA 1341

DEBRIS FIELD GREEN

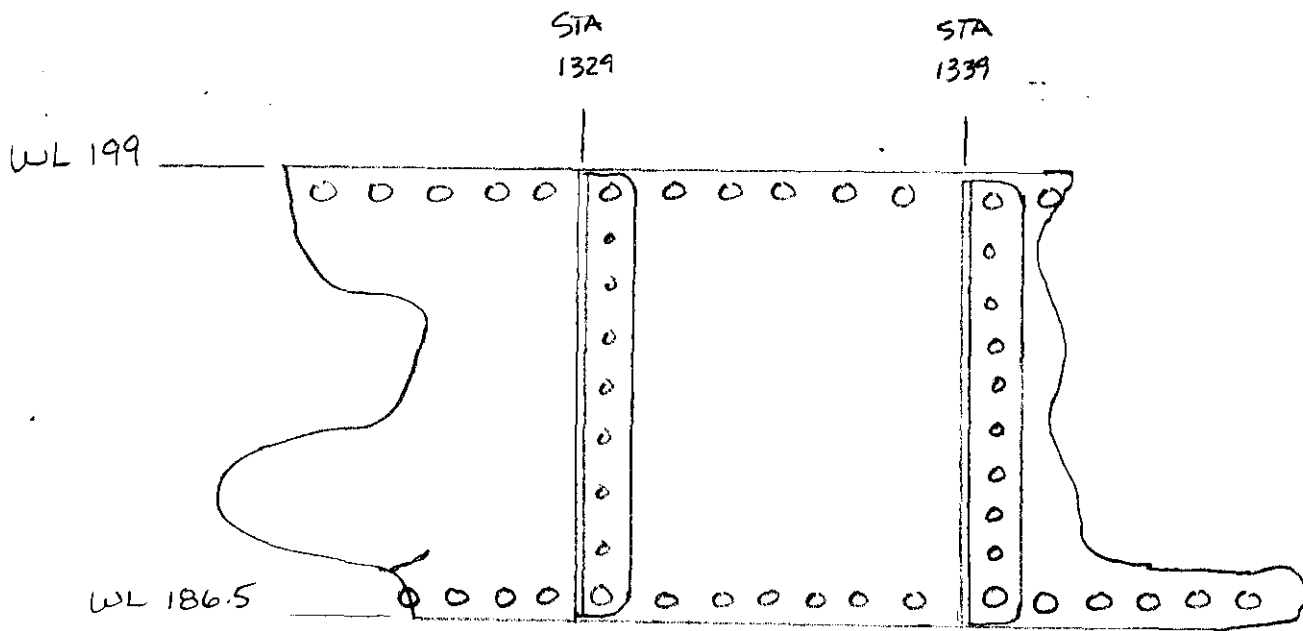

VIEW LOOKING INBOARD

- \* INDICATION OF POSSIBLE LIGHT SCOTING ON OUTBOARD SURFACE OF F/B WEB
- \* BOTH THE UPPER AND LOWER CHORDS FRACTURED AT THE RADIUS OF THE HORIZONTAL FLANGE. THE VERTICAL FLANGE REMAINED W/ WEB.
- \* THERE IS A TAR LIKE SUBSTANCE WHICH HAS RUN DOWN THE UPPER SURFACE OF THE FLOOR BEAM WEB ON THE OUTBOARD SIDE. NOT SHOWN ON SKETCH.
- \* NO INDICATION OF PENETRATIONS IN WEB.

Dennis Santiago IAM  
3-4-97


Heigh J. Johnson - ALPA  
3-17-97

George Good  
3-13-97 TWA

R. Harrower 3/22/97  
Boeing

Bob Breneman  
2/20/97  
FAA

65B11 3-55

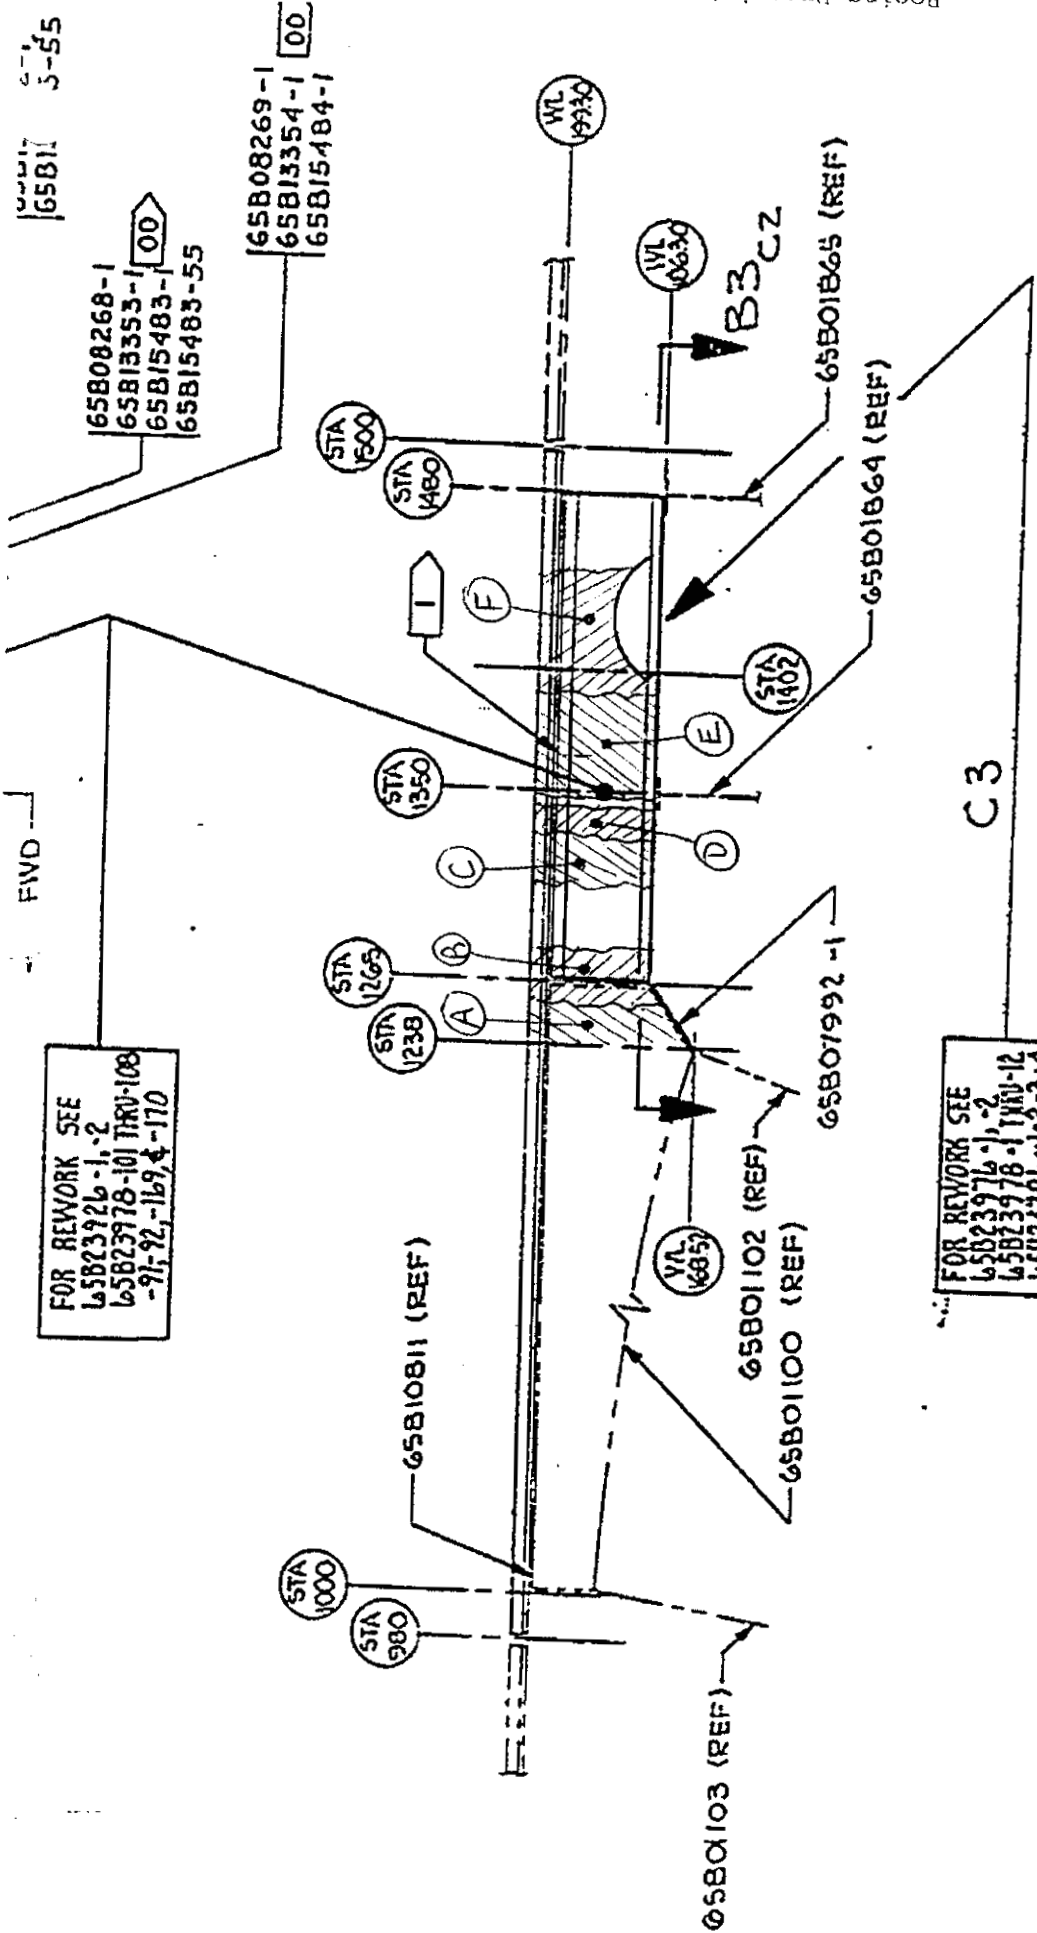


FOR REWORK SEE  
 65B23926-1, 2  
 65B23978-101 THRU-108  
 -91, 92, 169, 170

FOR REWORK SEE  
 65B23976-1, 2  
 65B23978-1 THRU-12  
 65B24706-1, 2, 3, 4

LBL 98.58  
 FLRBM

ITEM	LOG #
A	LF121
B	LF102 *
C	LF122
D	LF123
E	LF124
F	LF111 *

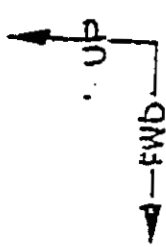

SCALE: NONE

\* PART OF