


LBL 33.99 LONGITUDINAL FLOOR BEAM
FROM STA 1273 TO 1303.5

LOG # LF 132
TARGET # D 2111
COORD: LAT _____
LONG _____

DEBRIS FIELD WHITE

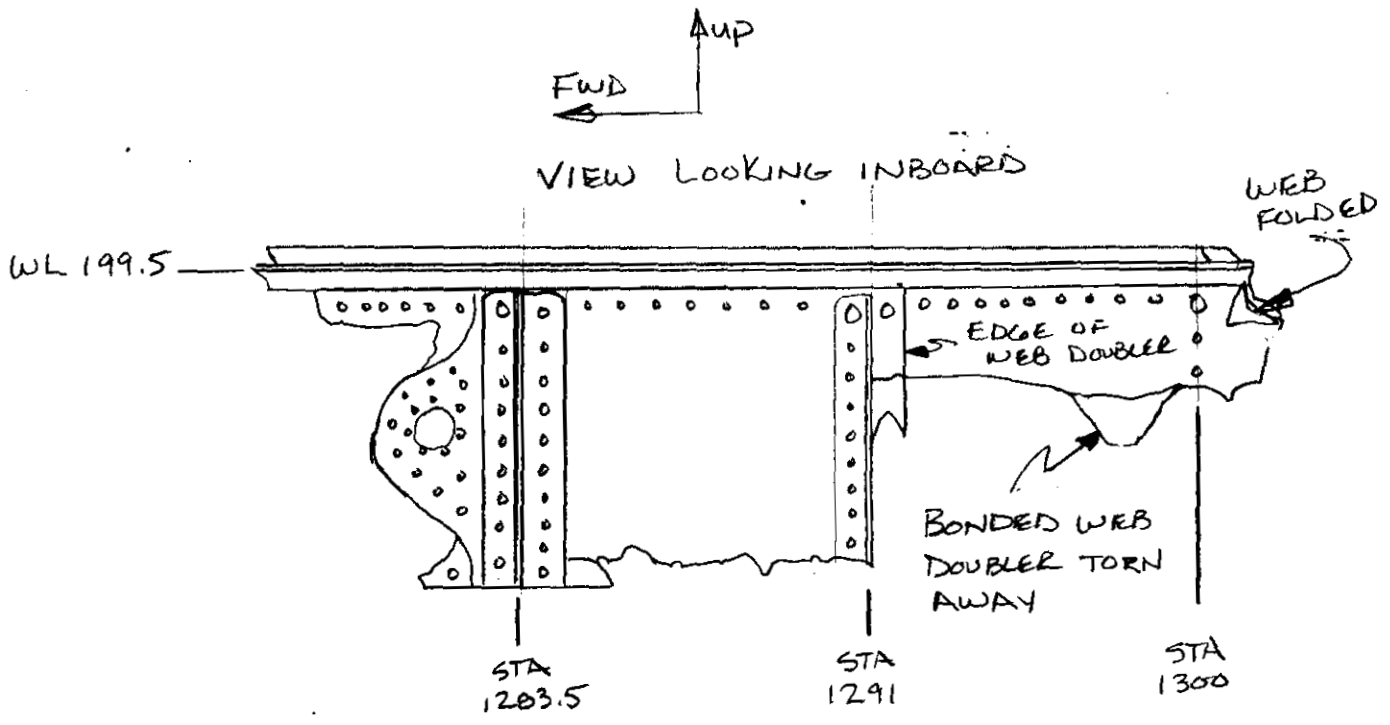


- * NO INDICATION OF ANY PENETRATIONS IN WEB.
- * INDICATION OF POSSIBLE LIGHT SOOTING AND OR DIRT ACCUMULATION ON BOTH THE INBOARD AND OUTBOARD SIDES.
- * SEALANT AROUND THE EDGE OF THE WEB CIRCULAR CUTOUT SHOWS INDICATION OF SOOT AND OR LIGHT CHARING ON THE OUTBOARD SIDE ONLY.
- * THE WEB LOWER EDGE FAILED ALONG THE FASTENER LINE COMMON TO THE LOWER CHORD EXCEPT AT THE STA 1283.5 STIFFENER WHERE A SMALL SECTION OF THE LOWER CHORD VERTICAL FLANGE REMAINED ATTACHED.

Handwritten signature
2/21/97
Dennis Santiago IAM
3-6-97
Stephen F. Klapach Jr
FAA - 03-06-97
Leigh D. Jones - ALPA
3-17-97

Rokanauer
3/22/97 Boeing

Bob Breneman
3/1/97
FAA

65B1331 55

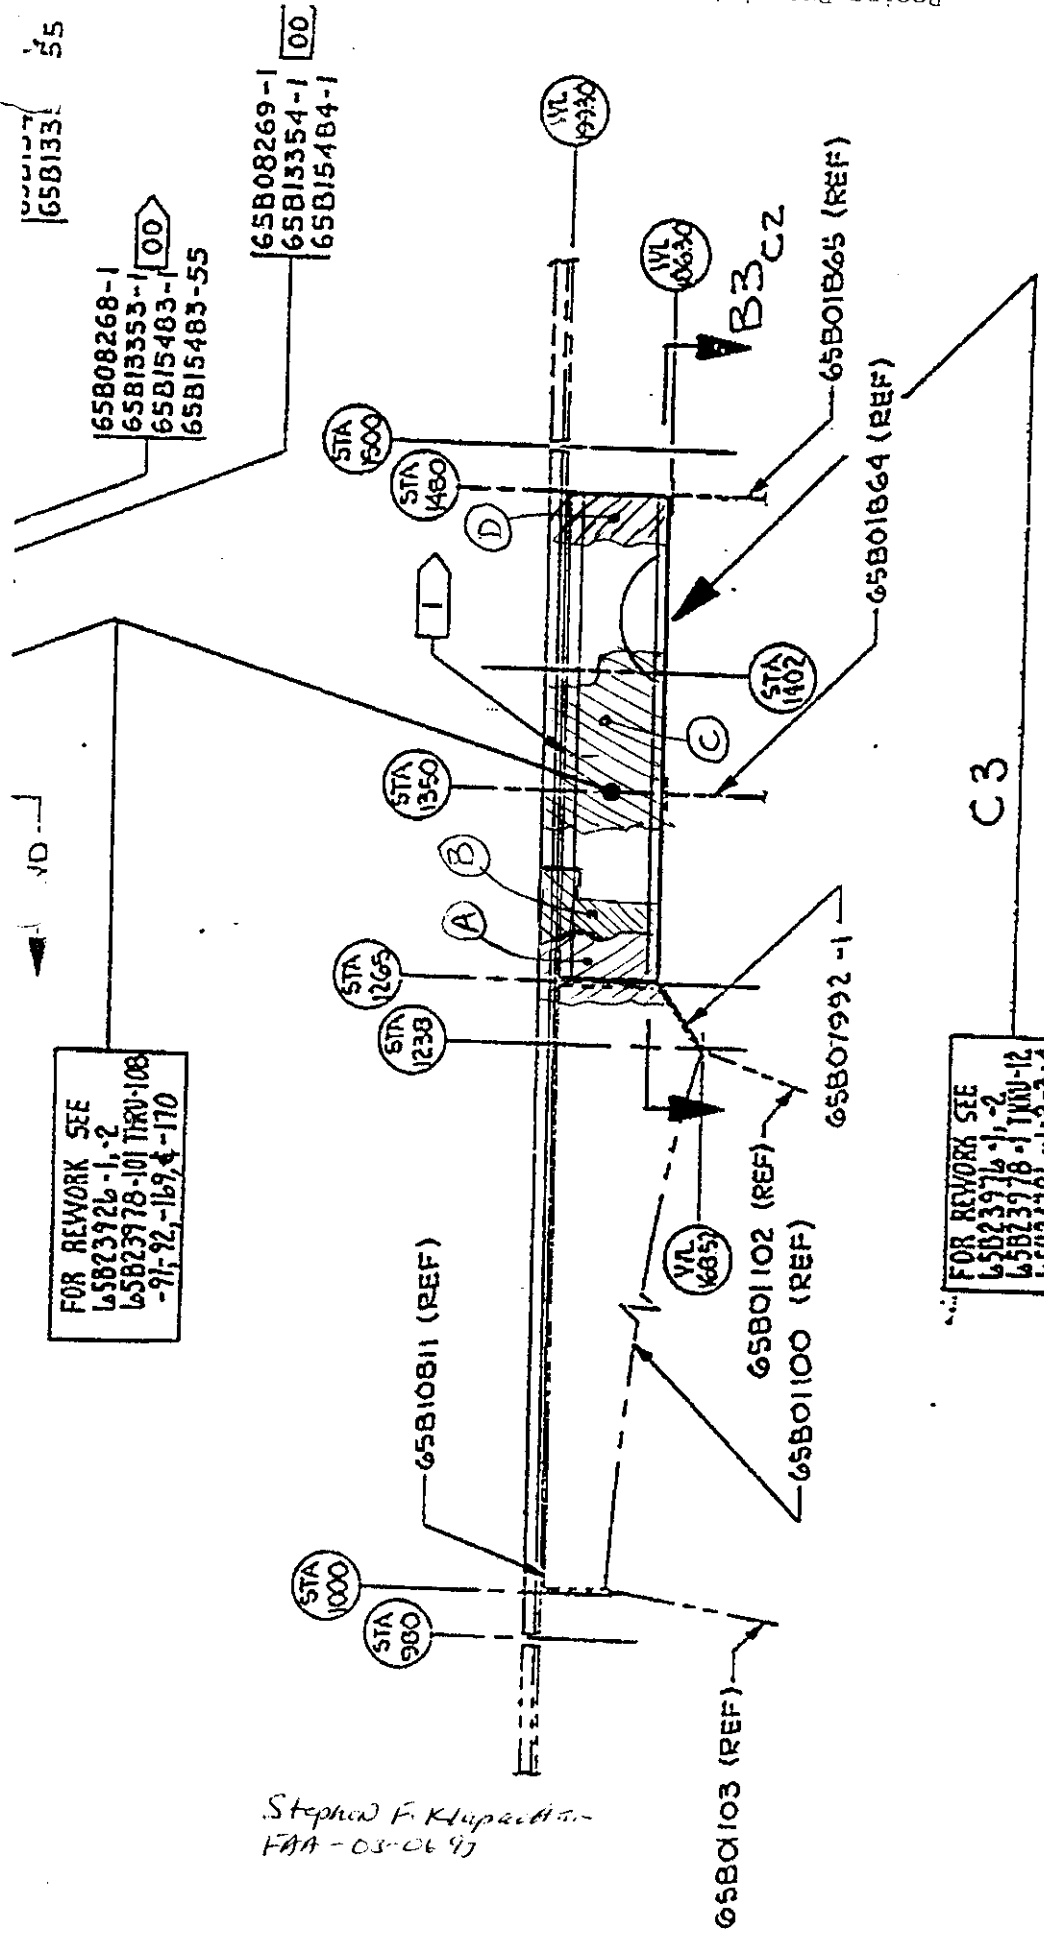

FOR REWORK SEE
 65B23926-1-2
 65B23978-101 THRU-108
 -91, 92, 116, 117, 170

FOR REWORK SEE
 65B23976-1-2
 65B23978-1 THRU-12
 65B24786-1:2, 3, 4

LBL 33,99
 FURBIM

ITEM	LOG #
A	LF 131
B	LF 132
C	LF 133
D	LF 134

UP
 FWD
 SCALE: NONE

Stephen F. Klupactin
 FAA - 03-06-97