


LOG # LF 126
 TAG TARGET # Z 3205
 COORD: LAT _____
 LONG _____

LBL 75.92 LONGITUDINAL FLOOR BEAM
 FROM STA 1290 TO STA 1318

DEBRIS FIELD GREEN

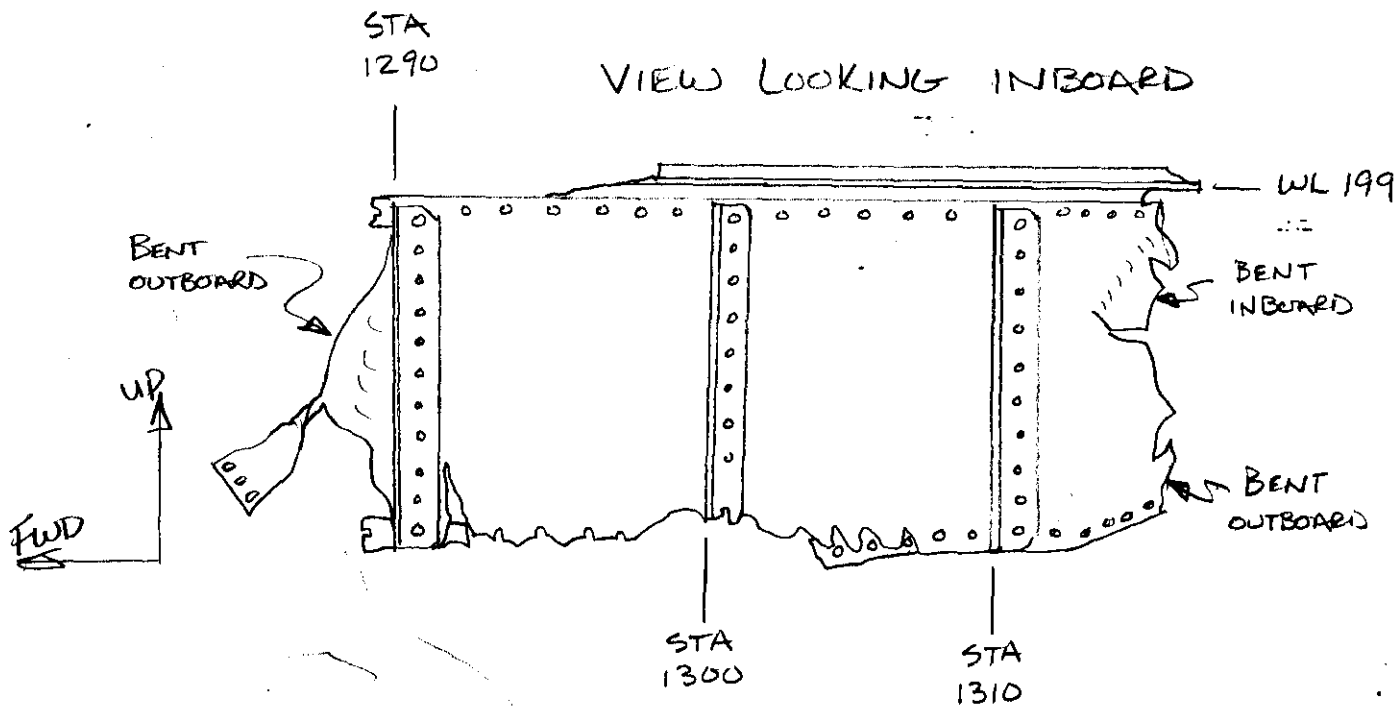

- * THERE ARE INDICATIONS OF MEDIUM TO HEAVY SOOTING ON BOTH INBOARD AND OUTBOARD SIDES.
- * LOWER CHORD HORIZONTAL FLANGE IS MISSING
- * LOWER CHORD VERTICAL FLANGE PULLED OUT OF WEB AND SEPERATED FROM REMAINING LOWER CHORD FROM STA 1290 TO STA 1305.
- * THERE ARE NO INDICATION OF PENETRATIONS IN WEB.
- * THERE IS A TAR LIKE SUBSTANCE ON THE LOWER SURFACE OF THE REMAINING UPPER CHORD HORIZONTAL FLANGE AND THE UPPER EDGE OF THE WEB ON THE OUTBOARD SIDE ONLY.
- * THERE ARE DARK SPLATER MARKS ON THE OUTBOARD WEB SECTION FORWARD OF STA 1290
- * THE FORWARD SIDE OF THE VERTICAL STIFFENERS HAVE A THICK BLACK SUBSTANCE FROM THE UPPER CHORD TO THE LOWER CHORD.

*Adnan
3/22/97
Boeing*


*Denis Santos JAA
3-4-97*

*Yusef 290 line - ALPA
3-17-97*

*George Ouellet
3-13-97*

*Bob Breneman
2/20/97 FAA*

5
65B1332

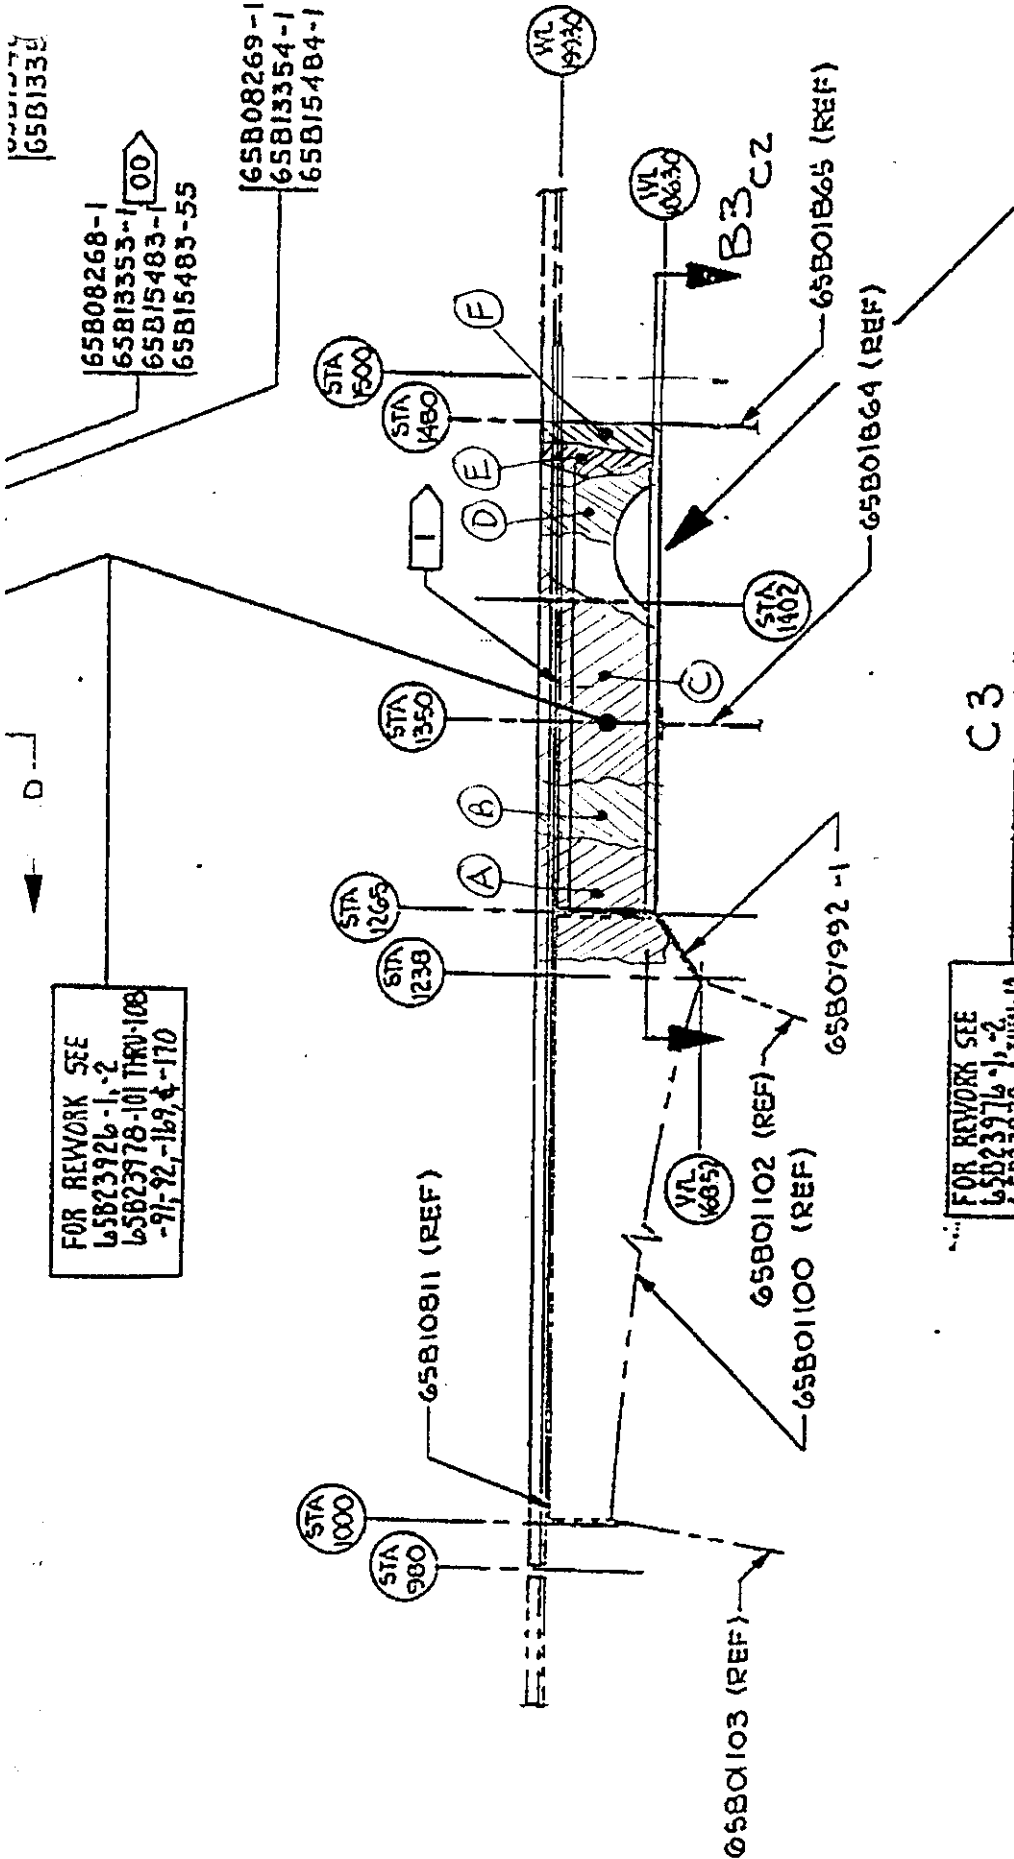

FOR REWORK SEE
 65B23926-1, 2
 65B23778-101 THRU-108
 -91, 92, 169, 4-170

FOR REWORK SEE
 65B23976-1, 2
 65B23978-1 THRU-12
 65B24785-1, 2, 3, 4

LBL 75.92
 FLRBM

ITEM	LOG #
A	LF125
B	LF126
C	LF109 *
D	LF116 *
E	LF127
F	LF116 *

UP
 FWD
 SCALE: NONE

* PART OF