| A | |
|---|--|
| | |
| | |
| A | |

LOG# LF 58 KI COORD: LAT

DEBRIS FIELD

TWO FRAME SEGMENTS

A) STA 960, STG 39L TO 43L & B) STA 960, STG 43L TO 47L

VIEW A-A

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE .

Med Savell

FRACTURE LINES "CLEAN COT" NO APPARENT BENT AFT AT ABOUT 60° FROM UPPER PORTION LOG # LF 58B FLANGE BENT OUT OF PLANE STIFFENER FUD-AFT LEG BROKEN STIFFENER DOUBLED HOLE NO TAG BUT FOUND IN RED FWD/AFT BEND LINE, WIRE WIRE 4-96-41-8 GROMMET PLA NE. FIELD CHARRING. S-47L STG 43L TO STG 47L AT FASTENER (?) WEBTORN FWD CUTOUT AUP OUTED VIEW LOOKING FWD AFT FLANCE TORNOFF TEE SHEARCLIP, FWD FLANGE MISSING, L SHEAR TIES SHEARED OFF, 3PL AT CLIP-TO-SKIN 5-441 FASTENERS ~ 6 INCH 5-436 WITH LF 58A MATES HERE,

STA 960 LOWER BODY FRAME

