Left Wing Gear Assembly

Log Number	LG2
Debris Field	Green
Target Number	C877
Coordinates:	
Latitude	
Longitude	
Left wing gear assembly	is not attached to trunnion fittings.
Some hydraulic lines rem	nain attached.
Some wiring remains atta	ached.
Downlock bungee is not	attached to gear assembly.
Inboard jury strut link is link is attached to outer c	unattached to side strut and unattached to outboard jury strut. Outboard jury strut ylinder.
All brake rods failed as si	hown on illustration.
Aft outboard axle failed 8	3.5 inches from gear beam centerline.
Retract stabilizing arms vunattached to gear assem	were bent as shown on illustration. Aft stabilizing arm outboard section is bly. See illustration.
	ub, outer hub, brake assembly, and outer portion of axle not attached to gear 5 inches from gear beam centerline.
Forward outboard tire ha	s cuts.
Inboard forward tire, innegear assembly.	er hub, outer hub, and outer two-thirds of brake pads and rotors not attached to
Inboard aft tire, inner hul	o, outer hub, and brake assembly not attached to gear assembly.
	gh paint layer only. No visible signs of soot.
TWA-REPHLO DYRYALS 11-26) <i>-9</i> 6
11-25-46 Stephen F. 1 R Suchtly 12.6. D. Att. BOUT	96 JAM
A. att. BOUT	NG 12/18/96
SU GAELENI A	NG 191910 NAPA 01-2=157

