
## Left Body Gear Doors

Log Number Debris Field Target Numbers Coordinates:	LG8 Green C849, Z3071, Z3269, Z3273 Latitude Longitude	
Outboard Forward Door	(Z3071)	
Outboard hinges failed.		
Inner skin has punctures,	cracks, and flapping as shown on illustration.	
Rod failed at door fitting.		
Structure has minor surface	ces abrasions. No visible indication of soot.	
Inboard Forward Door (2	Z3673)	
Inboard frame has failed a	at hinge locations. Hinges tore from door assembly.	
Outboard hinges failed.		
Leading edge door seal no	ot attached to door assembly.	
Rod not attached.		
Forward transverse inner	skin stiffener outboard 24 inches of vertical flange not attached.	
Inboard Aft Door (Z3269)	)	
Forward segment of door	exists. Aft segment is not attached and not identified.	
Forward segment separate	ed approximately forty-one inches aft of leading edge.	
Fuselage hinge failed at fo	orward hinge location.	
The second door hinge aft	; failed.	
Structure has minor surface	ce abrasions. No visible indication of soot.	
Outboard Aft Door (C849	<i>)</i> )	
Outer skin dented as show	on illustration and torn downward from top approximately twelve inches	i.
Hinges are failed.		
Approximately three inche	es of rod are attached.	
Seal retainer has areas of c	cracking and deflection as shown on illustration.	
	the abrasions. No visible indication of soot.	
Stephen F. Klapack SN	- 2-96 TWA R. Swelith IAM 12-6-96.	ALPA O1-20-97

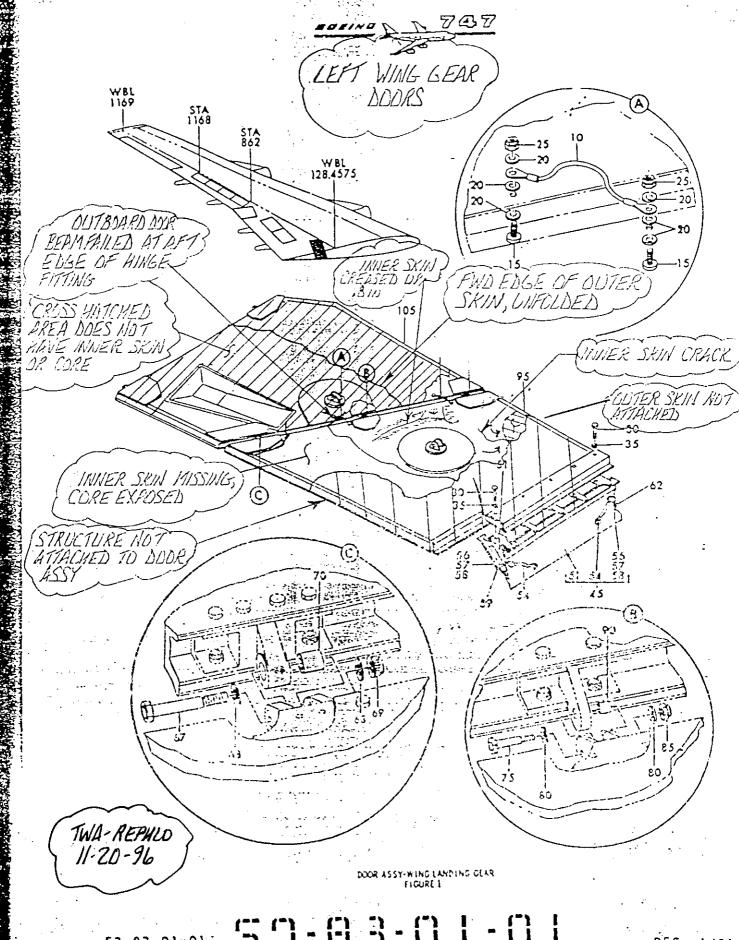

52-93-01-01 52-83-01-01

