SEE ADDITION	A Connert A
A D Maria Company of the same	
0 0	
Alacka Stacka	

LOG# L	w-23	A
TARGET#_	906	1963
COORD: LAT		·

FLAP. TRACK # 1 POSITION DERRI

DEBRIS FIELD Green (906

LONG

FLAP TRACK IS INTACT WITH THE EXCEPTION OF
THE YOKE ASSY. THE FLAP. GEAR BOX IS STILL ATTACHED
AN CONJECTED BY 2 STUDS AND NUTS. THE 3RD MOUNT IS
FRACTURED. THE WORE GEAR IS BROKEN OF F AT AROUT
3 to 4 INCHES FROM THE CONNECTING POINT. 3 to 4 INCHES
OF WORM GEAR IS STILL VISABLE. THE FRONT WINE
MOUNT IS STILL ATTACHED. BUT THE FSTUDS ARE STILL
ATTACHED, BUT THE NUTS HAVE SEPERATED.
APPEARS TO HAVE NO FIRE DAMAGE OR SUTTING
THE TRACK HAS A KARGE HOLE ON THE FWO-INBO
SIDE. THERE IS NO FLAP OR FLIGHT CONTROL
COMPONENT ATTACHED.

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

Dheitego 11/196 - IAM
TMENT 10-13-96 TWA

R DA 19/94 - BOTTLE


P. A. MAROTTE: -FAA

Stephent Klupulton Fina 10 28-46

Pg 201

•

1

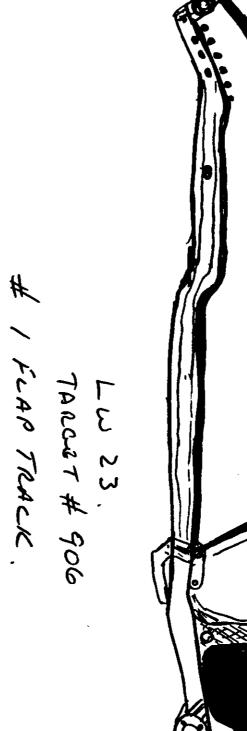

Stephen F 14 your Home FAM 10 28 46

ADDITIONE CHIMENTS

LW-23

R.J. STETTNER 11-12-96

Ng 30/3

1) THE IS LIGHT TO MODERATE SOUTHING ON ALL SIDES OF FLANTRACK BETWEEN FURWARD MOUNT AND REAL SPAR MOUNT

2) THER IS ALSO SUDTING AT THE TRAILING & DCK BUTTON 810C

12-6-9/

motion TWA 12-6-96 Dennis Sontiago IAM 12-6 96 Thu Toduco FAA 12-6-96 BUEING 6DEC96