

LOG # RF114  
 TARGET # \_\_\_\_\_  
 COORD: LAT \_\_\_\_\_  
 LONG \_\_\_\_\_

SKIN STA 1120-1170  
 \$19- \$23

DEBRIS FIELD GREEN

TAGS A Z3568 GREEN  
 B No TAG 9/29/96-2  
 C Z3215

RF114A BOTTOM FWD 20"

- FWD <sup>E</sup> EDGE FRACTURE THRU FASTENERS ARE THRU NON-FASTENER AREAS. ALL OTHER FRACTURES SEPERATED. STA 1140-1160 DOUBLER

- LIGHT SMOKE ON EXTERIOR WITH DARK TAR LIKE RUN 2" WIDE STA 1120 TO 1140 ABOVE WINDOW
- SOME TARNISH ON INSIDE

RF114B TOP & AFT EDGE FRACTURE THRU FAST. E'S

- LIGHT SMOKE ON EXTERIOR
- INSIDE PRIMER IS TARNISHED (DIRT OR SMOKE)

RF114C TOP FRACTURE THRU FASTENER

- LIGHT - MODERATE SMOKE OR DIRT ON EXTERIOR
- INSIDE PRIMER IS TARNISHED (DIRT OR SMOKE)

NOTE: ALL PARTS LOOK COMPARABLE WITH AJOINING PARTS EXCEPT RF17 ( DOOR 3 PANEL WITH HEAVY FIRE DAMAGE)


REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

Dennis Santiago IAM  
 10/28/96

*[Signature]*  
 DOEING 10/9/96

*[Handwritten notes]*  
 Tom Todino  
 FAA 10-24-96  
 Tom Todino  
 10/10/96

*[Handwritten mark]*

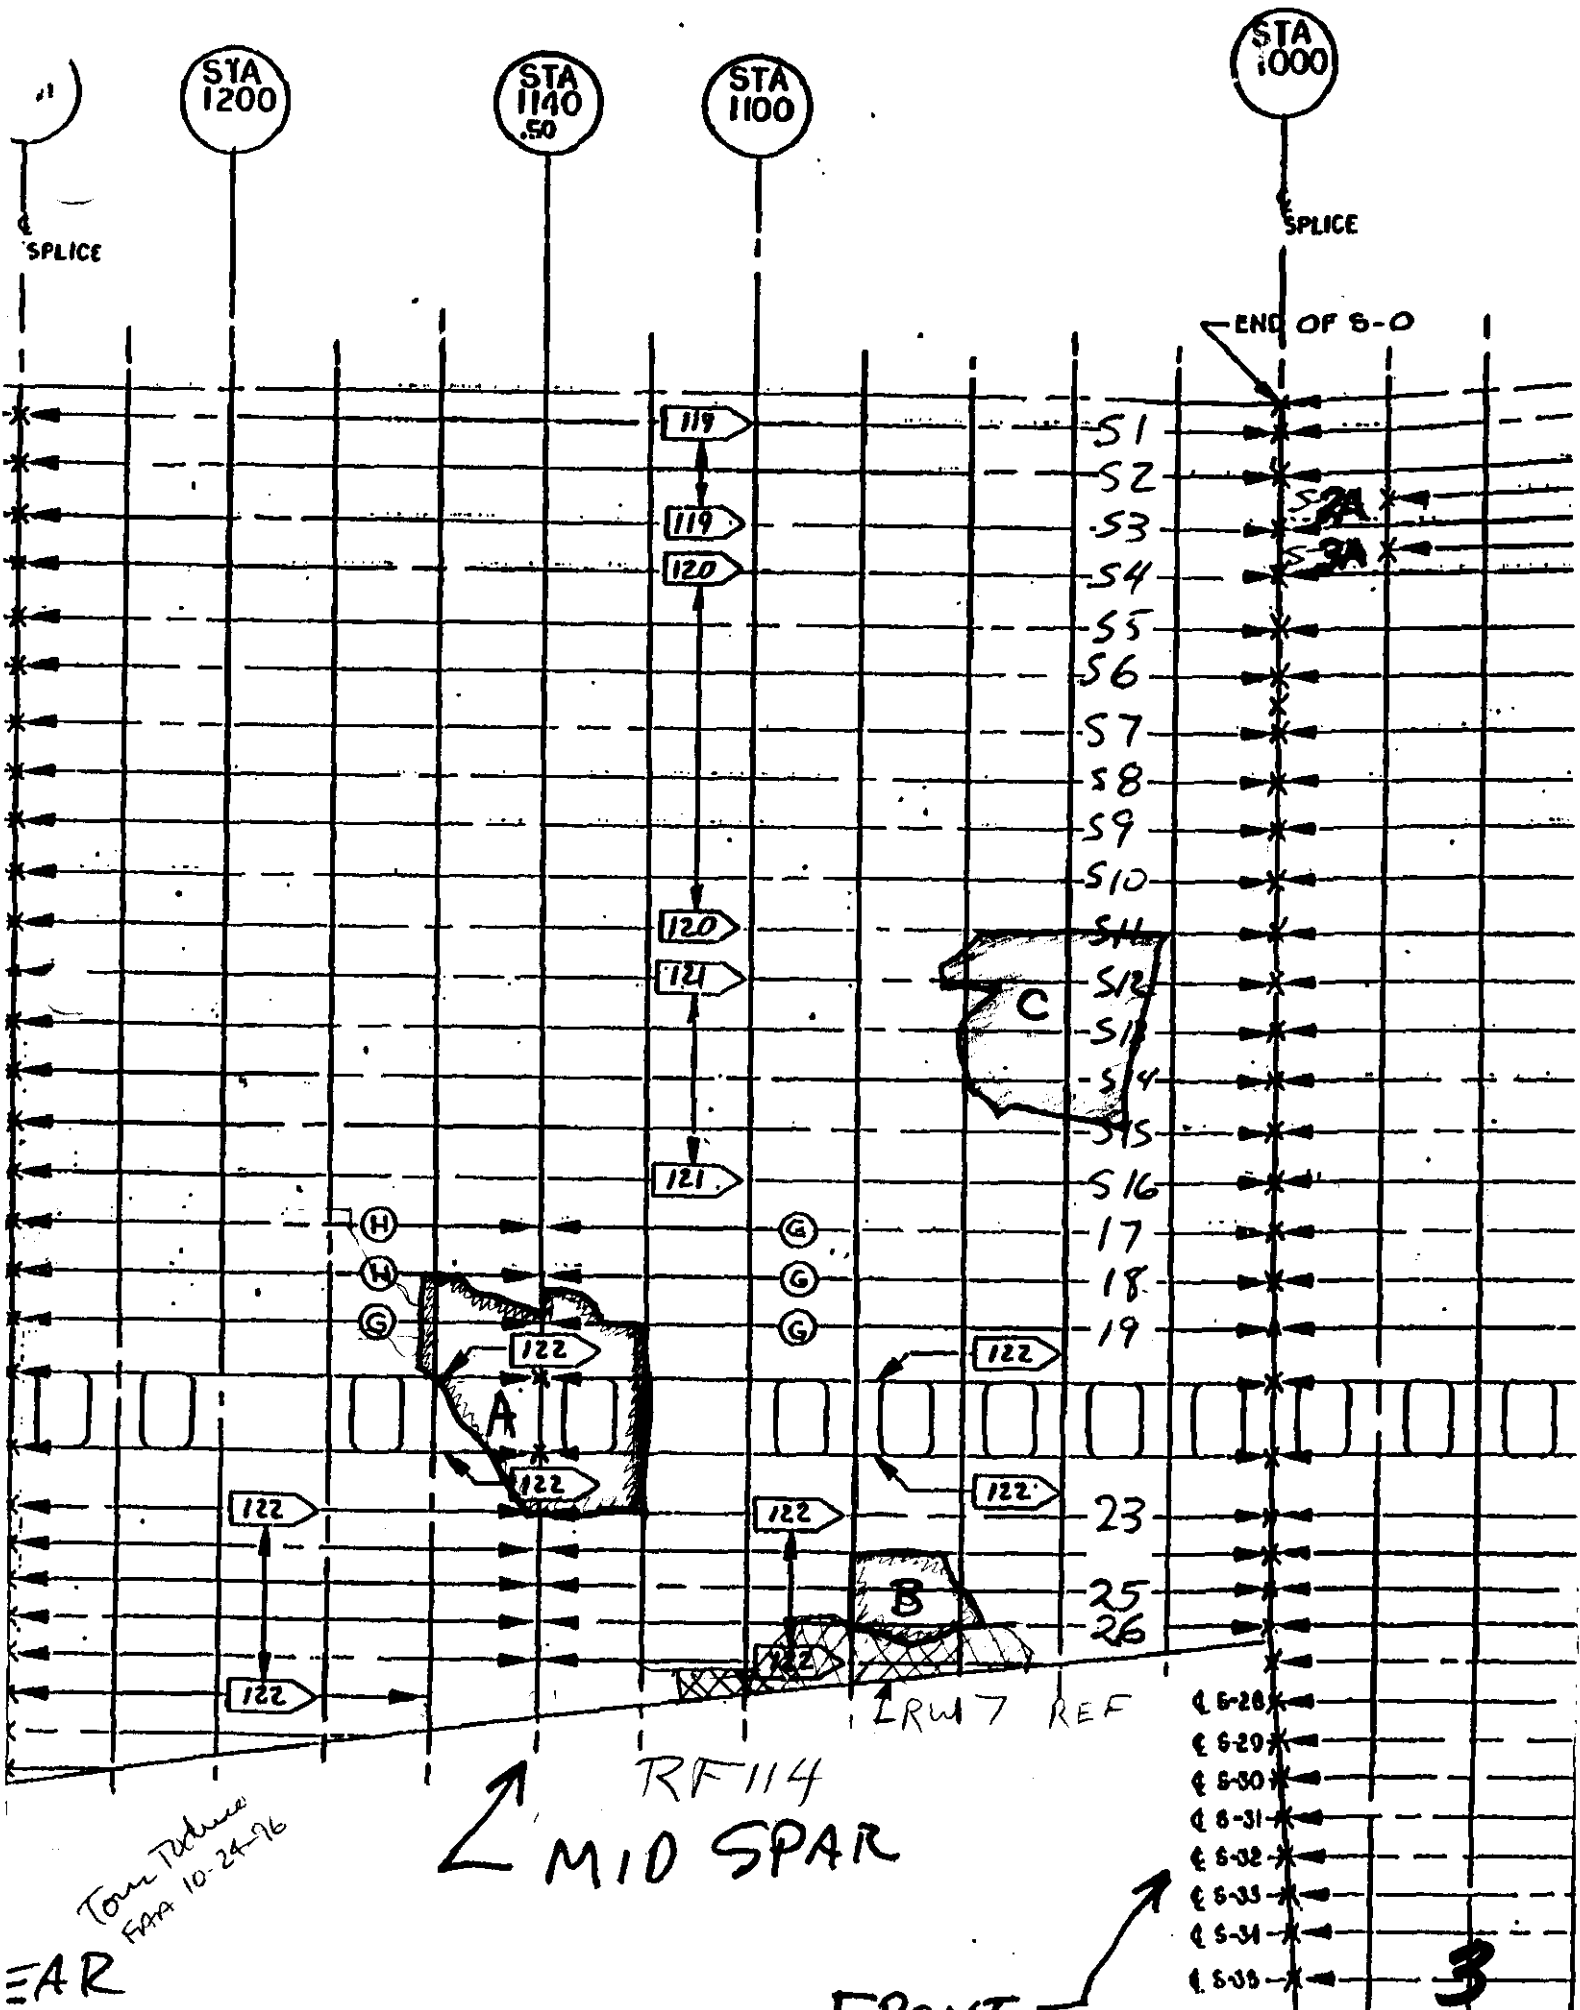

Tom Tullace  
FAA 10-24-96  
EAR