

SKIN: SKINIS SIGNIFICANTLY CRUMPLED, UPPEREDGE

FROM STA 1670 BACK TO STA 1720 IS FOLDED INBOARD ROUGHLY ALONG STG 31R. MOST OF THIS FOLD IS A TIGHT RADIUS, AND CRUSHES STG 31R FROM STA 1670 TO ABOUT STA 1700. ALL EDGES ARE JAGGED. THERE ARE A NUMBER OF AREAS ON THE INSIDE SURFACE WHERE THE ALUMINUM IS BARE, PAINT & PRIMER HAVING BEEN ABRADED AWAY. AT THE AFT END OF THE SEGMENT IS PART OF THE CUTOUT FOR THE CARGO EXTERNAL LIGHTING INSTALLATION (DWG 65840341-2). THE CUTOUT PORTION INCLUDES THE AFT, UPPER CORNER GOING FORWARD THEN DOWN TO THE FWD LOWER CORNER. THE CUTOUT IS CENTERED AT STA 1729.50, W.L. 157 (BETWEEN STG 31R AND STG 33R., STG 32 R IS DISCONTINUOUS BETWEEN 1720 \$ 1741.1), THERE IS A PENETRATION AT

STRINGERS :

STA~1698, STG 31/2. ABOUT 11/2"LONG 0.5" WIDE, FLANGED OUTBOARD

REMAINING ATTACHED TO THE SKIN IS STG 31R BETWEEN STAN1720 TO STATIN 1672, STG 32R REMAINS ATTACHED FROM STA~1690 TO STA 1720. A REMNANT OF STG 33R REMAINS ATTACHED BETWEEN STAN1702 AND STA 1720.

OTHER ITEMS :

FRAME SHEAR TIE REMNANTS (FLANGES ATTACHED TO SKIN) REMAIN ATTACHED BETWEEN STG JOR TO 31R, 31R TO 32R, & 32R TO 33R, ALLAT STA 1720. REMNANT OF A STRINGERCLIP STILL ATTACHED AT STG 32R, STA 1720.

NO APPARENT SOUTING PRESENT,

/WA =118/91 Blumderhuden Denis Sontions IAM Rep11-10-91 3-19.970

Stephin F. Iclupuition FAA-11-05-46 No Photo

B. HOCKING BOEING 11/2/96

1/2

