


RF 117

Log # 11-11-96-20
Green Area dredged Part
Tag# T6019

Skin Segment STA 920 to 980
STR 0 to str -5R

This area is jagged. Appears like large saw teeth. It does match with mating panel.

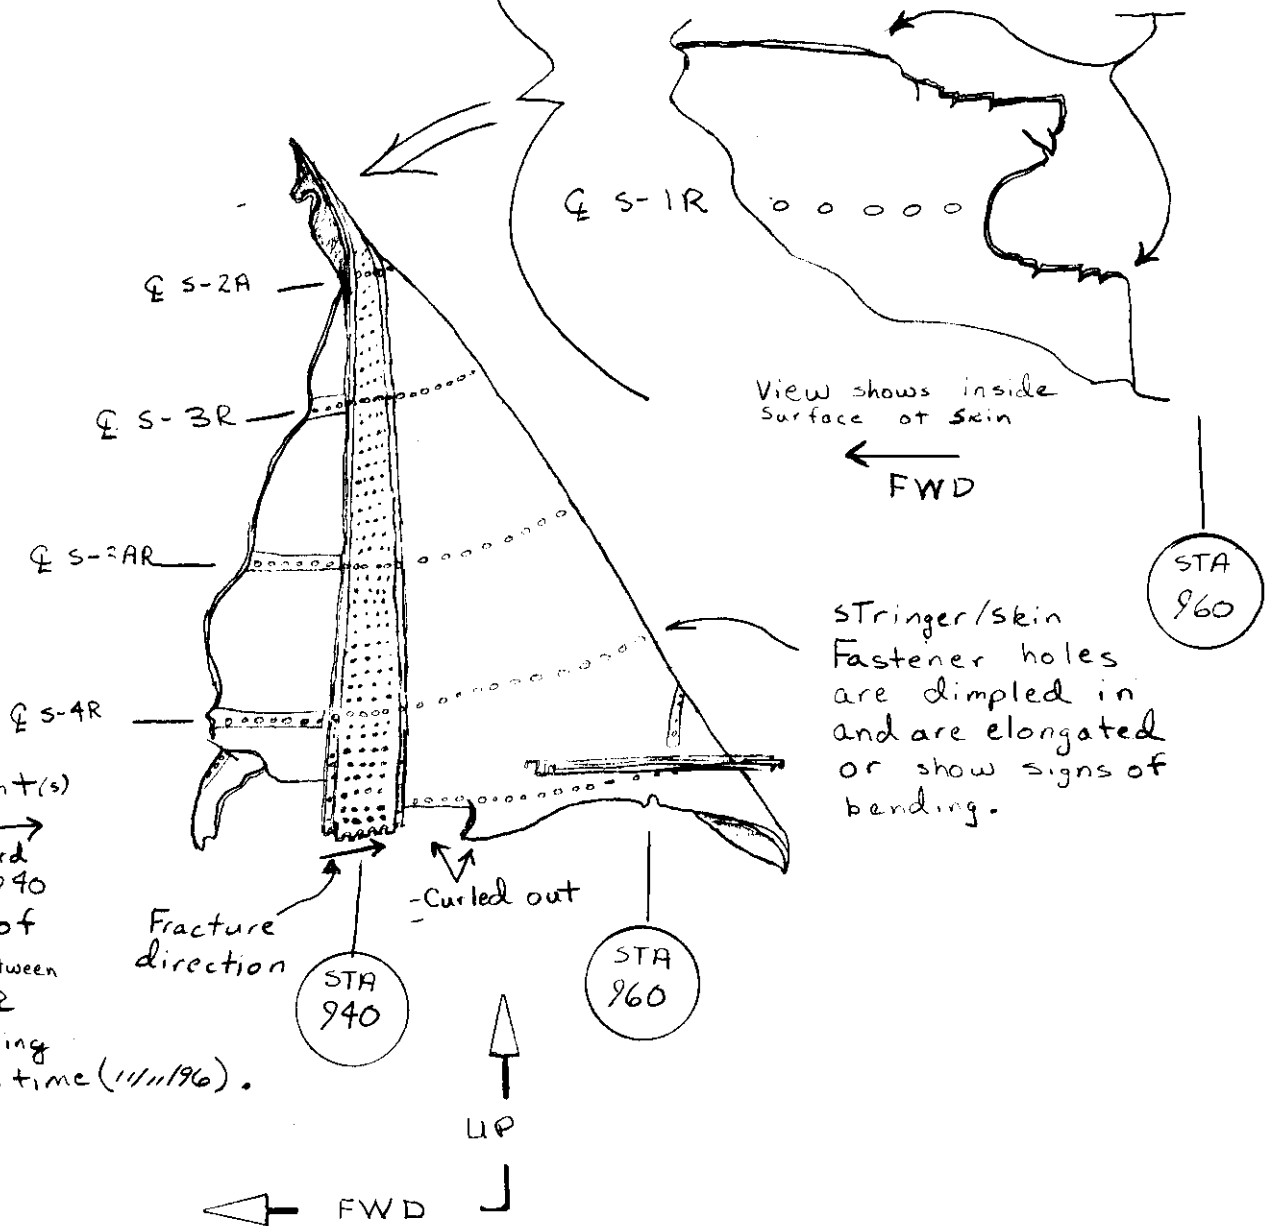

A segment(s) of skin just forward of STA 940 and aft of RF 19 between S-4R & 6R is missing at this time (11/11/96).

John Johns - ALPA
3-18-97

- Fracture surfaces on forward and Aft edge of panel are 45° fractures with a burr on the interior side of skin except in those areas smoothed by the dredging operation.

Dennis Santiago IAM
3-14-97

All Fractures appear to be ductile fractures

Stephen F. 11/14/96
17A 03-11-97
Jim Powers Boeing
11-11-96

RF 117 (4 sec 2)

