

LOG # RF127

TARGET # C-069

COORD: LAT _____


LONG _____

B.L. ϕ
RBL 33.99



B, HOCKING
BOEING
2/19/97

DEBRIS FIELD GREEN

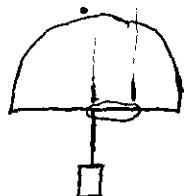

SEGMENT OF PRESSURE DECK
WEB FROM B.L. ϕ TO RBL 33.99,
STA 1404 TO STA 1458

VIEW A-A

WEB:

- 1) PORTION OF WEB FROM ~ STA 1410 TO 1424, B.L. ϕ TO ~ RBL 7.0 MISSING.
- 2) WEB CRACKED FROM RBL ~ 6.0 TO RBL ~ 23, AT ABOUT STA 1424,
- 3) WEB CRACKED FROM RBL ~ 5.0 TO RBL ~ 14.0 AT ABOUT STA 1414.
- 4) WEB CRACKS ORIGINATING AT ABOUT (RBL 3.0) (STA 1436) RUN DIAGONALLY TO ABOUT STA 1436, RBL 11.33 AND TO ABOUT STA 1442, RBL 11.33.
- 5) ALL EDGES OF WEB JAGGED ALONG FORWARD AND AFT EDGES, AND ALONG B.L. ϕ FROM ~ STA 1410 TO ~ STA 1424. EDGES ALSO JAGGED ALONG RBL 33.99 FROM STA ~ 1435 TO STA ~ 1458, WHERE A SLENDER REGION OF WEB IS MISSING (ABOUT 3" WIDE).

STIFFENERS:

- 1) ALL STIFFENERS RUNNING TRANSVERSELY ON BOTTOM OF WEB REMAIN ATTACHED (EXCEPT FOR THE ONE AT STA 1439) BUT ARE BENT AT VARIOUS POINTS ALONG THEIR LENGTHS.

FLOOR BEAM ATTACHMENT CHORDS

- 1) REMNANTS OF THE FLOOR BEAM ATTACHMENT CHORDS AT RBL 11.33 AND 33.99 REMAIN ATTACHED. ONLY THE HORIZONTAL FLANGES REMAIN, THE VERTICAL FLANGES HAVING DEPARTED WITH THE FLOOR BEAMS.

Dennis Santiago IAM
3-20-97

Stephen F. Kligo
FAR - 03-14-97

— CONTINUED —

1/3

10/19/97

LOG # RF127

THE WEB APPEARS DIRTY ON TOP AND BOTTOM SURFACES BUT HAS NO APPARENT SOOTING, EXCEPT AS DESCRIBED FOLLOWING:

THE OUTBOARD FLANGE OF THE RBL 33.99 FLOORBEAM APPEARS TO BE MODERATELY SOOTED ALONG ITS LENGTH FROM STA ~1409 TO ~1438. THE INBOARD FLANGE IS NOT SOOTED.

Stephen F. H. [unclear] +
FBI - 03-19-97

Dennis Bentley IAM
3-17-97

Leif D. Johnson - ALPA
3-18-97
Bhandalinder
TWA 3/19/97