


LOG # RF135

TARGET # DZ113

COORD: LAT \_\_\_\_\_  
LONG \_\_\_\_\_

RF135 CONSISTS OF FLOOR BEAM  
ABOVE PRESSURE DECK AT STA 1396 → DEBRIS FIELD WHITE  
1425. SEAT TRACK AND FLANGE IS IN-TACT ALONG MOST  
OF THE UPPER CHORD. LOWER CHORD IS FAILED IN RADIUS.  
ALL FASTENERS ARE PRESENT. VERTICAL STIFFENER  
ON OUTBOARD SIDE IS UN-DAMAGED INBOARD STIFFENER  
IS MISSING FLANGE.

*Robert M. [unclear]*  
TWA 2-28-97

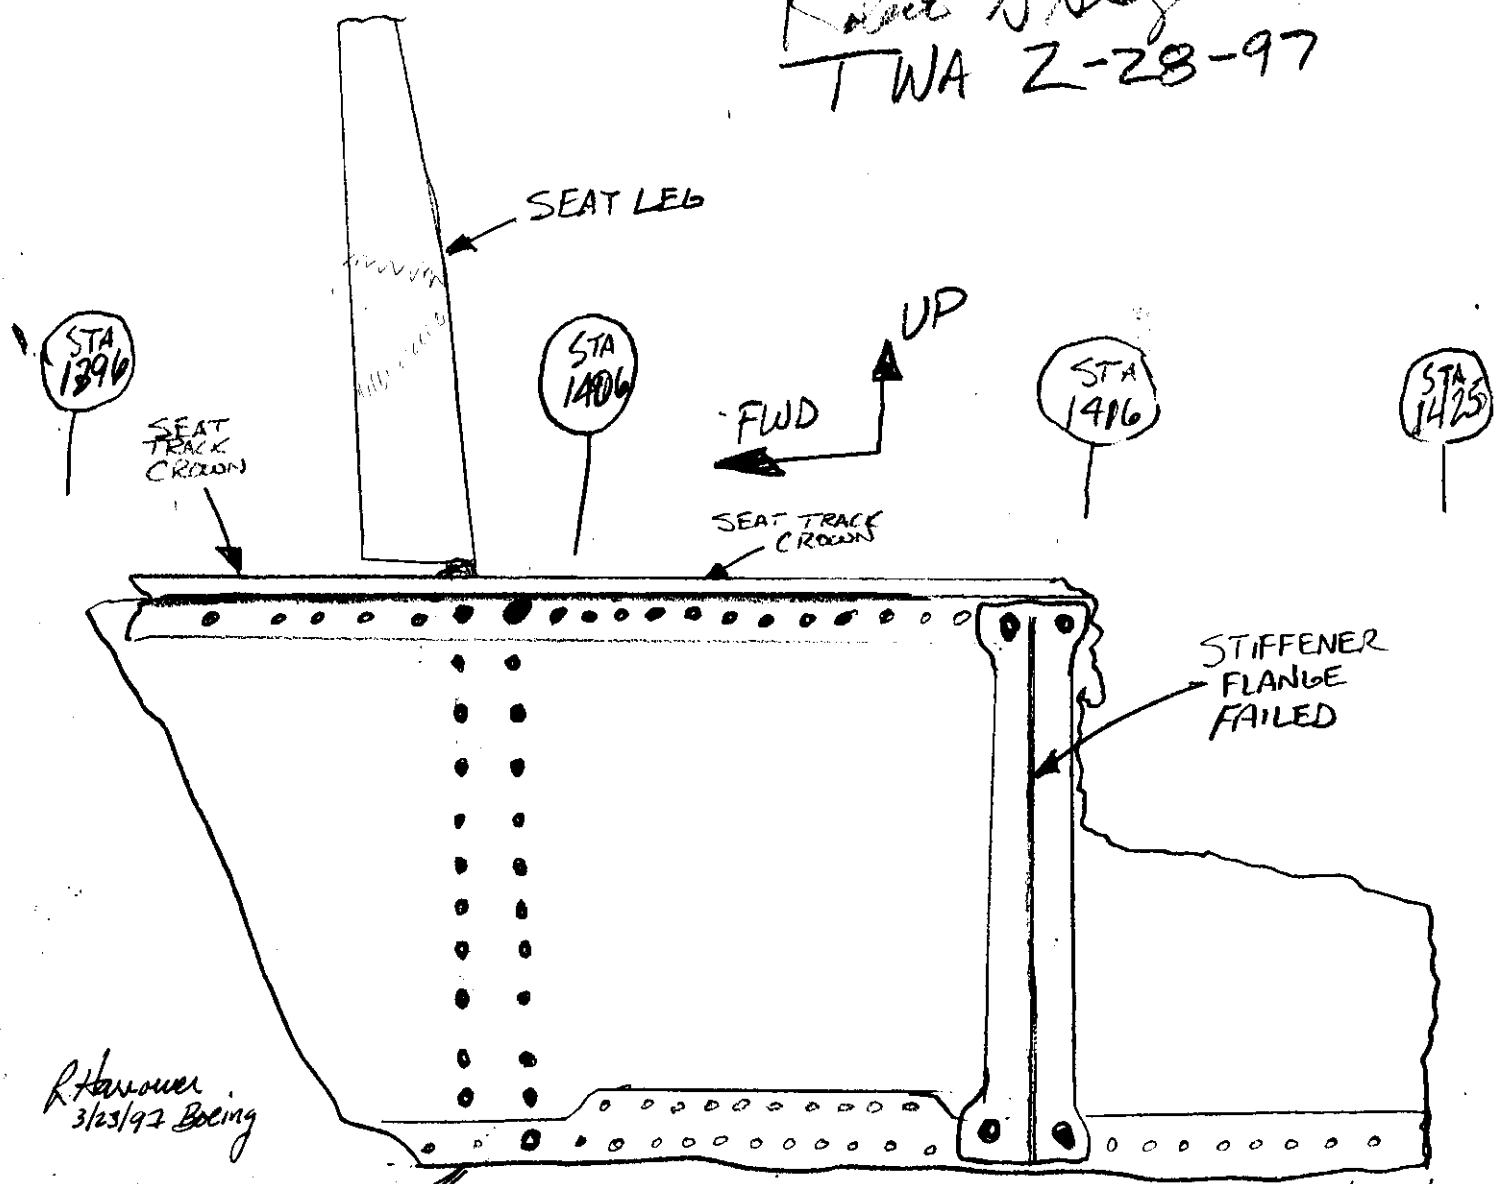

*R. Hanover*  
3/23/97 Boeing

LWR CHORD  
FAILED AT RADIUS

*Stephen F. Klupcton*  
F01-03-06-97


*Dennis Santiago* TAM  
3-17-97

*Leigh D. [unclear]*  
3-17-97

65B1336 55

65B08268-1  
65B13353-1  
65B15483-1  
65B15483-55


65B08269-1  
65B13354-1  
65B15484-1

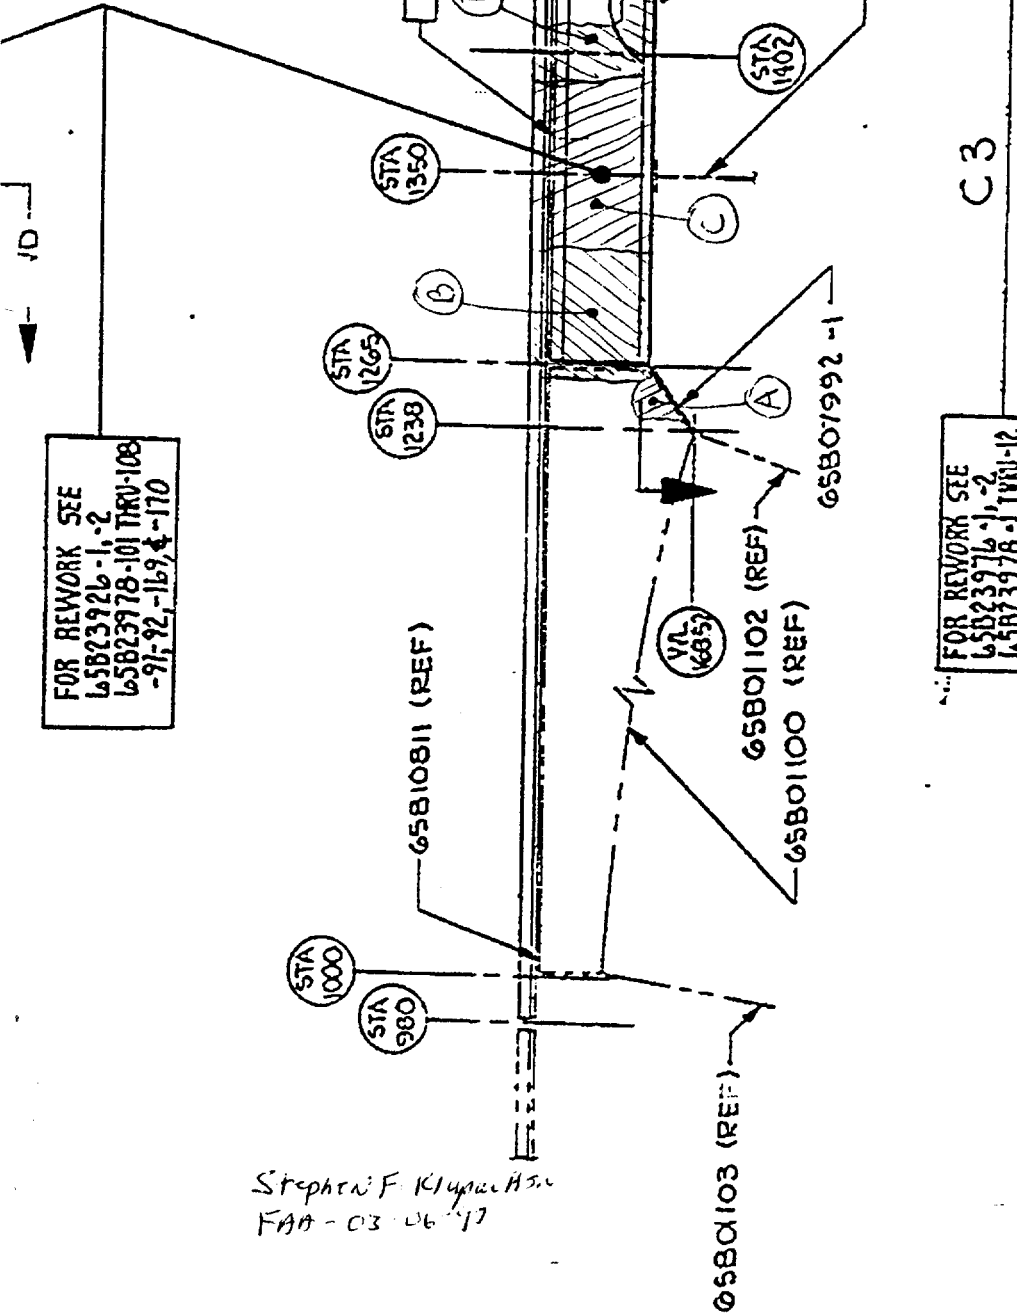

FOR REWORK SEE  
65B23926-1, 2  
65B23978-101 THRU-108  
-91, 92, 159, & -170

FOR REWORK SEE  
65B23976-1, 2  
65B23978-1 THRU-12  
65B27106-1, 2, 3, 4

ITEM	LOG #
A	LF16A *
B	RF126 *
C	LF135 *
D	RF135

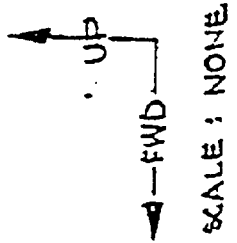

RBL 11.33  
FLRBM

\* PART OF

Stephen F. Klupach  
FAA - 03-06-97