



LOG # RF 163
 TAG
 TAGSET # X4076
 COORD: LAT _____
 LONG _____

STA 780 FRAME SEGMENT
 STR 35R -> 38R

DEBRIS FIELD RED
 FBI # 11/20/96-179

- SEGMENT INCLUDES FRAME WEB FROM STR 35R -> 5-38R
 FRAME INNER CHD FROM STR 36R -> 38R
- SHEAR TIE FLANGES ARE INTACT STR 35-36, 37R-38R
 SHEAR TIE-SKIN FLANGE IS SEVERED OFF BETWEEN
 STRS 36 & 37
- FAILSAFE CHORD IS ATTACHED TO PART FROM STR 35-38R
 CHORD IS FRACTURED @ STR 36 1/4 & BENT FWD 30°
- A 3" x 6" SEGMENT OF FRAME WEB IS PUSHED FWD JUST
 BELOW STR 36
- PART IS FREE OF SOOT

Dennis Santiago JAM
 3-25-97

Tom Todman
 FAA (3-20-97)
 B. W. Anderson
 TWA 3/19/97

Leigh Johns - ALPA
 3-19-97

Pg 1041
 R. Hanawa 3/6/97