

Sec AA  
Looking Fwd

LOG # RF172

TAG # C2505  
~~TARGET~~

COORD: LAT \_\_\_\_\_

LONG \_\_\_\_\_

DEBRIS FIELD GREEN  
FBI Lot  
P-24-96-7

A section of Sta 1600 frame from  
7" above Str 16 R to 5" below Str 20 R.

The stringer clips are attached to the frame.

The shear tie between Str 16 R and 17 R is  
attached to the frame. The center third of the  
shear tie, skin flange, remains with the shear tie;  
the rivet tails common to the skin pulled through.

The frame is twisted 90° from end to end.

The outer flange is missing above str 16 R, as is  
the fwd extension of the Str 16 clip.

The outer flange is missing below Str 20, as is the  
portion of the str 20 clip common to the stringer.

The frame inner flange is cracked, continuing  
into the web, btwn Str 16 and 17 and  
btwn Str 17 and 18.

The frame web is cracked from the outer str 20,  
up to the mid point at Str 19.

Possible light soot in places.

Dennis Santiago IAM  
4-21-97

Robert A. [Signature]  
4/24/97 TWA  
R. Newley 4/30/97  
FBI

Henry Missel  
4-18-97 Boeing  
[Signature]  
4/24/97 ALPA


(Y2)

RF 172

C2505

GREEN

STA 1600 R/H Frame Segment

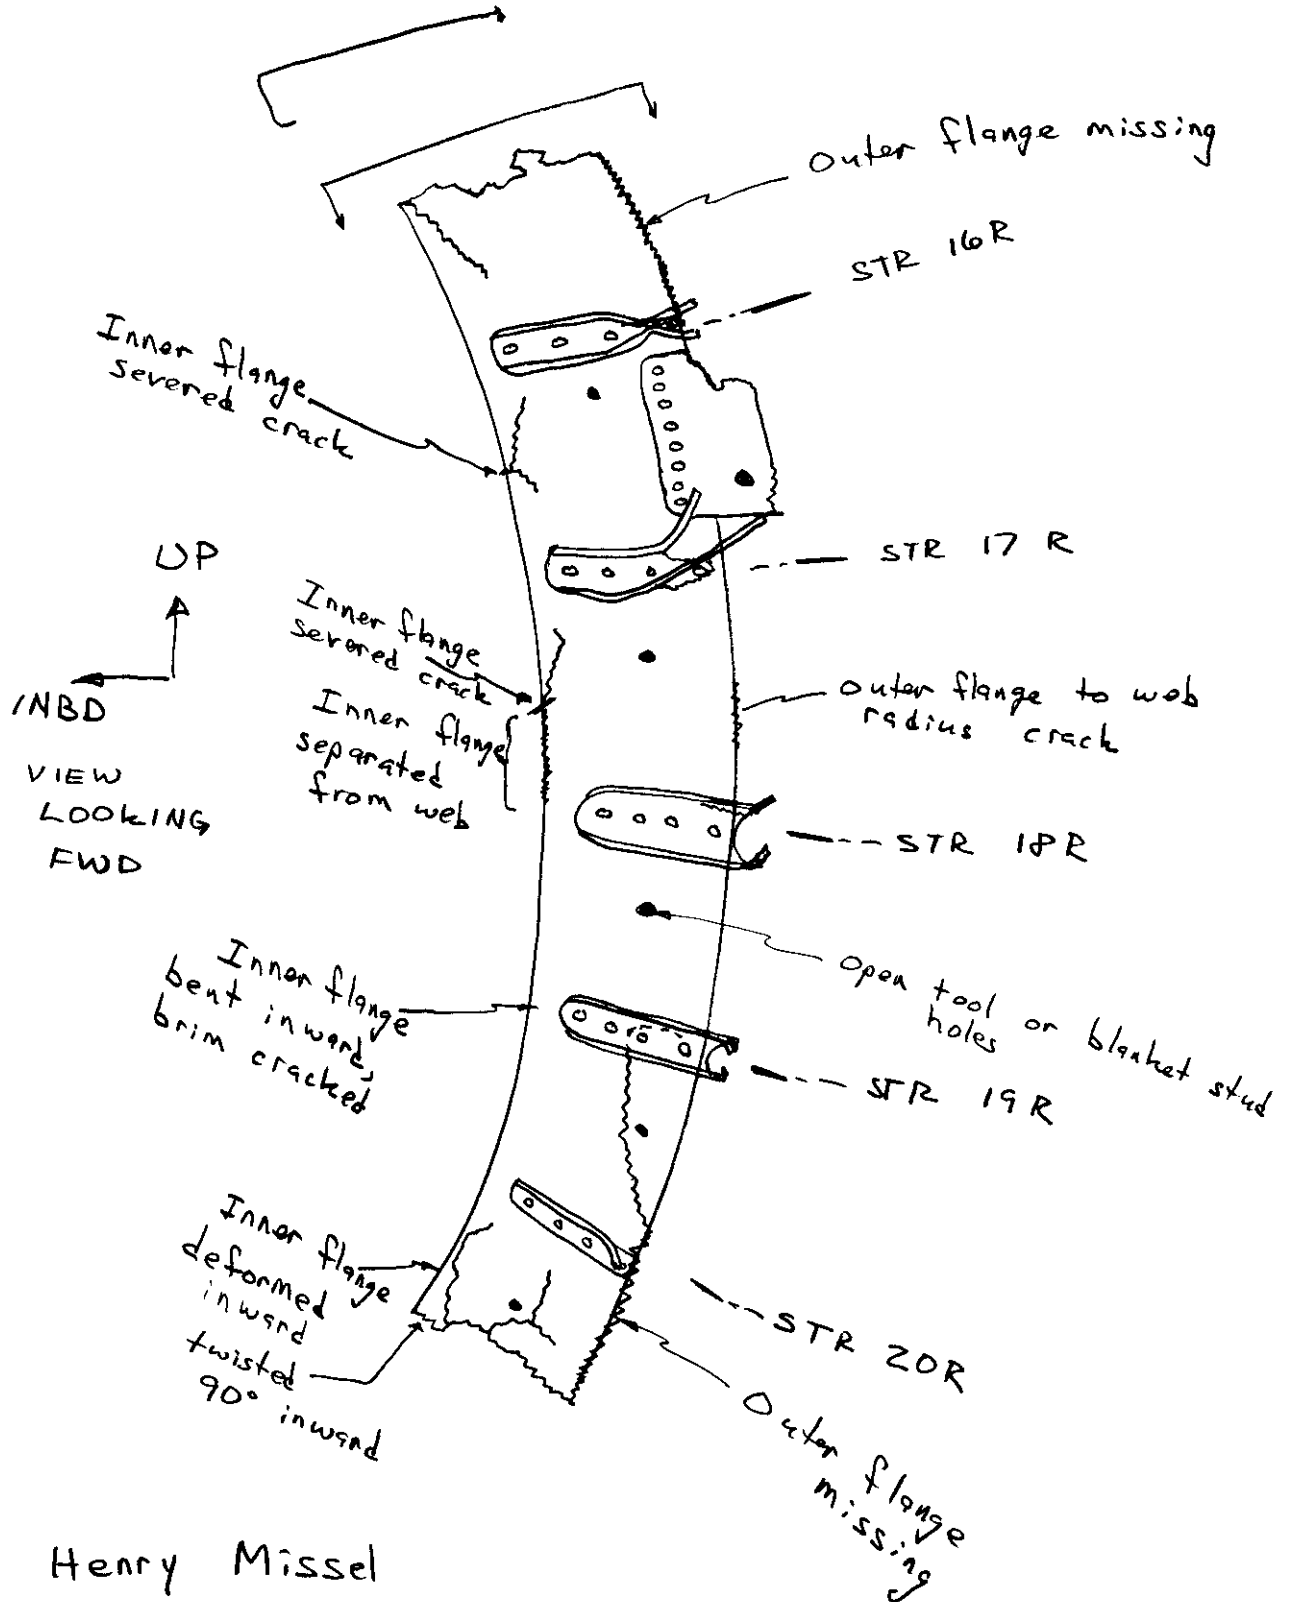

Henry Missel  
4-18-97 Boeing