

LOG # RF-30 RTB 4/2/96
PMS

TARGET # _____

COORD: LAT _____

LONG _____

SKIN ABOVE
CARGO DOOR
ON RHS

DEBRIS FIELD NOT
AVAILABLE

- Ⓐ - C2252 GREEN - C11Z?
- Ⓑ - C2253 "

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

Tom Todino
10/17/96



Dennis Santiago I AM
10/14/96

Jim King
TWA 10-11-96

SK FAA

8/13/96 1073
R Harover. 2

RF-30

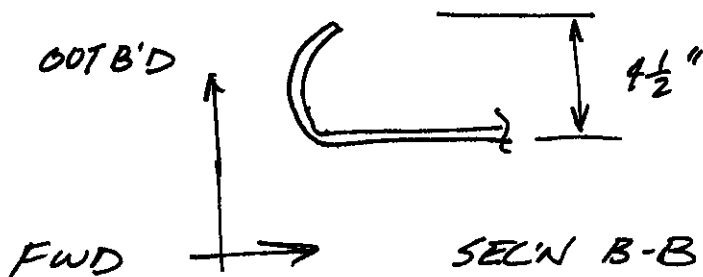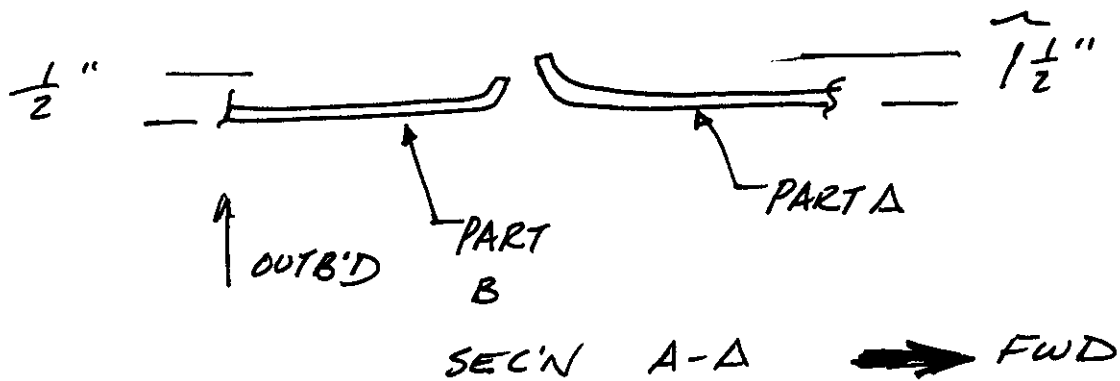


- ALL FRACTURE FACES FREE OF SOOT/BLACKENING
- EXTERIOR SKIN IS FREE OF BLACKENING, 20% OF PAINT (RED) HAS PEELED
- 90% OF STRINGERS INTACT, SEVERED AT STA 1840
- FRAMES AT STA'S 1840, 1860, 1880 & 1940 ARE MISSING
- UPR MAIN SILL INTACT FOR LENGTH OF PARTS A & B EXCEPT IT HAS BEEN JAMMED UPWARDS / ROTATED OVER 90° BTWN STA'S 1860 & 1900 FROM INBD TO OUTBD DIRECTION. SILL WEB & INNER CHORD MISSING FROM STA 1920 AFT

3

8/13/96
R. Hanauer

RF-30 C

FAILURE THRU FASTENER LINE

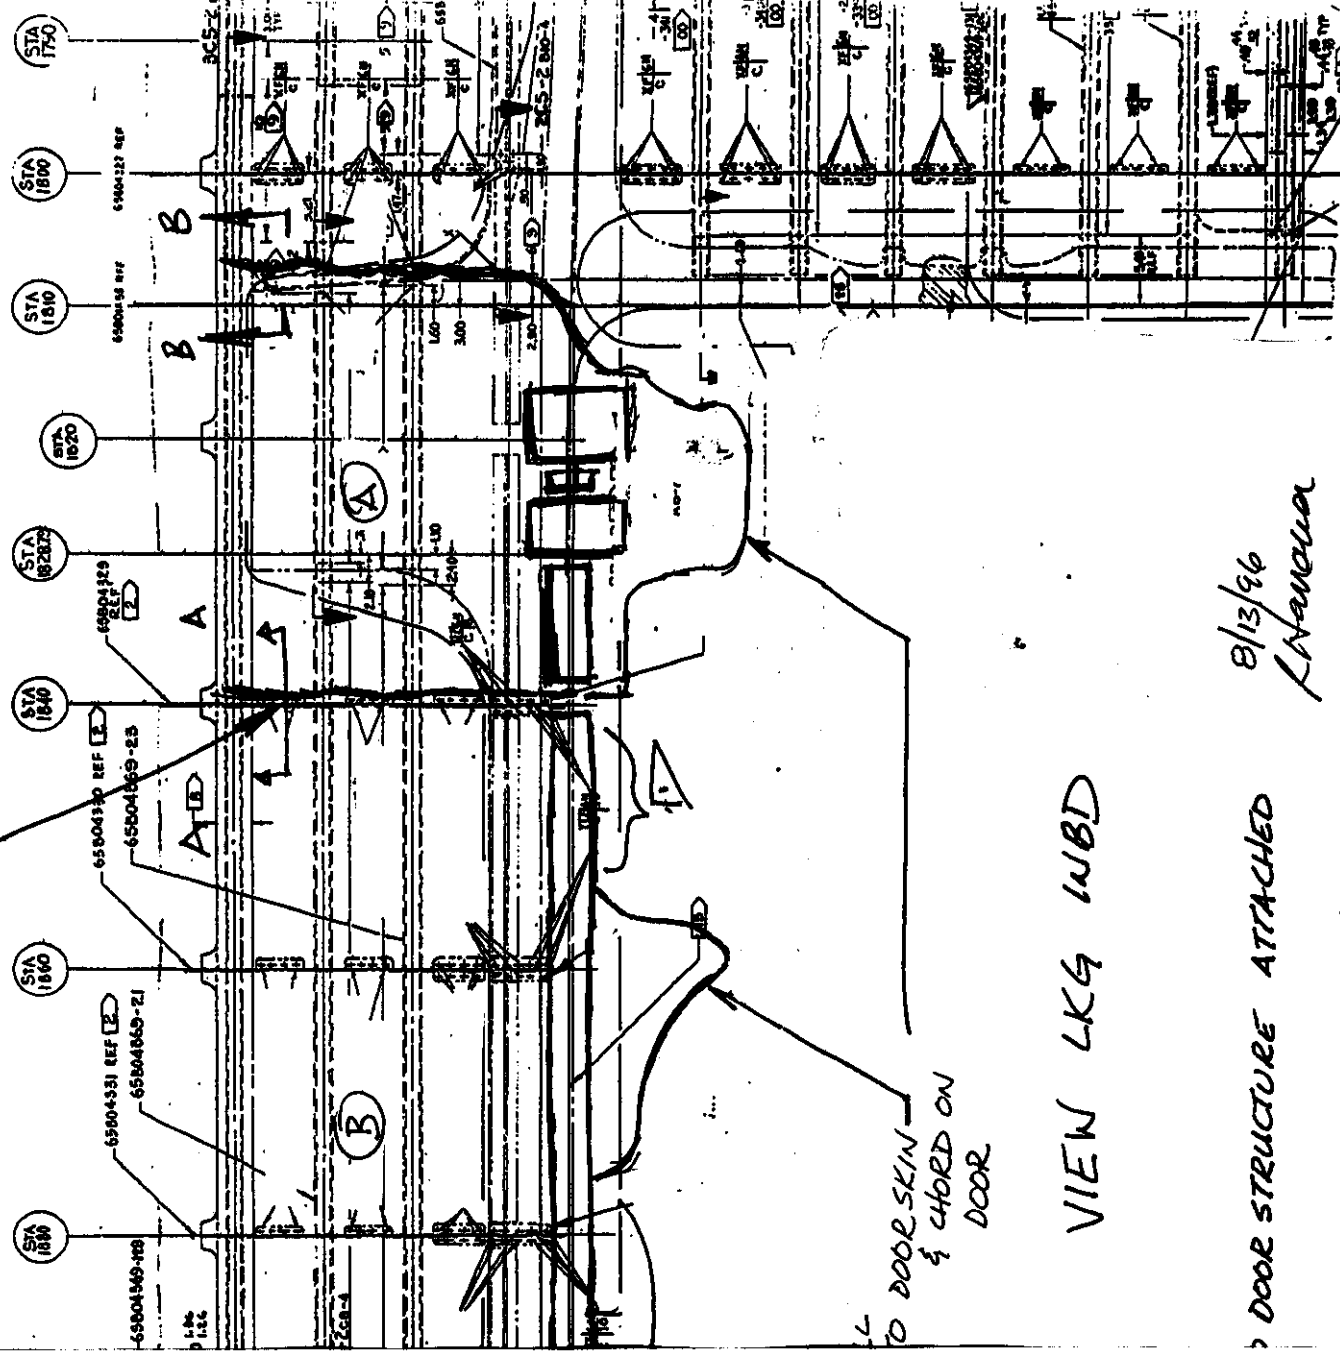

8/13/96
L. Hancock

DOOR STRUCTURE ATTACHED

VIEW LK4 WBD

TO DOOR SKIN
& CHORD ON
DOOR