

LOG # RF 67 *RF 20219*

TARGET # \_\_\_\_\_

COORD: LAT \_\_\_\_\_

LONG \_\_\_\_\_

DEBRIS FIELD \_\_\_\_\_

TAG # C 1696

\*C 1674 *on WIRES*

SEE ATTACHED SHEETS

REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE

REFER METALLURGY GROUP NOTES

Dennis Santiago  
10/24/96

*2*  
You Za  
10.23.96

VIEW LOOKING INBD

UP  
FWD

RF 67  
PAGE 1

TAG # 01096

BACK OF PANEL  
VERY CLEAN

STA 1000

STA 980

STA 960

BRACKET  
HEAVILY BURNED  
STA 940

STA 920

S-29

PANEL UNZIPPED  
AT FASTENERS

EMERALD  
CORAL

HEAVY  
SOOT

VERY LIGHT  
BOILING  
SLANT FACE FRACTURES

HEAVY SOOT  
PATTERN

TIP COILED IN

CORLED OUT

PANEL TORE JUST  
BELOW S-34 LAP  
SPICE  
WHITTINGTON  
8/31/73

INSULATION ON FEEDER  
CABLES BURED ON BOTH SIDES  
OF PANEL

LAST 3  
FEET OF WIRES  
ARE CLEAN


MAINTAINS  
COMTOUR

WIRES CLEAN  
AT BODY  
ENTRANCE

WIRES  
LIGHTLY  
SPOTTED

WIRES  
HEAVILY  
BURNED


SEE  
PAGE 2

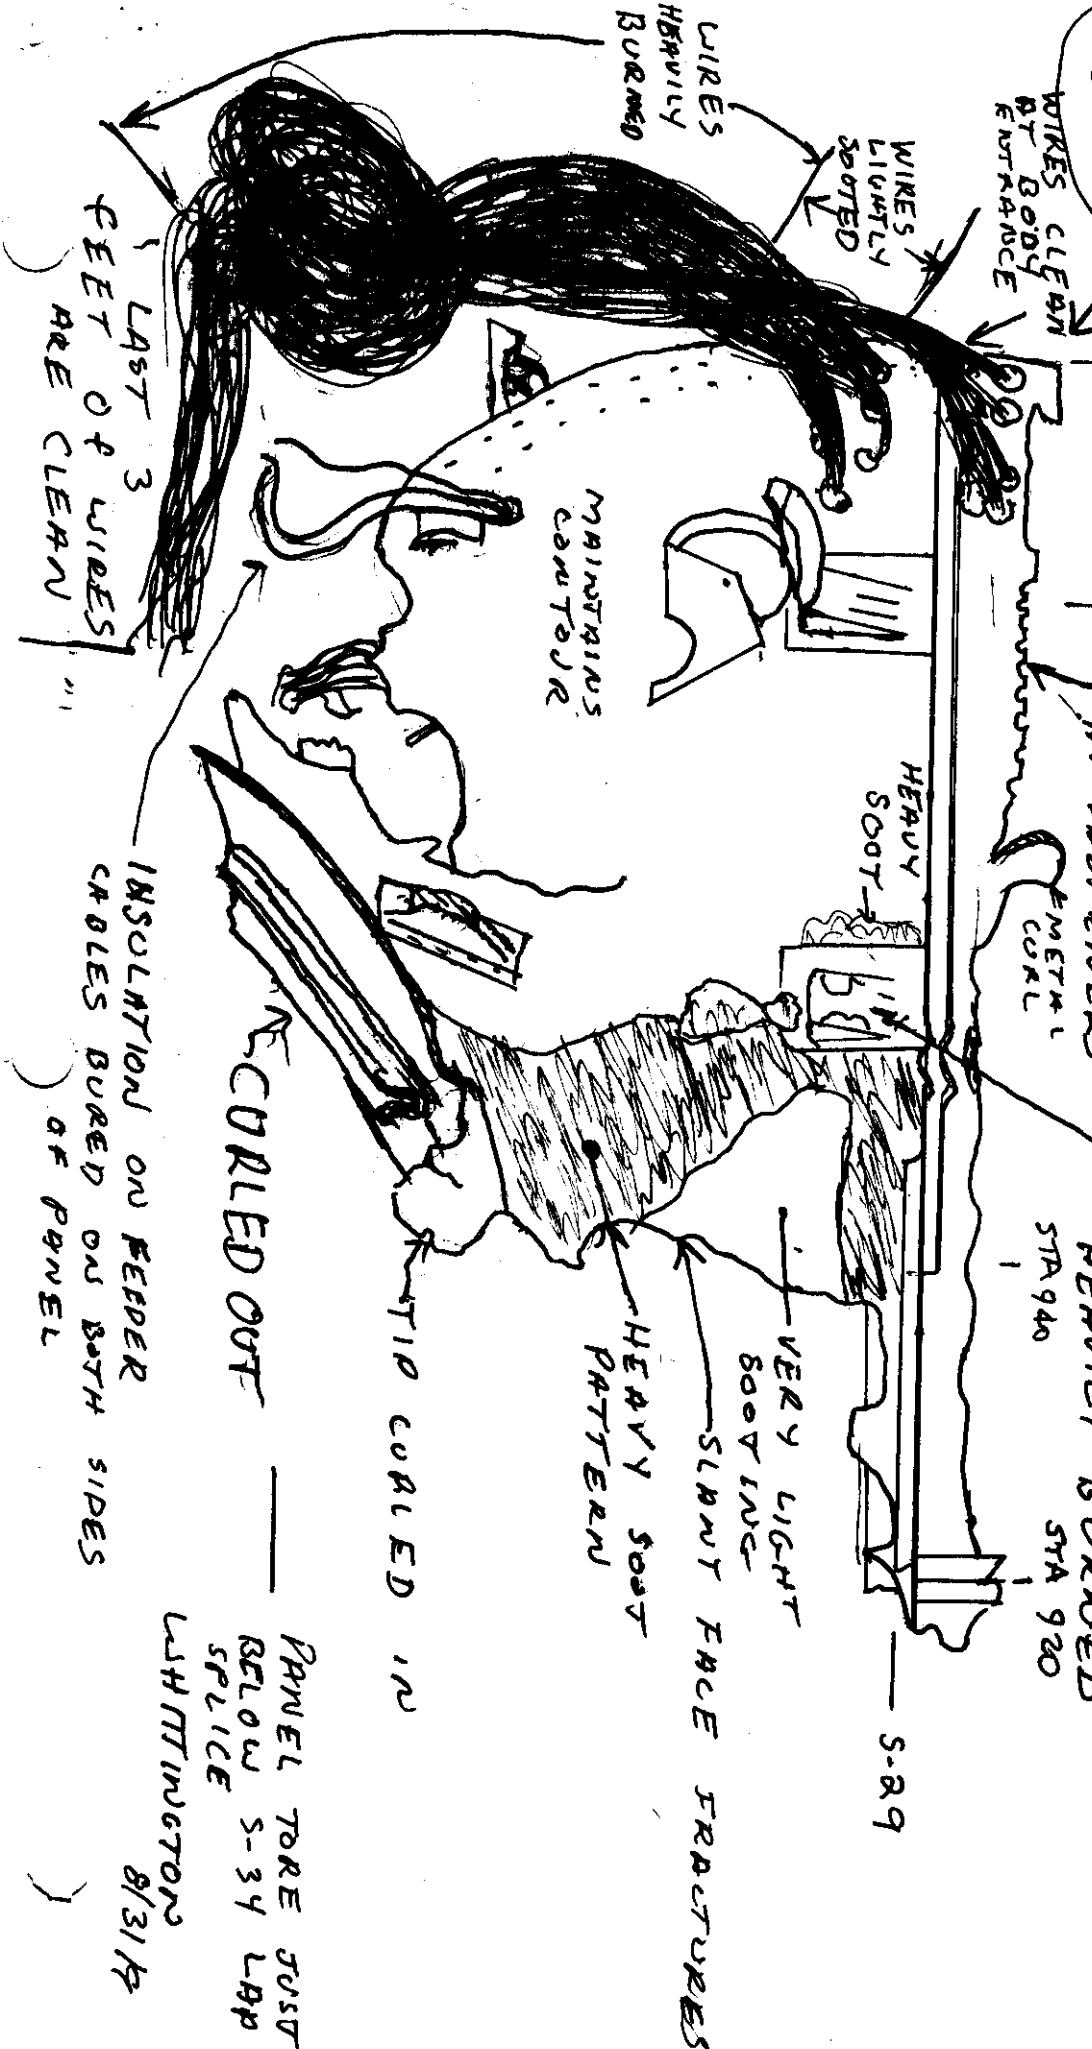

FASTENERS UNZIPPED  
HW SCUTOOTH PATTERN  
BETWEEN STA'S  
980 & 960 ALONG  
TOP OF PANEL

RF67  
PAGE 2

VIEW LOOKING  
FWD + OUT BD

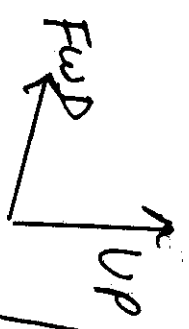

WHITTINGTON 8/31/96

STA 980

NO BURNING  
NO SCOTING

WIRES CLEAN  
AND HAVE  
NOT BEEN  
FOLDED THROUGH  
PANEL

CONNECTOR  
PANEL

PANEL CREASED ABOUT 3"  
FROM TOP ABOUT 45° INBOARD

STA 1000

DUCTILE FAILURE  
NO BENDING EVIDENT

SKIN PANEL PULLED  
OUT

PICKLE FORK PULLED  
INBD + BROKEN OFF

EDGE OF HOLES IN  
JOIN RING VOLCANO'D  
INBOARD + UP

John J. FFA  
10.23.96



