



# RIGHT WING RW-24

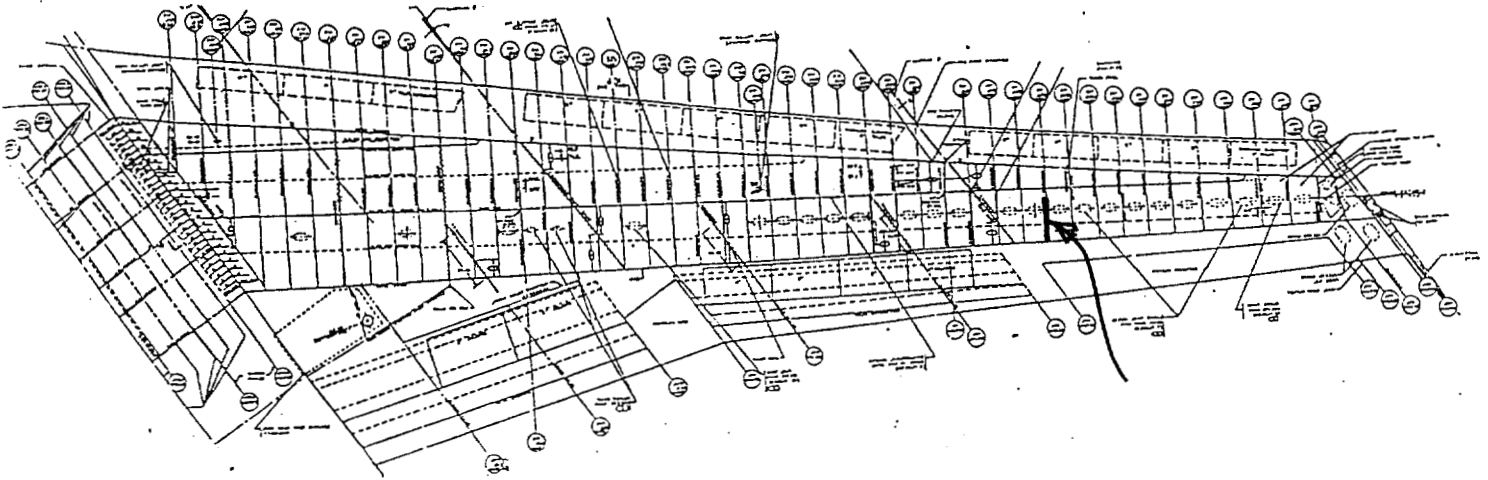

LOG # RW-24  
 TARGET # \_\_\_\_\_  
 10/07-5 (10/7/96)

COORD: LAT \_\_\_\_\_  
 LONG \_\_\_\_\_  
 DEBRIS FIELD \_\_\_\_\_

RIGHT HAND WING STATION 1252 RIB. FRACTURED AT STR-14 UPPER AND STR-10 LWR. FWD SECTION MISSING. SEGMENTS OF STR-14 UPR AND VENT STRINGER (LOC STR 12) STILL ATTACHED. (NOTE: THESE STRINGERS MATE WITH FRACTURE FACES ON CORRESPONDING STRINGERS ON PANEL RW-1 JUST OUTBD OF THIS RIB) (ALSO NOTE THAT THESE SEGMENTS ARE SOOTED EVEN ON FRACTURE FACES, WHILE MATING PIECES ON RW-1 ARE CLEAN) WEB IS BURNED THRU ALL BAYS BETWEEN RIB STIFFENERS.

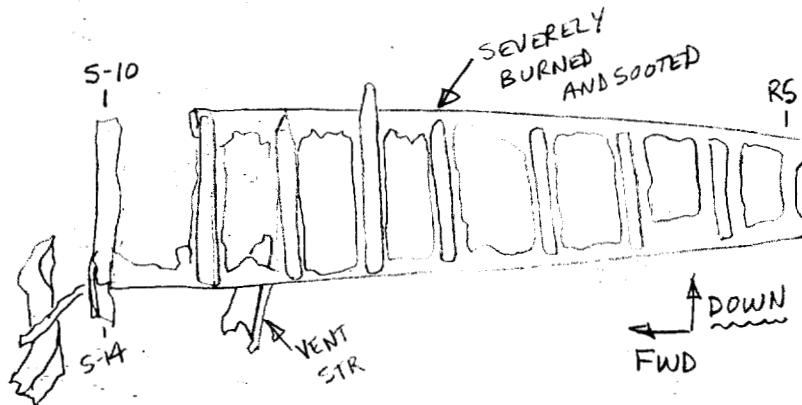

D. ORTH - BOEING  
 10/24/96  
 Stephen F. KLIMPACZ  
 FMA-10-27-96  
 No Photo  
 SD GREEN ALPA  
 11-13-96  
 B. VANDERHOUTEN TWA  
 11/18/96  
 Dennis Santiago IAM  
 11-27-96