REFER FIRE AND EXPLOSION GROUP NOTES FOR FIRE DAMAGE RW-9

CO40 GREEN DEBRIS FIELD

RIGHT HAND WING UPPER SKIN


RH WING UPPER SKIN FROM WS 1280 TO 1423 WITH NO STRINGERS REMAINING ATTACHED. PART EXTENDS FROM REAR SPARTD STRINGER 8 LOCATION AT WS 1280 AND IS TORN DIAGONALLY TO THE REAR SPAR AT WS 1423. THE HORIZONTAL FLANGE OF THE REAR SPARAREMAINS ATTACHED TO THE SKIN FROM WS 1343 TO WS 1392. THE CHORD IS FRACTURED IN THE VERTICAL FLANGE AT THE RADIUSTANGENT. ALL OTHER REAR SPAR CHORD IS MISSING.

THE OUTBOARD END OF THE PANEL IS BENT DOWNWARD FROM WS 1392 OUTBD,

THIS PANEL SHOWS NO FIRE OR SOOT EVIDENCE,

D.ORTH - BOEING 10/24/96 Stephen F Klapulton FAA 10-29-46 SOGBEEN 11/03/46 AUNA Dennis lantinge IAM 11/26/94 Meil Scould TWA 1.11-97

RW-9

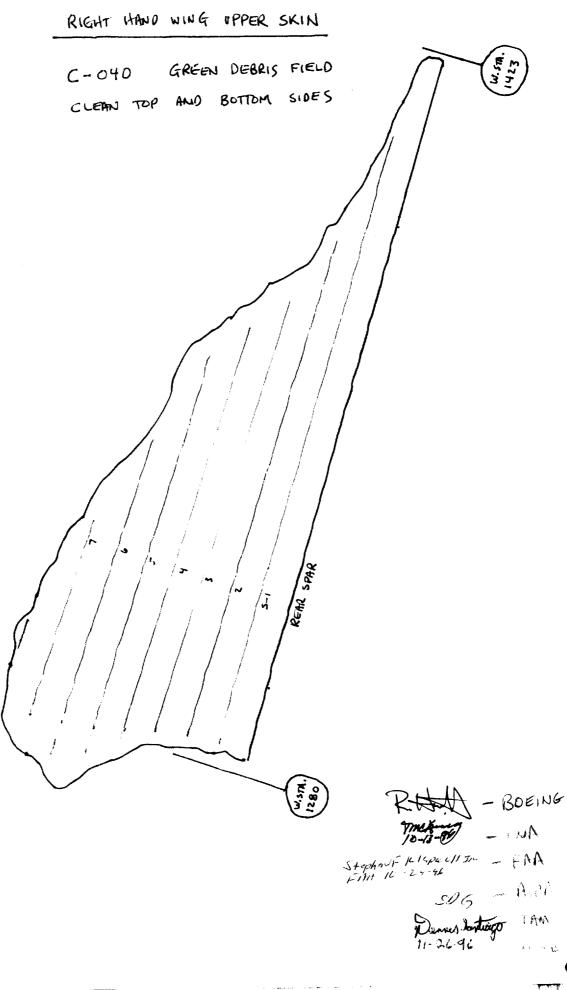

ور زی سال