


V-6

LEFT SIDE

TAG # D2020

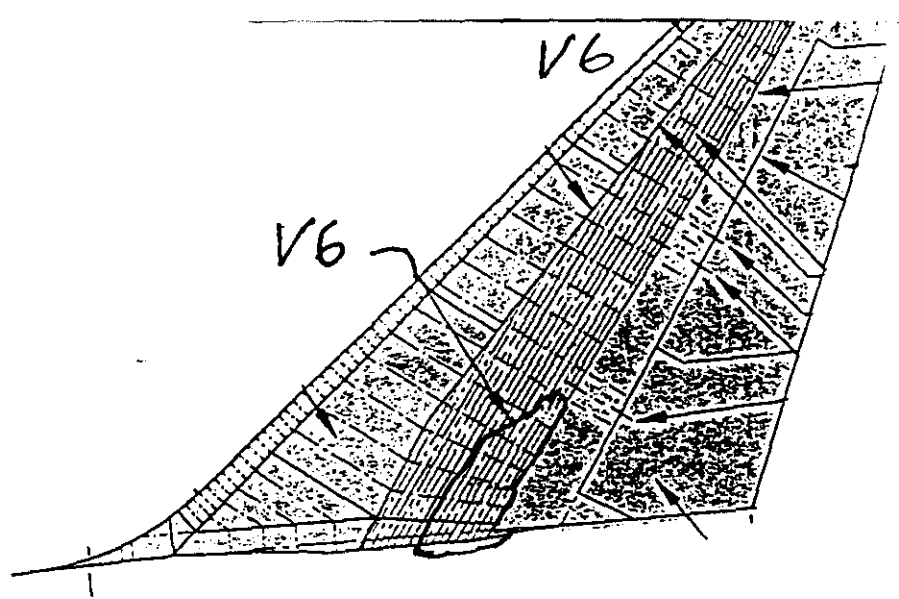

V-6

SKIN PANEL + STRINGERS FROM VERTICAL FIN FROM REAR SPAR TO STRINGER 9. BOTTOM OF PANEL INCLUDES BULKHEAD FROM STRINGER 9 AFT TO END OF FITTING. TOP OF PANEL IS GENERALLY FIN STR 230. FORWARD SIDE OF PANEL FAILED AT STRINGER 9 FASTENER LINE. UPPER EDGE OF PANEL IS TAPPED AND UNEVEN. AFT SIDE OF PANEL INCLUDES SPAR CHORD. REAR SPAR WEB FAILED AT FASTENERS. LOWER END OF PANEL STILL ATTACHED TO BULKHEAD. BULKHEAD FAILED AT STRINGER 9 IN TENSION.  
NO SMOKE OR FIRE DAMAGE.

WHITTINGTON

9/4/96

Robert E. Livingston

TWA 9-28-96

Stephen F. Klupach Jr


FAA 10-29-96

Dennis Santiago IAM  
10/22/96

*[Signature]*  
12-16-96

V-6


V-6  
LEFT SIDE

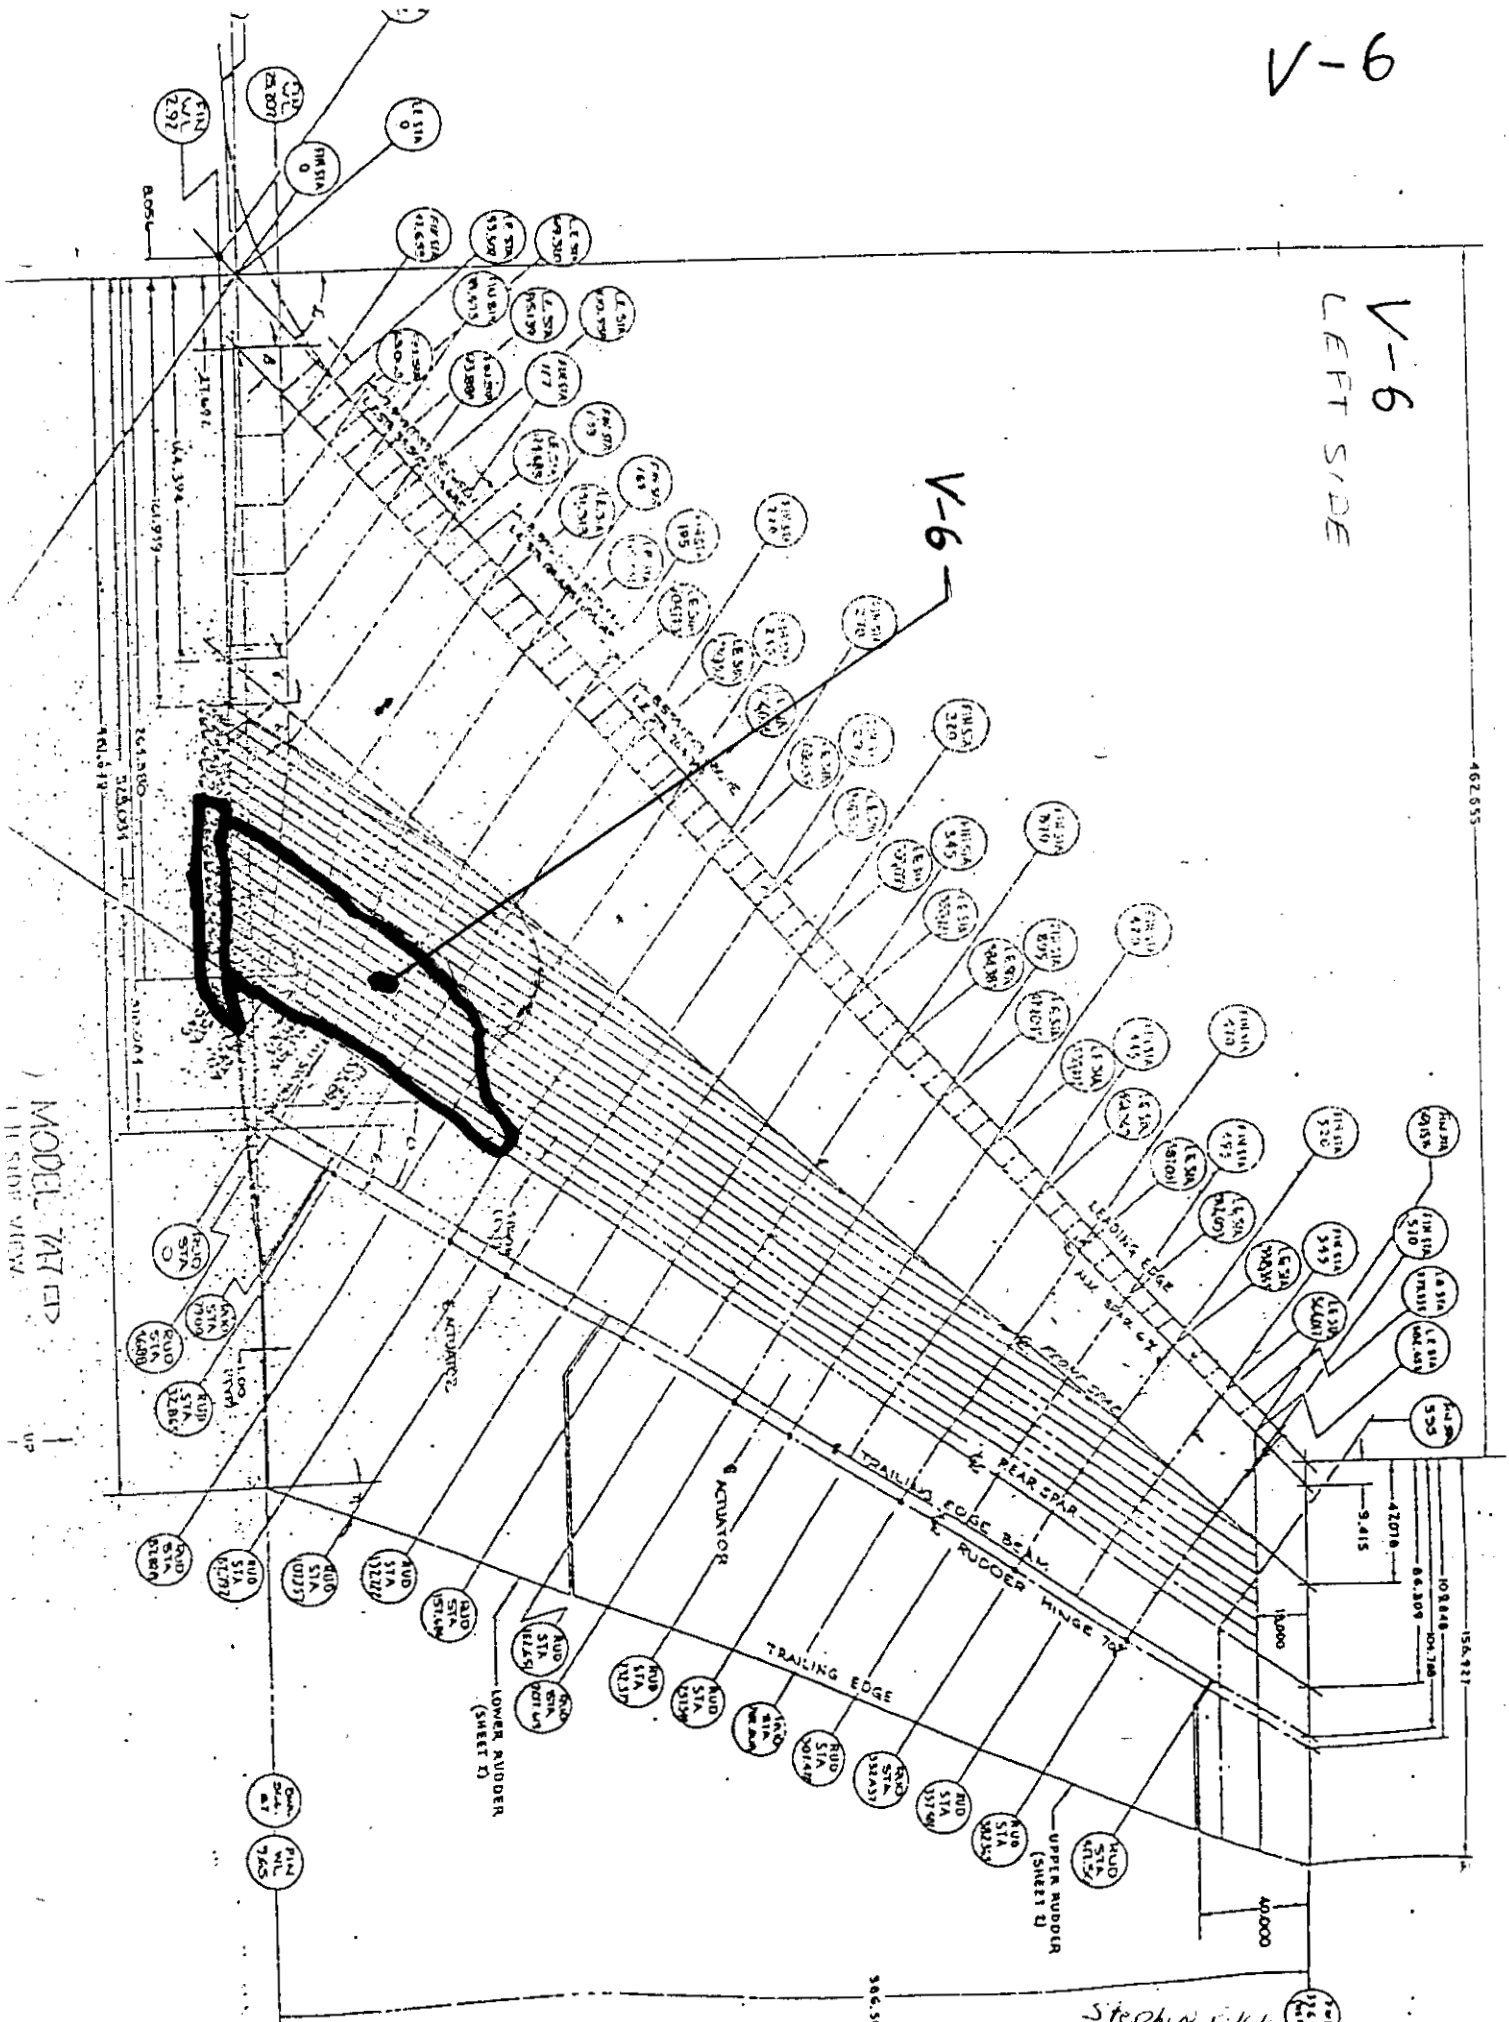

MODEL TYPED  
LEFT SIDE VIEW

Stephen P. Kelly  
FAA 10-27-96

V-6  
LEFT SIDE

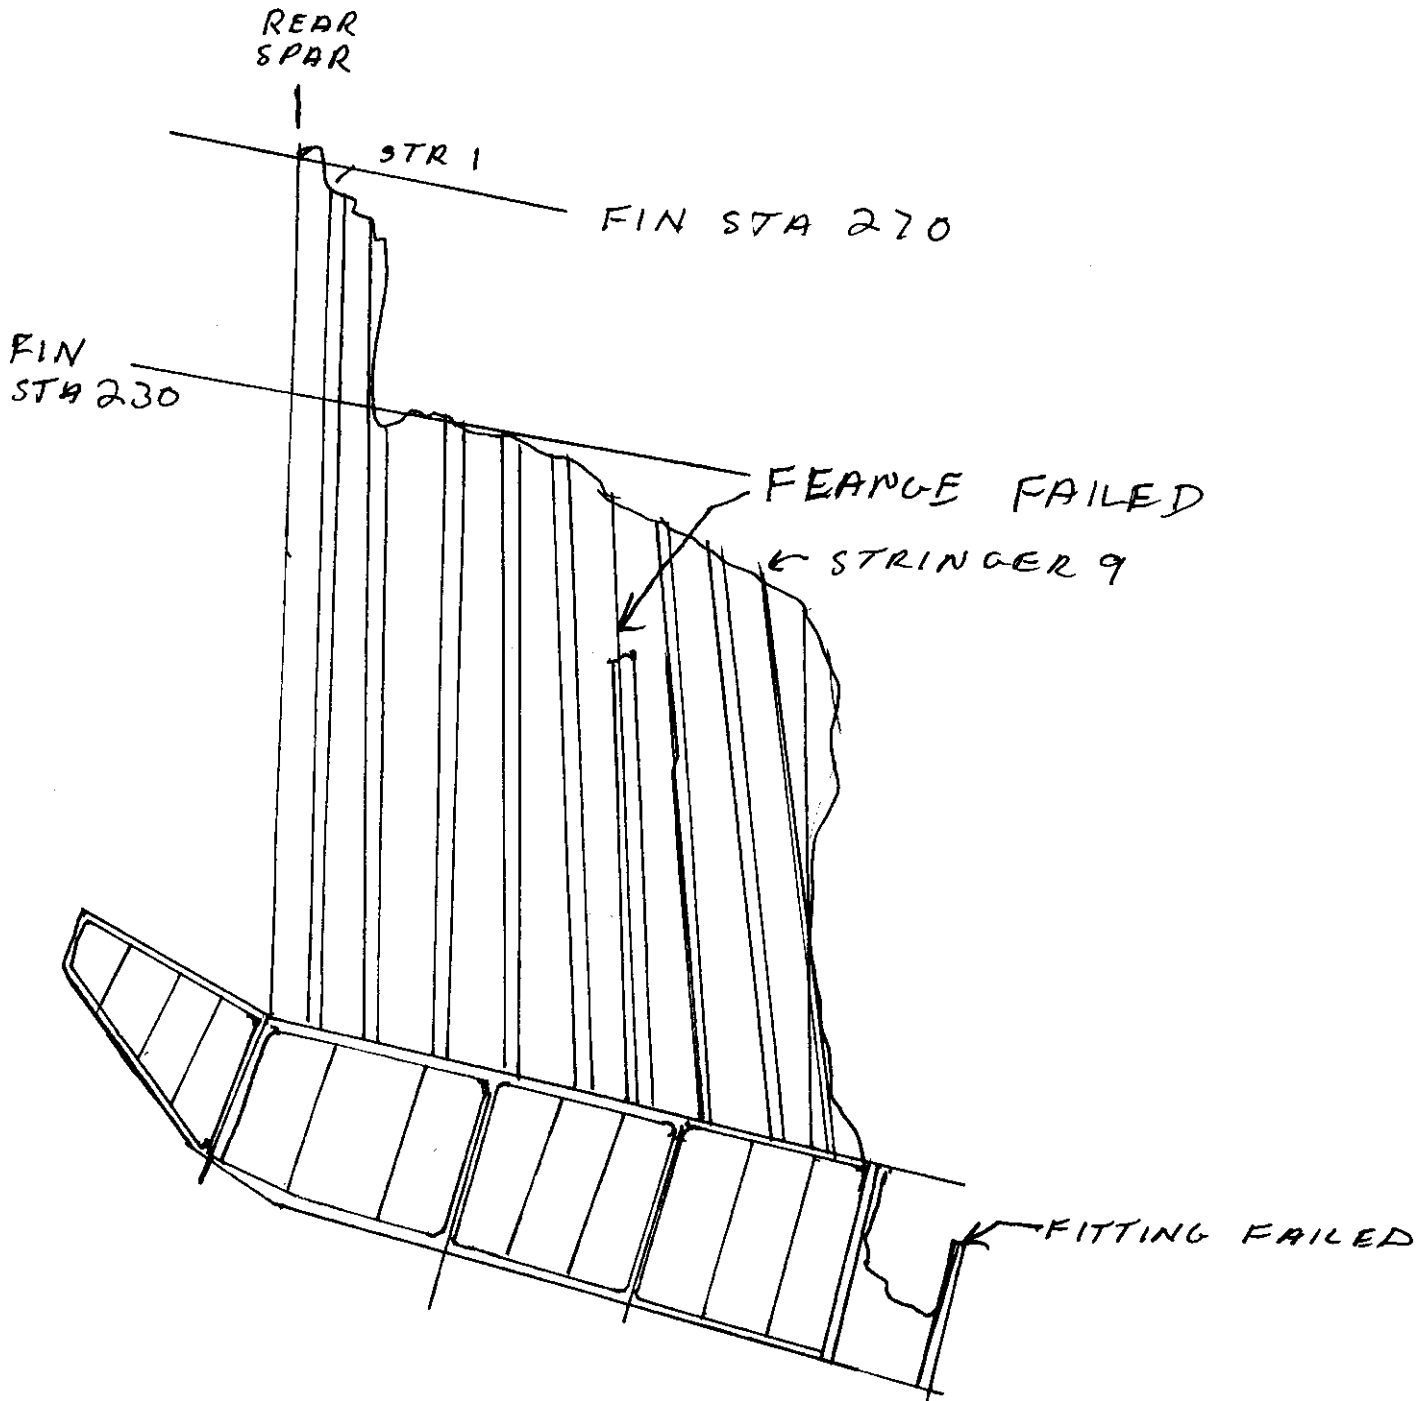

WHITTINGTON

9/4/96

Stephen F. Klappert  
FAA-70 24-96