


V-8
DEBRIS FIELD → GREEN
TAG# C1656

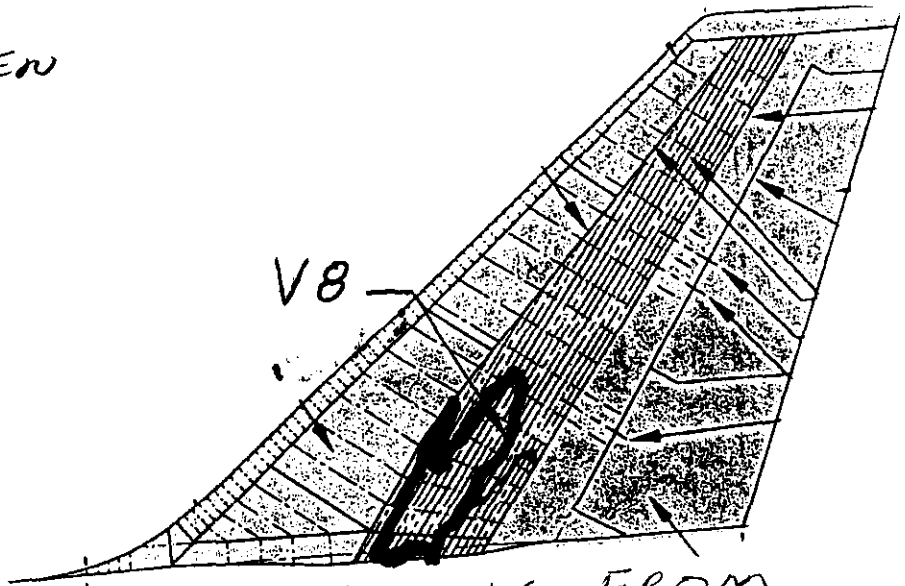

RHS R/L 12/13/96

V8- LWR VERTICAL FIN SKIN + STRINGERS FROM BODY CROWN UP TO FIN STA 245. FROM FRONT SPAR TO STRINGER B. PANEL IS FLAT EXCEPT FOR SLIGHT BENDING OUTBOARD OF THE UPPER 10" OF PANEL. THE REAR SIDE OF PANEL FAILED ALONG FASTENER HOLES FOR STRINGER B. THE UPPER SIDE IS JAGGED AND STRINGERS FAILED ^{fractured} IN TENSION ≈ 3 FEET FROM TOP OF PANEL. STRINGERS ARE BOCKLED ALONG LINE ≈ 3 FEET FROM BOTTOM OF PANEL. FWD SIDE OF PANEL FAILED IN MIDDLE OF BAY BETWEEN STRINGERS 13-14 & 14-15. BOTTOM PANEL FAILED AT STRINGER END FITTINGS. FRACTURED THRU THE SKIN AND ATTACH FITTINGS. PART MATES WITH V2 & V9. MINOR OUTBOARD BENDING AT BOTTOM END. NO SMOKE OR FIRE DAMAGE.

R.L. WHITTINGTON

9/3/96

Robert E. Whittington TWA

9-28-96

Stephen F. Klapachin
FAA 10-29-96

Dennis Santiago IAM

10-22-96

R. Hanover 12/13/96

TBC

Dennis Santiago IAM
12-16-96

12/16/96 TWA

R/S

10-24-96
12-16-96