



Systems 9 - Exhibit No. 9B - Photo 13. Figure 13c. As received condition of the RTV circuit breaker. Upper arrow highlights the corroded terminal hardware. Lower arrow highlights the missing actuator stem and mounting bushing.