



Systems 9 - Exhibit No. 9B - Photo 4. Figure 4f. Crack found to propagate from a hot stamp mark. Optical inspection revealed the conductor was exposed.