



Systems 9 - Fuel Quantity Indication System - Photo 17. Repair found in frame at station 400 (right), beneath route of W350 and W1360 wire bundles.