



Systems 9 - Fuel Quantity Indication System - Photo 29.  
Repair found to wiring behind upper deck flight attendant control panel.