

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7049	6/19/2016	6/24/16		2050583	CM	9	TOILET CLOGGED BATHROOM OUT OF SERV	COMP		TOILET BOWL	CLOG	CLEA			
7049	6/24/2016	6/24/16		2053495	CM	1	F END TRUCK FUNCTIONAL FAULT	COMP		CIRCUIT BREAKER CB002 F-END PROPULS. CONTROL	TRIP	RESE			
7049	6/27/2016	6/27/16		2054977	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	WAPPR							
7049	6/27/2016	7/6/16		2055318	CM	5	Engineers side drop sash window stuck closed.	COMP		CAB DROP SASH WINDOW ASSEMBL (ELLCON)	LOOS	TIGH			
7049	6/27/2016	6/27/16		2055671	CA	2	PTC-4 OBC/ADU INSTALL (M7)	WAPPR							
7049	8/11/2016	8/29/16		2087350	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7049	8/12/2016	8/12/16		2088123	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	WAPPR							
7049	8/18/2016	8/18/16		2091198	CM	2	Cut back in over the loop on it's own, crew C/O the ASC. **PAIR MUST RIDE BURIED**	COMP		SENSOR, SPEED, AUTOMA' TRAIN CONTROL WITH NEOPREN	INOP	REPL			Replaced number two speed sensor and preformed atc speed test passed attached form to work order C/C notified
7049	8/21/2016	8/29/16		2092035	CM	5	Air leak from piping leading into right side of Drum-switch	COMP	NDF						
7049	8/29/2016	8/30/16		2095757	CM	7	L2 AIRBAG DELAMINATING.	COMP		AIR BAG	WL	REPL			
7049	8/29/2016	8/29/16		2095978	CM	7	Shoe Pin Frozen	COMP		BRACKET CONTACT DISPLAY ASSEMBL MESSAGE SINGL DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	PD	CREPL			
7049	8/31/2016	8/31/16		2097341	CM	5	destination sign INOP	COMP			INOP	REPL	FE		
7049	8/31/2016	8/31/16		2097373	CM	7	R/4 VERTICAL SHOCK C/O (B8685)	COMP			LEAK	REPL	R4		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7049	9/19/2016	9/22/16		2109569	CM	5	Public Affairs Complaint - multiple (3) 'seats broken' ALL 3 OF THE B/END FOLD DOWN (Handicap) SEAT CUSHIONS ARE MISSING (1 CUSHION REPLACED ON 9-20-16 WEST SIDE YARD. DO NOT CLOSE THIS WORK ORDER UNTIL ALL CUSHIONS ARE REPLACED)	COMP		ADA TWO PASS BOTTOM	MISS	CREPL			N/S BE END FOLD CUSHION REPLACED. G/ F CABRERA NOTIFIED CENTRAL CONTROL TO VERIFY THAT ONLY 1 HAD BEEN REPLACED. WORK ORDER TO REMAIN OPEN UNTIL ALL CUSHIONS ARE REPLACED.
7049	9/19/2016	9/22/16		2109569	CM	5	Public Affairs Complaint - multiple (3) 'seats broken' ALL 3 OF THE B/END FOLD DOWN (Handicap) SEAT CUSHIONS ARE MISSING (1 CUSHION REPLACED ON 9-20-16 WEST SIDE YARD. DO NOT CLOSE THIS WORK ORDER UNTIL ALL CUSHIONS ARE REPLACED)	COMP		ADA TWO PASS BOTTOM	MISS	CREPL			Train in 5D, GF Okombarntfd Reports all 3 fold down handicap bottom seat cushions are missing NMOH. See also WO 2101740 for car 7050 from 9/2, same issue

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7049	9/19/2016	9/22/16		2109569	CM	5	Public Affairs Complaint - multiple (3) 'seats broken' ALL 3 OF THE B/END FOLD DOWN (Handicap) SEAT CUSHIONS ARE MISSING (1 CUSHION REPLACED ON 9-20-16 WEST SIDE YARD. DO NOT CLOSE THIS WORK ORDER UNTIL ALL CUSHIONS ARE REPLACED)	COMP		ADA TWO PASS BOTTOM	MISS	CREPL			<p>Good morning,</p> <p>Please see below car complaint:</p> <p>Train 1712 Car 7049</p> <p>SteinNds1122 Sep 17, 2016 8:22 AM @LIRR 3:00 pm from Woodside eastbound on Friday, car 7049, 3 broken seats! A new record for my \$338 a month ticket!</p> <p>LIRR onLIRRSep 19, 2016 9:53 AM @SteinNds1122 TY for bringing this to our attention, we will report the broken seats for repair. We apologize for the discomfort.</p> <p>-- Angelo Cannella Manager of Social Media JCC 5th floor 718-558-7842 acannell@lirr.org</p>
7049	10/11/2016	10/18/16		2124937	CM	5	F/E VESTIBULE FLOOR BUBBLE	COMP		COVERIN FLOOR INTERIOR CORNER	TORN	PATC			
7049	10/14/2016	3/1/17		2127628	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7049	10/15/2016	10/18/16		2129421	CM	3	R2 DBU DAMAGED GRINDING AGAINST WHEEL AS PER GF CHAMBERS	COMP		CALIPER ASSEMBL WITH PARKING BRAKE, LE	MHM	RMH	R2		
7049	10/20/2016	10/28/16		2131551	CM	9	TOILET HAS ** FOUL ODOR ** NEED THC	COMP	OAI						
7049	10/28/2016	6/2/17		2135421	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7049	10/28/2016	6/2/17		2137108	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7049	10/31/2016	6/2/17		2137771	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR								
7049	10/31/2016	6/2/17		2140060	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR								
7049	11/14/2016	11/29/16		2148913	PM	X	92 Day Periodic Inspection, M7B	COMP	IC							
7049	11/29/2016	11/29/16		2155948	CM	5	4 CASES WATER O.D.	COMP		Emergency Water	MISS	CREPL				
7049	11/29/2016	11/29/16		2156039	CM	10	R2 EXT. DESTINATIONS SIGN INOP	COMP		SIGN, SIDE DESTINA	INOP	REPL	R2			
7049	11/29/2016	11/29/16		2156053	CM	8	B/E ACCU BOARD FAULTS	COMP		AIR CONDITIO	LIQLF	REPL	BE			
7049	11/29/2016	11/29/16		2156063	CM	7	L1 AND L2 HANGER FLASHED	COMP		BRACKET CONTACT	PD	CREPL				
7049	12/1/2016	12/1/16		2159513	CM	5	HANDICAP TRANSFER SEAT, PULL DOWN SIGNAGE MISSING	APPR		INTERSHO TRANSFE (COMPON USED FOR IT'S)						
7049	12/1/2016	12/1/16		2159513	CM	5	HANDICAP TRANSFER SEAT, PULL DOWN SIGNAGE MISSING	APPR		INTERSHO TRANSFE (COMPON USED FOR IT'S)						
7049	12/1/2016	12/1/16		2159513	CM	5	HANDICAP TRANSFER SEAT, PULL DOWN SIGNAGE MISSING	APPR		INTERSHO TRANSFE (COMPON USED FOR IT'S)						
7049	12/1/2016	12/1/16		2159513	CM	5	HANDICAP TRANSFER SEAT, PULL DOWN SIGNAGE MISSING	APPR		INTERSHO TRANSFE (COMPON USED FOR IT'S)						
7049	12/2/2016	6/2/17		2161619	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR								
7049	12/11/2016	1/17/17		2188455	CM	7	ALL WHEELS HAVE METAL BUILD UP	COMP		WHEEL	MBU	TRUE	L1			
7049	12/11/2016	1/17/17		2188455	CM	7	ALL WHEELS HAVE METAL BUILD UP	COMP		WHEEL	MBU	TRUE	L4			
7049	12/11/2016	1/17/17		2188455	CM	7	ALL WHEELS HAVE METAL BUILD UP	COMP		WHEEL	MBU	TRUE	L3			
7049	12/11/2016	1/17/17		2188455	CM	7	ALL WHEELS HAVE METAL BUILD UP	COMP		WHEEL	MBU	TRUE	L2			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7049	12/15/2016	1/10/17		2169479	CM	9	TOILET OS - OVER PRESSURE FAULT NO CONTACT TIME	COMP		VALVE, PINCH, ND 40 (DV2)	INOP	REPL			TRIED TO REMOVED SOMETHING STUCK IN WASTE PIPE BUT NOT ENOUGH CONTACT TIME. NO BOLTS TO MOUNT THE BOWL AND THE BOWL HAD BEEN TAKEN APART. ADVISED GANG FOREMAN OF PROBLEM AND LOCKED BATHROOM OUT.
7049	12/15/2016	1/10/17		2169479	CM	9	TOILET OS - OVER PRESSURE FAULT NO CONTACT TIME	COMP		PRESSURE TRANSDUCER TOILET, TVPSA	INOP	REPL			TRIED TO REMOVED SOMETHING STUCK IN WASTE PIPE BUT NOT ENOUGH CONTACT TIME. NO BOLTS TO MOUNT THE BOWL AND THE BOWL HAD BEEN TAKEN APART. ADVISED GANG FOREMAN OF PROBLEM AND LOCKED BATHROOM OUT.
7049	2/14/2017	3/1/17		2209697	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7049	2/17/2017	2/19/17		2212167	CM	5	CEILING LIGHT FIXTURE GLASS BROKEN	COMP	GFS					REPLACED CEILING LIGHT FIXTURE NO PART NUMBER	
7049	2/20/2017	2/21/17		2212829	CM	7	L2 CONTACT SHOE PD	COMP		SHOE, CONTACT 3RD RAIL	WL	CREPL	L2		
7049	2/28/2017	3/1/17		2217411	CM	7	R2 CONTACT SHOE WL	COMP		SHOE, CONTACT 3RD RAIL	WL	CREPL	R2		
7049	3/1/2017	3/1/17		2217451	RCM	X	1YR_RCM_M7B	COMP	IC						
7049	3/1/2017	3/1/17		2217451	RCM	X	1YR_RCM_M7B	COMP	IC						
7049	3/1/2017	3/1/17		2217451	RCM	X	1YR_RCM_M7B	COMP	IC						
7049	3/2/2017	3/3/17		2222176	CM	9	NO WATER/ FLUSH	COMP		TOILET BOWL COMPACT SYSTEM WITH ORBITAL VALVE	CLOG	CLEA			
7049	3/9/2017	6/2/17		2226679	CA	3	Campaign to change out safety valve C4563 on the "B" cars - M7	COMP		VALVE, SAFETY, 11 BAR	INOP	REPL			
7049	3/11/2017	3/13/17		2228573	CM	9	SINK WATER EMPTY	REJECT							REJECT: rejected work order no work orders should be created for sink water

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7049	3/20/2017	3/20/17		2232233	CM	8	toilet exhaust fan inop	COMP		TOILET EXHAUST FAN	DISC	RECO			
7049	3/27/2017	3/27/17		2235967	CA		AVRM - M7B Car - T92400	WAPPR							
7049	3/27/2017	3/27/17		2236697	CA	2	PTC-5 Dynamic testing Test Track 11 Car test and Commissioning	WAPPR							
7049	4/6/2017	4/6/17		2244836	CM	9	TOILET DOOR LOCK LOOSE	COMP		MODIFIEI SLIDING TOILET DOOR LOCK	OA	ADJU			
7049	4/11/2017	6/1/17		2247688	CM	5	F/E FLOOR BUBBLES	COMP		TILE, NORAMEI 925B, IME X IME GRANO, B	LOOS	TACK			
7049	4/16/2017	5/12/17		2249772	CM	7	L2 CONTACT SHOE WEAR LIMIT	COMP		SHOE,COI 3RD RAIL	WL	CREPL	L2		
7049	5/3/2017	5/3/17		2259742	RCM	7	Truck Drop and Install, M7B RCM	WAPPR							
7049	5/6/2017	6/1/17		2261965	RCM	5	Phase 1 Carbody, 5 year RCM, M7B	COMP		PARKING BRAKE FLASHER RELAY (PBFR)	RCM	REPL			
7049	5/6/2017	6/1/17		2261965	RCM	5	Phase 1 Carbody, 5 year RCM, M7B	COMP		MODIFIC/ COMPLEI	MC	MC			
7049	5/6/2017	6/1/17		2261965	RCM	5	Phase 1 Carbody, 5 year RCM, M7B	COMP		OPERATO SWITCH PANEL ASSEMBL	RCM	REPL			
7049	5/12/2017	5/12/17		2265629	CM	10	ENG SIDE RADIO HEAD INOP	COMP		HEAD ASSEMBL RADIO CONTROL OPERATO	INOP	RMH			
7049	5/16/2017	6/2/17		2267363	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7049	5/22/2017	6/1/17		2269740	RCM	3	PH2: 8 Year Air Brake Valve C/O, Car Body RCM, M7B	COMP	IC						
7049	5/22/2017	5/31/17		2269744	RCM		Phase 4 Truck Drop / Install M7B	COMP		TRUCK (COMPLE	RCM	REMV	FE		
7049	5/22/2017	5/31/17		2269744	RCM		Phase 4 Truck Drop / Install M7B	COMP		TRUCK (COMPLE	RCM	REPL	BE		
7049	5/22/2017	5/31/17		2269744	RCM		Phase 4 Truck Drop / Install M7B	COMP		TRUCK (COMPLE	RCM	REPL	FE		
7049	5/22/2017	5/31/17		2269744	RCM		Phase 4 Truck Drop / Install M7B	COMP		TRUCK (COMPLE	RCM	REMV	BE		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7049	5/22/2017	5/25/17		2269857	CM	5	F/E FOLD DOWN SEAT CUSHION FELL OFF ITS MOUNTING PLATFORM	COMP		OBSERVE FLIP UP BOTTOM CUSHION	MISS	CREPL			
7049	5/30/2017	5/30/17		2273750	CM	3	parking brake cable p/d C4652	COMP		PARKING CABLE, TRUCK BOX TO QUICK DISCONN	PD	REPL			
7049	5/31/2017	5/31/17		2274189	CM	7	R2 shoe fuse box P/D to C/O	COMP		SHOE BEAM SHOE BOX	CRAC	REPL			
7049	6/1/2017	6/1/17		2277626	CM	5	COUPLER TIME DELAY RELAY DELAY INOP (ISOLATED)	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7049	6/1/2017	6/1/17		2277626	CM	5	COUPLER TIME DELAY RELAY DELAY INOP (ISOLATED)	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7049	6/2/2017	6/2/17		2278284	CM	5	COUPLER TIME DELAY RELAY DELAY INOP (ISOLATED)	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7050	7/15/2016	8/29/16		2068489	CM	5	L1 EMERGENCY WINDOW EXIT RANDOM TESTING	COMP	EWP						
7050	7/22/2016	7/22/16		2072879	CA	2	PTC-4A ADU INSTALL (M7)	WAPPR							
7050	8/11/2016	8/29/16		2087348	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7050	8/29/2016	8/29/16		2095756	CM	10	L2 EXTERIOR DESTINATION SIGN INOP.	COMP		SIGN, SIDE DESTINA'	INOP	REPL	L2		
7050	8/29/2016	8/29/16		2096002	CM	5	LED APPLIED LIGHTS INOP	COMP		EXTERIOI APPLICA1 LIGHT (AMBER BIDIRECT LED)	INOP	CREPL			
7050	9/2/2016	9/22/16		2101740	CM	5	ALL 3 OF THE B/END FOLD DOWN (Handicap) SEAT CUSHIONS ARE MISSING	COMP		ADA TWO PASS BOTTOM	MISS	CREPL			
7050	9/21/2016	9/21/16		2110390	CA	2	PTC-3A MCP A - CAR FILTER INSTALL (M7)	WAPPR							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7050	10/14/2016	3/1/17		2127638	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC							
7050	10/22/2016	10/22/16		2132180	CM	8	HVACF ANALOG FAULTS	COMP		AIR CONDITIC CONTROL UNIT - ACCU	LC	TIGH	FE			
7050	10/28/2016	6/2/17		2135737	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR								
7050	10/28/2016	6/2/17		2136322	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR								
7050	10/31/2016	6/2/17		2139034	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR								
7050	10/31/2016	6/2/17		2139275	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR								
7050	11/14/2016	11/29/16		2148909	PM	X	92 Day Periodic Inspection, M7A	COMP	IC							
7050	11/23/2016	11/23/16		2153728	CM	5	CONDUCTOR SEAT MISSING	COMP		OBSERVE FLIP UP BOTTOM CUSHION	MISS	CREPL				
7050	11/29/2016	11/29/16		2155913	CM	7	#4 GEAR CASE LEAKING	COMP		GEAR CASE COVER	LOOS	TIGH				
7050	11/29/2016	11/29/16		2155914	CM	7	#1 WHEEL *NGTR* SHELLING 2 1/2"	COMP		WHEEL	SHEL	TRUE	R1			
7050	11/29/2016	11/29/16		2155915	CM	5	B/E VEST FLOOR BUBBLE	COMP		TILE, NORAMEI 925B, 1ME X 1ME GRANO, B	LOOS	TACK				
7050	11/29/2016	11/29/16		2155949	CM	5	4 CASES WATER O.D.	COMP		Emergency Water	MISS	CREPL				
7050	11/29/2016	11/29/16		2156046	CM	5	L/H 2 Seat (R5) Shell Back P/D- C/O A0022	COMP		TWO-PASSENG BACKSHE LEFT-HAND	PD	REPR				
7050	12/2/2016	6/2/17		2161027	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR								
7050	12/5/2016	12/11/16		2163597	CM	7	R1/L1 WHEELS SHELLING OVER 2 1/2" DEFECT CONFIRMED BY G/F CUNNINGHAM. 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		WHEEL	MBU	TRUE	L4			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7050	12/5/2016	12/11/16		2163597	CM	7	R1/L1 WHEELS SHELLING OVER 2 1/2" DEFECT CONFIRMED BY G/F CUNNINGHAM. 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		WHEEL	MBU	TRUE	L3		
7050	12/5/2016	12/11/16		2163597	CM	7	R1/L1 WHEELS SHELLING OVER 2 1/2" DEFECT CONFIRMED BY G/F CUNNINGHAM. 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		WHEEL	MBU	TRUE	L2		
7050	12/5/2016	12/11/16		2163597	CM	7	R1/L1 WHEELS SHELLING OVER 2 1/2" DEFECT CONFIRMED BY G/F CUNNINGHAM. 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		WHEEL	MBU	TRUE	L1		
7050	1/17/2017	3/1/17		2187829	RCM	10	Event Recorder 1 Year Certification - CFR 229.27, M7A	COMP	IC						
7050	2/14/2017	3/1/17		2209695	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7050	2/25/2017	3/1/17		2216038	CM	7	R2 & L2 CONTACT SHOE WORN	COMP		SHOE,COI	WL	CREPL	L2		
7050	3/1/2017	3/1/17		2220977	CM	10	L-2 DEST SIGN INOP	COMP		SIGN, SIDE	INOP	REPL	L2		
7050	3/1/2017	3/1/17		2221001	CM	8	F/E ACCU BOARD INOP	COMP		DESTINA' AIR CONDITIC CONTROL UNIT - ACCU	INOP	REPL	FE		
7050	3/27/2017	3/27/17		2236455	CA		AVRM - M7A Car - T92400	WAPPR							
7050	4/23/2017	5/2/17		2252616	CM	5	PRY BAR MISSING	COMP		BENT PRY BAR	MISS	CREPL			
7050	5/3/2017	5/3/17		2259754	RCM	7	Truck Drop and Install, M7A RCM	WAPPR							
7050	5/3/2017	5/30/17		2259760	RCM	4	Battery Service RCM, M7A	COMP		BATTERY CELLS INSTALL/ ASSY, CENTER	RCM	REPL	NS		
7050	5/3/2017	5/30/17		2259760	RCM	4	Battery Service RCM, M7A	COMP		BATTERY CELLS INSTALL/ ASSY, CENTER	RCM	REPL	SS		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7050	5/6/2017	6/1/17		2261963	RCM	5	Phase 1 Carbody, 5 year RCM, M7A	COMP		PARKING BRAKE FLASHER RELAY (PBFR)	RCM	REPL			
7050	5/6/2017	6/1/17		2261963	RCM	5	Phase 1 Carbody, 5 year RCM, M7A	COMP		MODIFIC/ COMPLEI	MC	MC			
7050	5/6/2017	6/1/17		2261963	RCM	5	Phase 1 Carbody, 5 year RCM, M7A	COMP		OPERATO SWITCH PANEL ASSEMBL	RCM	REPL			
7050	5/16/2017	6/2/17		2267361	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7050	5/22/2017	6/1/17		2269738	RCM	3	PH2: 8 Year Air Brake Valve C/O, Car Body RCM, M7A	COMP	IC						
7050	5/22/2017	5/31/17		2269742	RCM	7	Phase 4 Truck Drop / Install M7A	COMP		TRUCK (COMPLE	RCM	REMV	FE		
7050	5/22/2017	5/31/17		2269742	RCM	7	Phase 4 Truck Drop / Install M7A	COMP		TRUCK (COMPLE	RCM	REPL	BE		
7050	5/22/2017	5/31/17		2269742	RCM	7	Phase 4 Truck Drop / Install M7A	COMP		TRUCK (COMPLE	RCM	REPL	FE		
7050	5/22/2017	5/31/17		2269742	RCM	7	Phase 4 Truck Drop / Install M7A	COMP		TRUCK (COMPLE	RCM	REMV	BE		
7050	5/26/2017	5/26/17		2272958	CM	1	Cannibalized System: 1 Component: M700757 Position: BE to RSU: 7739	REJECT							REJECT: WORK ORDER MADE IN ERROR
7050	5/31/2017	6/1/17		2274187	CM	7	TRUCK at position BE needs to be trued.	COMP	GFS						Inspected all wheels for defects. Only small shell spots noted, not condemnable. Okay for service.
7050	6/2/2017	6/2/17		2278345	CM	10	north side exterior sign inop.	COMP		SIGN, SIDE DESTINA'	INOP	REPL	L2		
7403	6/19/2016	8/16/16		2050616	CM	5	(HMC) ENGINEERS WINDSHIELD SCRATCHED IN LINE OF SIGHT. "MUST RIDE BURIED" DEFECT CONFIRMED BY G/F CATALDO 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		ENGINEE) WINDSHII GLASS ELECTRIC HEATED	DIST	REPL			
7403	6/27/2016	6/27/16		2054550	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	WAPPR							
7403	6/27/2016	6/27/16		2056093	CA	2	PTC-4 OBC/ADU INSTALL (M7)	WAPPR							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7403	7/15/2016	7/15/16		2068253	CM	8	MARGINAL TEMP 76 AMBIENT TEMP 74	COMP		CIRCUIT BREAKER CB061 AUXILIAI INVERTEI CONTROI	TRIP	RESE			
7403	7/18/2016	7/18/16		2069655	CM	7	CONTACT SHOE BROKEN	COMP		SHOE,COI 3RD RAIL	PD	CREPL	L2		
7403	7/28/2016	8/16/16		2077204	CM	14	CDS CDP INOP	COMP		DISPLAY, OPERATO L IS CDS/ CDP, R IS TOD	TRIP	RESE	L		
7403	8/2/2016	8/2/16		2081686	CM	9	TOILET OS - BAF	COMP		NOZZLE	INOP	REPL			
7403	8/9/2016	8/16/16		2085943	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7403	8/10/2016	8/10/16		2087252	CM	9	TOILET EXHAUST FAN O/ L	COMP		TOILET EXHAUST FAN	INOP	REPL			
7403	8/12/2016	8/12/16		2088478	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	WAPPR							
7403	8/16/2016	8/16/16		2090336	CM	5	LIGHT BALLAST INOP	COMP		BALLAST ASSEMBL 72 VDC	INOP	CREPL			
7403	9/7/2016	9/15/16		2103723	CM	5	WINDSHIELD WIPER PUMP INOPERATIVE	COMP		pump, windshield washer	INOP	REPL			
7403	9/19/2016	9/19/16		2109675	CM	7	L/3 VERTICAL SHOCK C/ O	COMP		DAMPER, SUSPENSJ PRIMARY VERTICAL (SHOCK)	LEAK	REPL	L3		
7403	10/3/2016	10/3/16		2120838	CM	1	f end dead truck	COMP		CIRCUIT BREAKER CB002 F- END PROPULS: CONTROI	TRIP	RESE			
7403	10/13/2016	11/7/16		2127059	CM	5	F/E VESTUBULE FLOOR BUBBLE PD	COMP		TILE, NORAMEI 925B, 1ME X 1ME GRANO, B	LOOS	TACK			
7403	10/14/2016	2/7/17		2128371	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7403	10/18/2016	10/18/16		2130804	CM	9	TOILET OS - VACUUM FAULT	COMP		VALVE, PINCH, 1/2 IN, MAIN TANK ASSY	INOP	REPL			
7403	10/28/2016	4/28/17		2136146	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7403	10/28/2016	4/28/17		2136611	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR							
7403	10/31/2016	4/28/17		2138270	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7403	10/31/2016	4/28/17		2139566	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7403	11/1/2016	11/7/16		2140250	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7403	11/7/2016	11/7/16		2145857	CM	7	L2 DOGBONE X PLAY.	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBL	PD	REPL	L2		
7403	11/7/2016	11/7/16		2145913	CM	5	3 Emergency water c/o	COMP		Emergency Water	MISS	CREPL			
7403	11/7/2016	11/7/16		2145957	CM	7	GROUND STRAP P/D	COMP	IC						parts not in system
7403	11/7/2016	11/7/16		2145972	CM	14	TOD SCREEN INOP	COMP		DISPLAY, OPERATC L IS CDS/ CDP, R IS TOD	TRIP	RESE	R		
7403	11/12/2016	11/13/16	8009	2148638	LG	7	Check all wheels for flats/ shelling	COMP		WHEEL	FS	TRUE	L1	TRUED #s 1,2,3 & 4 AXLES	
7403	11/12/2016	11/13/16	8009	2148638	LG	7	Check all wheels for flats/ shelling	COMP		WHEEL	FS	TRUE	L4	TRUED #s 1,2,3 & 4 AXLES	
7403	11/12/2016	11/13/16	8009	2148638	LG	7	Check all wheels for flats/ shelling	COMP		WHEEL	FS	TRUE	L3	TRUED #s 1,2,3 & 4 AXLES	
7403	11/12/2016	11/13/16	8009	2148638	LG	7	Check all wheels for flats/ shelling	COMP		WHEEL	FS	TRUE	L2	TRUED #s 1,2,3 & 4 AXLES	
7403	11/17/2016	11/17/16		2151219	CM	5	GIMBLE LIGHT ENG SIDE INOP	COMP		GIMBEL LIGHT BULB	INOP	CREPL			
7403	11/26/2016	1/13/17		2155045	CM	5	(hmc) Excessive wind noise coming from the F/E storm door above 30 MPH, possible defective weather strip. *Must Ride Buried*	COMP	GFS					Mechanic added extra door gasket material to door.	

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7403	12/2/2016	12/2/16		2160244	RCM	X	Phase 2 Propulsion, RCM, M7B	WAPPR								
7403	12/2/2016	4/28/17		2161909	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR								
7403	1/23/2017	2/7/17		2190677	PM	X	92 Day Periodic Inspection, M7B	COMP	IC							
7403	2/3/2017	2/6/17		2200601	CM	9	TOILET DOOR WILL NOT CLOSE	COMP		KEEPER, WITH MICRO SWITCH TOILET DOOR	MISS	REPL				
7403	2/7/2017	2/7/17		2202008	CM	7	L1 DOG BONE CO.	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBLY DAMPER, SUSPENSION PRIMARY VERTICAL (SHOCK)	LOOS	REPL	L1			
7403	2/7/2017	2/7/17		2202405	CM	5	14 vert shock leak	COMP		WIPER BLADE ASSY.,28 IN. LONG,	LEAK	REPL	L4			
7403	2/10/2017	3/1/17		2208674	CM	5	WIPER BLADE TORN * MUST RIDE BURIED*	COMP			TORN	CREPL				
7403	2/17/2017	2/18/17	453/138	2212151	LG	6	OPERATING FROM 2 DR STATIONS N/S DOORS FAIL TO OPEN T/L	COMP	OAI					Tested and inspected the doors operate as intended	CYCLED DOORS FROM OBSERVER SIDE AND ENG'S DCP'S, FOUND DOORS OPERATING AS INTENDED COULD NOT DUPLICATE OAI	
7403	2/17/2017	2/17/17	453/138	2212147	LG	6	OPERATING FROM 2 DR STATIONS S/S DOORS FAIL TO OPEN T/L BETWEEN 7403 & 7078 CREW RESET DOOR CONTROL CB IN 7403 7078 REGAINED DOOR OPERATING T/L.	COMP		CIRCUIT BREAKER CB019 DOOR CONTROL PANELS	TRIP	RESE		CREW RESET DOOR CONTROL CB IN 7403 7078 REGAINED DOOR OPERATING T/L.	-Notified by CC of reported issue. Download and analyzed internal logs. Found no issues in the internal logs. -On equipment, checked observer side DCP in car 7403, OAI. Check engineer's side DCP in car 7078. found high resistance in MDKS door open signal. Replaced DCP in car 7078. Tested DCP and door open T/L. OAI	

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7403	2/17/2017	2/18/17	453/138	2212151	LG	6	OPERATING FROM 2 DR STATIONS N/S DOORS FAIL TO OPEN T/L	COMP	OAI					Tested and inspected the doors operate as intended	-Notified by CC of reported issue. Download and analyzed internal logs. Found no issues in the internal logs. -On equipment, checked observer side DCP in car 7403, OAI. Check engineer's side DCP in car 7078, found high resistance in MDKS door open signal. Replaced DCP in car 7078. Tested DCP and door open T L, OAI.
7403	2/18/2017	4/28/17		2212328	RCM	X	1YR_RCM_M7B	COMP	IC						
7403	2/18/2017	4/28/17		2212328	RCM	X	1YR_RCM_M7B	COMP	IC						
7403	2/18/2017	4/28/17		2212328	RCM	X	1YR_RCM_M7B	COMP	IC						
7403	2/28/2017	2/28/17		2217390	CM	8	hvacb no blowers	COMP		CIRCUIT BREAKER CB218 B-END BLOWER & FRESH AIR FAN MOTORS	TRIP	RESE			
7403	3/9/2017	4/28/17		2226969	CA	3	Campaign to change out safety valve C4563 on the "B" cars - M7	COMP	IC						
7403	3/15/2017	3/15/17		2230088	CM	5	CEILING LIGHT INOP	COMP		4 ft Fluorescen lamp (48" bulb)	INOP	CREPL			
7403	3/22/2017	4/28/17		2233210	CM	5	L15 CEILING LIGHT INOPERATIVE	COMP		BALLAST ASSEMBL 72 VDC	INOP	CREPL			
7403	3/22/2017	4/28/17		2233211	CM	5	F/E 2' CEILING EMERGENCY LIGHT INOPERATIVE	COMP		2 ft Fluorescen lamp (24" bulb)	INOP	CREPL			
7403	3/27/2017	3/27/17		2235752	CA		AVRM - M7B Car - T92400	WAPPR							
7403	3/27/2017	3/27/17		2236987	CA	2	PTC-5 Dynamic testing Test Track 11 Car test and Commissioning	WAPPR							
7403	3/31/2017	3/31/17		2239299	CM	7	R2 CONTACT SHOE WL	COMP		SHOE,COI 3RD RAIL	WL	CREPL	R2		
7403	4/3/2017	4/17/17		2243180	CM	5	CAB CILING LIGHT NO MATERIAL	COMP	GFS						
7403	4/10/2017	4/17/17		2247310	CM	7	R2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	WL	CREPL	R2		
7403	4/10/2017	4/17/17		2247572	CM	5	Interior OH light not illuminated	COMP	GFS						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7403	4/25/2017	4/28/17		2253997	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7403	4/25/2017	4/26/17		2254095	CM	9	TOILET OUT OF SERVICE	COMP		TOILET BOWL	CLOG	CLEA			
7403	4/28/2017	4/28/17		2255768	CM	1	F/E CHB1 FLASHED	COMP		CHARGIN CONTACT CHB (NEW STYLE)	FLAS	REPL			
7403	5/1/2017	5/1/17		2258866	CM	9	BOWEL FULL W/ DEBRIS	COMP		ELBOW, SWIVEL, 1/8 IN THRD X 8 MM MALE/ PNEUFIT	LEAK	TIGH			
7403	5/8/2017	5/8/17		2262861	CM	10	ccu inop	COMP		COMMUN CONTROL UNIT- B CAR-CCU B	INOP	REPL			
7404	6/13/2016	6/13/16		2047976	CM	7	L2 LATERL LINK (DOG BONE) EXCESSIVE MOTION	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBL	WL	REPL	L2		
7404	7/3/2016	7/5/16		2062838	CM	14	SYSTEM IN COMBINE MODE	COMP		SWITCH, ROTARY, TOD AND CDP CONTROL PANEL, COMMUN	TRIP	RESE			
7404	7/15/2016	7/19/16		2068469	CM	10	Off side radio stays keyed on - Radio is now disconnected	COMP			INOP	REPL	L1		The engineer reported that the off side cab radio stays keyed on at all times causing communication issues. RCI Gero in Huntington was called and asked to either fix or disconnect the radio. She was unable to get the radio not keyed. So, the radio was able to be disconnected.
7404	7/15/2016	7/19/16		2068469	CM	10	Off side radio stays keyed on - Radio is now disconnected	COMP		HEAD ASSEMBL RADIO CONTROL OBSERVE	PD	REPL			The engineer reported that the off side cab radio stays keyed on at all times causing communication issues. RCI Gero in Huntington was called and asked to either fix or disconnect the radio. She was unable to get the radio not keyed. So, the radio was able to be disconnected.

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7404	7/22/2016	7/22/16		2073235	CA	2	PTC-4A ADU INSTALL (M7)	WAPPR								
7404	7/28/2016	7/28/16		2077202	CM	14	cds inop	COMP		DISPLAY, OPERATO L IS CDS/ CDP, R IS TOD	INOP	REPL	L		-CDS inoperative, not resetting with breaker. CDS replaced, OAI. -WO to be closed on RCE repair sheet.	
7404	7/29/2016	8/16/16	307	2077461	LG	5	(HMC) Water Leaking Through Windshield ::must ride buried::	COMP		ENGINEE WINDSHII GLASS ELECTRIC HEATED	LOOS	REPL		Replaced GLASS, ELECTRICAL HEATED, WINDSHIELD ASSEMBLY,		
7404	8/9/2016	8/16/16		2085945	PM	X	92 Day Periodic Inspection, M7A	COMP	IC							
7404	9/16/2016	9/19/16		2108623	CM	7	R1 SHOE LEAD FLASHED AS PER GF CALLAHAN	COMP		BRACKET CONTACT	PD	CREPL				
7404	9/21/2016	9/21/16		2111091	CA	2	PTC-3A MCP A - CAR FILTER INSTALL (M7)	WAPPR								
7404	10/13/2016	10/25/16		2127060	CM	5	B/E CEILING DOOR HANDLE INOP	COMP	OAI							
7404	10/14/2016	2/7/17		2128375	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC							
7404	10/28/2016	2/7/17		2135807	CA		P3 Door w/TH Plate, RCM M7A, Position L1	COMP	MC							
7404	10/28/2016	4/28/17		2136953	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR								
7404	10/31/2016	2/7/17		2137928	CA		P3 Door w/TH Plate, M7, Position R1	COMP	MC							
7404	10/31/2016	4/28/17		2139906	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR								
7404	11/1/2016	11/7/16		2140252	PM	X	92 Day Periodic Inspection, M7A	COMP	IC							
7404	11/7/2016	11/7/16		2145906	CM	7	L-1 Vertical Shock leaking	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	REPL	L1			
7404	11/7/2016	11/7/16		2145911	CM	5	4 Emergency water C/O	COMP		Emergency Water	MISS	CREPL				
7404	11/12/2016	11/13/16	8009	2148639	LG	7	check wheels for shelling/ flat spots	COMP		WHEEL	FS	TRUE	L3	TRUED #4 AXLE		
7404	11/12/2016	11/13/16	8009	2148639	LG	7	check wheels for shelling/ flat spots	COMP		WHEEL	FS	TRUE	L1	TRUED #4 AXLE		
7404	11/12/2016	11/13/16	8009	2148639	LG	7	check wheels for shelling/ flat spots	COMP		WHEEL	FS	TRUE	L2	TRUED #4 AXLE		
7404	11/12/2016	11/13/16	8009	2148639	LG	7	check wheels for shelling/ flat spots	COMP		WHEEL	FS	TRUE	L4	TRUED #4 AXLE		
7404	12/2/2016	12/2/16		2160247	RCM	X	Phase 2 Propulsion, RCM, M7A	WAPPR								

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7404	12/2/2016	4/28/17		2161163	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							
7404	12/8/2016	1/13/17		2165507	CM	5	N/S OBSERVER SIDE WINDOW SCRATCHED.	COMP	SSS						
7404	12/12/2016	2/8/17		2167626	CM	5	WATER LEAKING INTO CAB FROM CEILING	COMP		HVAC UNIT,ROC MOUNTEI	LEAK	RESEAL	FE		WATER LEAKING INTO CAB FROM CEILING. COOR'D & 204 NTFD CAR WILL BE BURIED IN LB
7404	1/17/2017	4/28/17		2188189	RCM	10	Event Recorder 1 Year Certification – CFR 229.27, M7A	COMP	IC						
7404	1/23/2017	2/7/17		2190680	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7404	1/23/2017	1/31/17		2190990	CM	8	MARGINAL TEMP 77 AMBIENT TEMP 47	COMP		FRESH AIR DAMPER ASSEMBL ENGINEE	BJL	FBP			
7404	1/23/2017	2/7/17		2191453	CM	5	(HMC) Windshield leaking *Must Ride Buried*	COMP		WINDSHI GLASS ELECTRIC HEATED	LOOS	REPL			The engineer reports the windshield is leaking, the equipment will go down to WSY GF Neeley NTFD.
7404	1/23/2017	1/24/17		2191473	CM	8	F/E FLOOR HEATER GROUND FAULT 1& 2	COMP		GROUND FAULT DETECTO FOR FLOOR HEAT 1 AND 2	INOP	RESE			
7404	1/23/2017	1/24/17		2191474	CM	8	B/E FLOOR HEATER GROUND FAULT 1& 2	COMP		GROUND FAULT DETECTO FOR FLOOR HEAT 1 AND 2	INOP	RESE			
7404	2/7/2017	2/7/17		2202009	CM	7	R2 DOG BONE X-PLAY	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBL	LOOS	REPL	R2		
7404	2/7/2017	2/7/17		2202402	CM	5	R1,R4,L2,L3 vert shocks leaking	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	REPL	R4		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7404	2/7/2017	2/7/17		2202402	CM	5	R1,R4,L2,L3 vert. shocks leaking	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	WIPE	L3		
7404	2/7/2017	2/7/17		2202402	CM	5	R1,R4,L2,L3 vert. shocks leaking	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	WIPE	L2		
7404	2/7/2017	2/7/17		2202402	CM	5	R1,R4,L2,L3 vert. shocks leaking	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	WIPE	R1		
7404	2/7/2017	2/7/17		2202404	CM	5	parking brake test failed	COMP		BRAKE MECHAN RELEASE TRUCK BOX	BJL	CREPL			
7404	2/7/2017	2/7/17		2202633	CM	4	S/S BATTERY LEAKING C/O	COMP		BATTERY CELLS INSTALL/ ASSY, CENTER	LEAK	CREPL	SS		
7404	3/22/2017	3/22/17		2233208	CM	5	3/4 wrench Missing	COMP		BENT PRY BAR	MISS	CREPL			
7404	3/26/2017	4/4/17		2235412	CM	7	R2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	WL	CREPL	R2		
7404	3/27/2017	3/27/17		2236385	CA		AVRM - M7A Car - T92400	WAPPR							
7404	3/27/2017	4/28/17		2237438	CM	5	Engineer's Cab Leaking Water *Car Must Ride Buried*	COMP		ANTENN/ RADIO	MHM	RMH			Cabin 8 RCI reports weather stripping missing between exterior body and roof causing leak
7404	3/27/2017	3/28/17	478	2237630	LG	5	NO AUXILARY LIGHTS IN BRIGHT ONLY ONE IN DIM	COMP		Lamp 350 Watt (Ditch Light, Headlight Bulb)	INOP	CREPL		Replace Lamp 350 Watt (Ditch Light, Headlight Bulb)	Lamp 350 Watt (Ditch Light, Headlight Bulb)
7404	3/31/2017	3/31/17		2239297	CM	7	L2 CONTACT SHOE WL	COMP		SHOE,COI 3RD RAIL	WL	CREPL	L2		
7404	4/3/2017	4/3/17		2243181	CM	5	L1 EMERG HANDLE GLASS CRACKED	COMP		GLASS, INTERIOR EMERGEN HANDLE	CRAC	CREPL			
7404	4/25/2017	4/28/17		2253999	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7404	4/26/2017	4/26/17		2254967	CM	5	R2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	WL	CREPL	R2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7404	4/28/2017	4/28/17		2255761	CM	5	CPHJ1 P/D	COMP		CPHP1 SMALL COUPLER CABLE	PD	REPL			
7404	5/11/2017	5/12/17	2082	2265258	LG	7	The engineer reported possible flat spots on the F/E truck	COMP	NDF					No condemnable running gear defects found.	No condemnable running gear defects found.
7404	5/23/2017	5/26/17		2270421	CM	1	PCUB PROPULSION BLOWER INOPERATIVE CAUSING B-END INVERTER MODULE OVERTEMP FAULTS *****SEE NOTES****	COMP	SPC						2C SENT **STATES** PROPULSION BLOWER INOP B/E **GOOD TO RIDE THREE CALENDAR DAYS
7404	5/23/2017	5/26/17		2270421	CM	1	PCUB PROPULSION BLOWER INOPERATIVE CAUSING B-END INVERTER MODULE OVERTEMP FAULTS *****SEE NOTES****	COMP	SPC						-Confirmed motor seized causing contact overload trip. -Gang foremen notified of findings, car to be shopped when 2C expires. CREATED A NEW WORK ORDER FOR 5/25/17 REFLECTING 2C AS PER MANAGEMENT. CONFIRMED BY G/F FINEGAN KO YARD.
7404	5/25/2017	5/26/17		2272186	CM	1	B/E DEAD TRUCK. INVERTER MODULE OVERTEMP FAULT DUE TO THREE PHASE PROPULSION BLOWER MOTOR PHASE LOST. FROM CIRCUIT BREKER (PART# B0799) OKTR 3 CALENDAR DAYS.	COMP		CIRCUIT BREAKER CB207 B-END TRACTIO BLOWER MOTOR	INOP	REPL			*REPETITIVE FAILURE SEE WORK ORDER# 2270421 WRITTEN ORIGINALLY BY TECH SUPPORT K NELSON FURTHER INVESTIGATION NEEDED
7417	6/16/2016	7/1/16		2049306	CM	9	HAND DRYER INOPERATIVE	COMP		TOILET HAND DRYER	LC	TIGH			
7417	6/21/2016	7/7/16		2051525	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7417	6/27/2016	6/27/16		2055035	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	WAPPR							
7417	6/27/2016	6/27/16		2055613	CA	2	PTC-4 OBC/ADU INSTALL (M7)	WAPPR							
7417	7/7/2016	7/8/16		2064519	CM	7	#1 AND 2 WHEELS *NGTR* SHELLING 2 1/2"	COMP		WHEEL	SHEL	TRUE	L1		
7417	7/7/2016	7/8/16		2064519	CM	7	#1 AND 2 WHEELS *NGTR* SHELLING 2 1/2"	COMP		WHEEL	SHEL	TRUE	L2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7417	7/7/2016	7/7/16		2064520	CM	6	L-1 THRESHOLD PLATE WARPED	COMP		MODIFIED WIDE DOOR THRESHOLD PLATE	SHOR	REPL	L1		
7417	7/7/2016	7/7/16		2064621	CM	7	I-1 shoe beam cleat missing	COMP		CLEAT	MISS	RMH			
7417	7/28/2016	7/28/16		2077242	CM	7	R2 CONTACT SHOE PD	COMP		SHOE, CONTACT 3RD RAIL	PD	CREPL	R2		
7417	8/5/2016	8/5/16		2084720	CM	7	R1 SHOE BEAM COMPROMISED FIBER GLASS NOT INSULATION. POSSIBLE FIRE HAZZARD. TOOK A FLASH	COMP	GFS						
7417	8/12/2016	8/12/16		2088492	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	WAPPR							
7417	8/21/2016	8/22/16		2092104	CM	5	Windshield wiper blade is torn and hanging	COMP	OAI						
7417	8/29/2016	8/29/16		2096029	CM	7	R-1 + L-2 Dog bones excessive play	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBLY	LOOS	REPL	R1		
7417	8/29/2016	8/29/16		2096029	CM	7	R-1 + L-2 Dog bones excessive play	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBLY	LOOS	REPL	L2		
7417	9/22/2016	9/30/16		2111388	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7417	9/30/2016	10/3/16		2068525	CM	5	L2 EMERGENCY WINDOW EXIT RANDOM TESTING	COMP	EWP						
7417	9/30/2016	9/30/16		2116125	CM	5	SNOW SHIELD MISSING	COMP		COUPLER ASSEMBLY COMPLETE	MODI	RMH	FE		
7417	9/30/2016	9/30/16		2116126	CM	5	CPHJ1 COUPLER CABLE PD	COMP		CPHP1 SMALL COUPLER CABLE	PD	REPL			
7417	9/30/2016	9/30/16		2116129	CM	5	ASU PRESSER SWITCH O/J (160 PSI)	COMP		SWITCH, PRESSURE CCPS	INOP	REPL			
7417	9/30/2016	9/30/16		2116924	RCM	X	Phase 2 Propulsion, RCM, M7B	COMP		PROPULSION CONTROL UNIT	RCM	REPL	FE		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7417	9/30/2016	9/30/16		2116924	RCM	X	Phase 2 Propulsion, RCM, M7B	COMP	IC						
7417	9/30/2016	9/30/16		2116924	RCM	X	Phase 2 Propulsion, RCM, M7B	COMP		MASTER CONTROL ASSEMBLY	RCM	REPL			
7417	9/30/2016	9/30/16		2116924	RCM	X	Phase 2 Propulsion, RCM, M7B	COMP		PROPULSION CONTROL UNIT	RCM	REPL	BE		
7417	10/14/2016	3/23/17		2128419	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7417	10/26/2016	10/27/16		2134465	CM	9	SINK WATER SENSOR INOP	COMP		IR SINK SENSOR, CABLE ASSEMBLY	INOP	REPL			
7417	10/27/2016	11/21/16		2135060	CM	8	TOILET HEAT BREAKER TRIPED	COMP	NDF						
7417	10/28/2016	3/23/17		2136006	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7417	10/28/2016	3/23/17		2136753	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR							
7417	10/31/2016	3/23/17		2138128	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7417	10/31/2016	3/23/17		2139707	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7417	11/21/2016	11/21/16		2152288	CM	9	TOILET OUT OF SERVICE.	COMP		TOILET BOWL FULL	CLOG	CLEA			
7417	12/2/2016	3/23/17		2161561	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							
7417	12/16/2016	12/22/16		2169714	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7417	12/22/2016	3/13/17		2172534	CM	7	B/E Scraper shoes installed	COMP	GFS						CLOSED AS PER M DILIBERTI
7417	12/22/2016	12/22/16		2172547	CM	5	2 waters are O/D	APPR		INTERSH(TRANSFER (COMPOUND USED FOR IT'S) LINKAGE ASSEMBLY LEVELLING VALVE, LEFT-HAND MODIFICATION COMPLETE					
7417	12/22/2016	12/22/16		2172548	CM	7	L-2 L/L leaking	COMP			OA	REPL	BE		
7417	12/22/2016	12/22/16		2172587	RCM	9	PH 2 Toilet System M7B	COMP			MC	MC			
7417	2/4/2017	2/6/17		2200930	CM	7	L3 & R3 Shelling	COMP		WHEEL	SHEL	TRUE	L3		
7417	2/4/2017	2/6/17		2200930	CM	7	L3 & R3 Shelling	COMP		WHEEL	SHEL	TRUE	L1		
7417	2/4/2017	2/6/17		2200930	CM	7	L3 & R3 Shelling	COMP		WHEEL	SHEL	TRUE	L4		
7417	2/4/2017	2/6/17		2200930	CM	7	L3 & R3 Shelling	COMP		WHEEL	SHEL	TRUE	L2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7417	3/3/2017	3/23/17		2223029	CM	9	Toilet Servicing Defect CAP MISSING - EXTERIOR	COMP		TOILET, SYSTEM ASSEMBL COMPAC.	MHM	RMH			
7417	3/9/2017	3/23/17		2225893	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7417	3/9/2017	3/23/17		2226621	CA	3	Campaign to change out safety valve C4563 on the "B" cars - M7	COMP		VALVE, SAFETY, 11 BAR	MHM	REPL			
7417	3/12/2017	3/12/17		2228632	CM	5	FIRE EXTINGUISHER EMPTY	COMP		EXTINGU CHEMICA 20 LB	EMPT	CREPL			
7417	3/19/2017	3/23/17		2231918	CM	7	L2 CONTACT SHOE WORN	COMP	IC						
7417	3/23/2017	3/23/17		2234071	CM	7	#3 AXLE GROUND STRAP P/D (4123255)	COMP		CABLE ASSEMBL GOUND, GROUND BRUSH TO TRUCK FRAME PER LIRR	PD	REPL			
7417	3/23/2017	3/23/17		2234083	CM	5	LED EXT DOOR DISABLE LIGHT INOP	COMP		LED MODULE, TRANSVE FLASHING AMBER	INOP	CREPL			
7417	3/23/2017	3/23/17		2234086	CM	3	CURRENT DIFFERENCE DETECTOR INOP (A0360)	COMP		DETECTO CURRENT IMBALAN LOW VOLTA	INOP	REPL			
7417	3/27/2017	3/27/17		2235997	CA		AVRM - M7B Car - T92400	WAPPR							
7417	3/27/2017	3/27/17		2236639	CA	2	PTC-5 Dynamic testing Test Track 11 Car test and Commissioning	WAPPR							
7417	4/11/2017	4/11/17		2247696	CM	8	HVAC PUMP DOWN RELAY FAULT	COMP		CIRCUIT BREAKER CB216 B-END HVAC COMPRES MOTOR	TRIP	RESE			
7417	4/13/2017	4/14/17		2248574	CM	9	TOILET OUT OF SERVICE BOWL FULL	COMP		TOILET BOWL	CLOG	CLEA			
7417	4/21/2017	4/28/17		2251985	CM	9	TOILET DOOR INOPERATIVE	COMP		MODIFIEI SLIDING TOILET DOOR LOCK	LOOS	TIGH			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7417	4/26/2017	4/28/17		2254756	CM	9	Toilet inop	COMP		ORBITAL VALVE ASSEMBL (DV1)	MHM	RMH			TOILET MISSING DVI HOSE
7417	5/7/2017	5/10/17		2262383	CM	5	BURNING SMELL COMING FROM WINDSHIELD WIPER MOTOR IN OVERHEAD AS PER GF NEELY **MUST RIDE BURIED**	COMP		WIPER MOTOR ASSEMBL 24 VOLTS DIRECT CURRENT 14 AMPE	INOP	REPL			
7417	6/8/2017	6/8/17		2281470	PM	X	92 Day Periodic Inspection, M7B	WAPPR							
7418	6/15/2016	6/15/16		2048948	CM	8	hot car	COMP		FRESH AIR DAMPER ASSEMBL	BJL	FBP			
7418	6/21/2016	7/7/16		2051523	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7418	7/7/2016	7/7/16		2064521	CM	7	#1 AXLE 6 O'CLOCK GR CABLE AND BRACKET P/D	COMP		NON-GEAR UNIT SIDE CABLE ASSEMBL CURRENT	PD	RMH	L1		
7418	7/7/2016	7/7/16		2064522	CM	6	L-2 THRESHOLD PLATE WARPED	COMP	SPC						
7418	7/7/2016	7/7/16		2064523	CM	5	MM WIPER BLADE W/L	COMP		WIPER BLADE ASSY .28 IN. LONG, MODIFIEI	TORN	CREPL			
7418	7/7/2016	7/7/16		2064630	CM	6	L2 THRESHOLD (M726809) RIPPED TO INSTALL	COMP		WIDE DOOR THRESHO PLATE	WARP	REPL	L2		
7418	7/22/2016	7/22/16		2073249	CA	2	PTC-4A ADU INSTALL (M7)	WAPPR							
7418	7/28/2016	7/28/16		2077243	CM	7	L2 CONTACT SHOE PD	COMP		SHOE,COI 3RD RAIL	PD	CREPL	L2		
7418	8/5/2016	8/5/16		2084719	CM	7	L2 SHOE BEAM COMPOMISED FIBER GLASS NOT INSULATING .POSSIBLE FIRE HAZZARD. TOOK A FLASH	COMP	GFS						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7418	8/12/2016	8/12/16	710	2087951	LG	6	R2 C/O/L - NO DOOR LIGHT - DOOR LOCK ERROR FAULT	COMP		SIDE DOOR, L1, R2	DIRT	CLEA	R2	DEBRIS WAS REMOVED FROM DOOR TRACK	-When I arrived on the car the door was operational -I found the door lock bracket set too tight -All door adjustments set to spec, OAI
7418	8/12/2016	8/12/16	710	2087951	LG	6	R2 C/O/L - NO DOOR LIGHT - DOOR LOCK ERROR FAULT	COMP		SIDE DOOR, L1, R2	DIRT	CLEA	R2	DEBRIS WAS REMOVED FROM DOOR TRACK	DEBRIS WAS REMOVED FROM DOOR TRACK
7418	8/23/2016	8/29/16		2093099	CM	8	FRESH AIR DAMPER POSITION FAULT	COMP		PCB ASSEMBL SCP	INOP	CN			
7418	8/26/2016	8/29/16	5518	2095001	CM	7	2c submitted. FE truck vibration when first drawing power and when braking. Grinding noise #1 axle, investigation required.	COMP	OAI						reported by engineer of 5518 directly to CC after equipment was in HSY as FE truck vibration when taking power then when braking. Vibration leveled off at MAS. GF Wittneben reports car was rolled back and forth and grinding noise from #1 axle. Pair O/S for further investigation.
7418	8/26/2016	8/29/16	5518	2095001	CM	7	2c submitted. FE truck vibration when first drawing power and when braking. Grinding noise #1 axle, investigation required.	COMP	OAI						
7418	8/30/2016	9/2/16	457	2096389	LG	7	The engineer reported vibration coming from the F/E truck **Repeater, see WO 2095001, overpit inspection required**	COMP		WHEEL	HT	TRUE	L1	F/E TRUCK WHEELS HAD HOLLOW TREAD CAUSEING SIDE TO SIDE MOVEMENT, TRUED F/E TRUCK AND REPLACED YAW DAMPERS	F/E TRUCK WHEELS HAD HOLLOW TREAD CAUSEING SIDE TO SIDE MOVEMENT, TRUED F/E TRUCK AND REPLACED YAW DAMPERS

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7418	8/30/2016	9/2/16	457	2096389	LG	7	The engineer reported vibration coming from the F/E truck **Repeater, see WO 2095001, overpit inspection required**	COMP		WHEEL	HT	TRUE	R1	F/E TRUCK WHEELS HAD HOLLOW TREAD CAUSEING SIDE TO SIDE MOVEMENT, TRUED F/E TRUCK AND REPLACED YAW DAMPERS	F/E TRUCK WHEELS HAD HOLLOW TREAD CAUSEING SIDE TO SIDE MOVEMENT, TRUED F/E TRUCK AND REPLACED YAW DAMPERS
7418	9/2/2016	9/2/16		2101722	CM	7	R/1 & L/1 YAW DAMPERS C/O	COMP		ANTI-YAW DAMPER TRUCK (COMPLETE	PD	REPL			
7418	9/4/2016	9/7/16		7611/6822102731	LG	7	Possible defective traction motor on the F/End truck. FE truck grinding noise and bucking. **Heavy repeater for FE truck vibration and grinding noise**	COMP			FLAS	REPL	FE	Replaced the F/E Truck	OLD SERIAL NUMBER: BOM 045111004SE 10800 LOCATION: HMC NEW SERIAL NUMBER: BOM 045111004SE 11222 UNINSTALL FAILED
7418	9/6/2016	9/8/16		2103435	CM	17	MFU OFFLINE	COMP		MULTIFU UNIT- MFU CHARGIN CONTACT CHB (NEW STYLE)	INOP	REPL	-		
7418	9/15/2016	9/15/16		2107732	CM	1	F/END DEAD TRUCK CHARGING RESISTOR OPEN	COMP			BJL	REPL			
7418	9/21/2016	9/21/16		2110733	CA	2	PTC-3A MCP A - CAR FILTER INSTALL (M7)	WAPPR							
7418	9/22/2016	9/30/16		2111390	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7418	9/30/2016	9/30/16		2116127	CM	5	COUPLERDOOR HITTING SNOW SHIELD	COMP	SSS						
7418	9/30/2016	9/30/16		2116128	CM	5	CPHJ1 COUPLER CABLE PD	COMP		CPHP1 SMALL COUPLER CABLE PROPULS CONTROL UNIT	PD	REPL			
7418	9/30/2016	9/30/16		2116921	RCM	X	Phase 2 Propulsion, RCM, M7A	COMP			RCM	REPL	FE		
7418	9/30/2016	9/30/16		2116921	RCM	X	Phase 2 Propulsion, RCM, M7A	COMP	IC						
7418	9/30/2016	9/30/16		2116921	RCM	X	Phase 2 Propulsion, RCM, M7A	COMP		MASTER CONTROL ASSEMBL	RCM	REPL	-		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7418	9/30/2016	9/30/16		2116921	RCM	X	Phase 2 Propulsion, RCM, M7A	COMP		PROPULS CONTROL UNIT	RCM	REPL	BE		
7418	9/30/2016	9/30/16		2116945	CM	6	BGuzzer Relay Inop	COMP		BUZZER RELAY, 72V	INOP	REPL	R		
7418	10/6/2016	10/8/16		2122411	CM	1	F/E DEAD TRUCK. NUMEROUS MODULE OVER TEMP FAULTS STAGE 1 AND 2 DEFECT CONFIRMED BY G/F FINEGAN 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		PROPULS CONTROL UNIT	INOP	REPL	FE		
7418	10/7/2016	10/8/16	2859	2123205	LG	1	Swap of equipment the engineer reported a friction brake fault on the screen that would not reset. MU 265 reported an F/E dead truck with module over temp faults.	COMP	SPC					PCU replaced.	
7418	10/8/2016	10/8/16		2123662	CM	10	BUZZER INOP	COMP		BUZZER RELAY, 72V	INOP	REPL	R		
7418	10/14/2016	3/23/17		2128417	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7418	10/21/2016	2/6/17		2132013	CM	10	ODMS OFFLINE CODE 2000	COMP		MULTIFU UNIT-MFU	INOP	REPL			
7418	10/28/2016	3/23/17		2135566	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7418	10/28/2016	3/23/17		2137110	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR							
7418	10/31/2016	3/23/17		2137769	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7418	10/31/2016	3/23/17		2140062	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7418	12/2/2016	3/23/17		2160684	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							
7418	12/12/2016	12/13/16	4202	2167870	LG	5	Employee injury - Cab door was stuck closed and when conductor pulled it open he was struck in the face by the door	COMP	GFS					Investigation found that there was no damage to the door and that the door operates normally as intended.	Investigation found that there was no damage to the door and that the door operates normally as intended.
7418	12/16/2016	12/22/16		2169716	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7418	12/22/2016	3/13/17		2172535	CM	7	B/E Scrapper shoes installed	COMP	GFS					CLOSED AS PER M DILIBERTI	
7418	12/22/2016	12/22/16		2172550	CM	5	3 waters are O/D	APPR		INTERSHO TRANSFER (COMPOUND USED FOR IT'S) MASTER CONTROL ASSEMBLY ENGINEER WINDSHIELD GLASS ELECTRIC HEATED					
7418	12/22/2016	12/22/16		2172554	CM	1	P-wire out of range	COMP			OA	REPL			
7418	1/7/2017	2/6/17		2182493	CM	5	(HMC) ENGINEER WINDOW SCRATCHED...P/D *** MUST RIDE BURIED***	COMP			DIST	REPL			
7418	1/17/2017	3/23/17		2187739	RCM	10	Event Recorder 1 Year Certification - CFR 229.27, M7A	COMP	IC						
7418	1/21/2017	1/26/17		2190331	CM	5	emergency brake valve decal missing nmoh	COMP		DECAL, "EMERGENCY BRAKE VALVE", PVC, 1.3	MISS	CREPL			
7418	2/6/2017	3/18/17		2231645	CM	7	aLL Wheels Shelling	COMP		WHEEL	SHEL	TRUE	L1		
7418	2/6/2017	3/18/17		2231645	CM	7	aLL Wheels Shelling	COMP		WHEEL	SHEL	TRUE	L4		
7418	2/6/2017	3/18/17		2231645	CM	7	aLL Wheels Shelling	COMP		WHEEL	SHEL	TRUE	L3		
7418	2/6/2017	3/18/17		2231645	CM	7	aLL Wheels Shelling	COMP		WHEEL	SHEL	TRUE	L2		
7418	3/9/2017	3/23/17		2225895	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7418	3/13/2017	3/15/17		2228945	CM	5	CREW OF 711 REPORTS OFF SIDE CAB WINDOW WON'T STAY UP	COMP		DROP SASH COUNTER (PYRAMID)	WL	RMH			Counterbalance replaced in Jamaica B8465 from whse 90
7418	3/15/2017	3/15/17		2229929	CM	5	Conductor reports defective off cabside window.	COMP	SPC						Conductor reports defective off cabside window. The window drops fast (when you use a key) and is difficult to raise.
7418	3/23/2017	3/23/17		2233861	CM	7	#4 wheel has shelling	COMP	GFS						
7418	3/23/2017	3/23/17		2234073	CM	7	#2 AXLE GROUND STRAP P/D (4123255)	COMP		CABLE ASSEMBLY GROUND, GROUND BRUSH TO TRUCK FRAME PER LIRR	PD	REPL			
7418	3/27/2017	3/27/17		2236206	CA		AVRM - M7A Car - T92400	WAPPR							
7418	6/8/2017	6/8/17		2281472	PM	X	92 Day Periodic Inspection, M7A	WAPPR							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7625	6/24/2016	6/24/16	1629	2053530	LG	5	Possibly offensive graffiti on parking brake cut out access door - needs to be cleaned	COMP	GFS					Graffiti removed.	
7625	6/24/2016	8/15/16		2053681	CM	5	HORN HANDLE COVER MISS	COMP		HORN HANDLE COVER	MISS	CREPL			
7625	6/27/2016	6/27/16		2055212	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	WAPPR							
7625	6/27/2016	6/27/16		2055437	CA	2	PTC-4 OBC/ADU INSTALL (M7)	WAPPR							
7625	7/15/2016	8/15/16		2068572	CM	5	R1 EMERGENCY WINDOW EXIT RANDOM TESTING	COMP	EWP						
7625	8/1/2016	8/1/16		2081379	CM	7	L-1 VERTICAL DAMPER LEAKING	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	REPL	L1		
7625	8/1/2016	8/1/16		2081380	CM	9	TOILET DOOR HANGER SHEARED	COMP		TOILET DOOR HANGER BOLT (BOLT ONLY)	PD	CREPL			
7625	8/2/2016	8/2/16		2082041	CM	7	L1 CONTACT SHOE PD	COMP		SHOE, COI 3RD RAIL	PD	CREPL	L1		
7625	8/5/2016	8/15/16		2084410	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7625	8/11/2016	8/11/16		2087458	CM	7	L1 Vertical Damper Blown out - Heavy Oil Leak	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	REPL	L1		
7625	8/12/2016	8/15/16		2087919	CM	7	L1 Vertical damper leak repeater investigation required ** send to HMC **attn. Jenkins**	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK)	LEAK	REPL	L1		car going to wheel truer, #1 wheel to true.
7625	8/12/2016	8/12/16		2088700	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	WAPPR							
7625	8/15/2016	8/16/16		2089564	CM	7	L1 and R1 wheel indifferent	COMP		WHEEL MODIFIC	HF MC	TRUE MC	L1		
7625	8/15/2016	8/15/16		2089609	RCM	2	Phase 1 Relay, RCM, M7 B Car	COMP		COMPLET					
7625	9/7/2016	9/7/16		2104028	CM	8	hvacf damper position fault	COMP		FRESH AIR DAMPER ASSEMBL	BJL	FBP			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7625	9/9/2016	9/20/16		2105380	CM	7	Ground Strap PD	COMP		STRAP, BRAIDS, GROUND BRUSH	PD	CREPL			
7625	9/17/2016	9/19/16		2109007	CM	8	FRESH AIR DAMPER POSITION FAULT CODE 30	COMP		AIR CONDITIC CONTROL UNIT - ACCU PLATE, WEAR, GATE ASSY	INOP	REPL	BE		
7625	9/20/2016	9/20/16		2109885	CM	5	N/S S/S ADA PADS MISSING	COMP			MISS	CREPL			
7625	10/3/2016	10/12/16		2120815	RCM	3	6 Year Air Brake Valve C/O, Car Body RCM, M7B	COMP	IC						
7625	10/6/2016	10/13/16		2122644	CM	2	Cannibalized System: 2 to RSU: 7371	COMP		MODULE, CPU, ALERTER	MISS	REPL			
7625	10/11/2016	10/12/16	2862	2125268	CM	10	Cannibalized System: 10 to RSU: 7624	COMP	NDF						
7625	10/12/2016	10/13/16		2125534	CM	10	Foot Pedal Missing - M700941	COMP	SPC						
7625	10/13/2016	10/13/16		2126893	CM	10	RADIO FOOT PEDAL MISSING.	COMP		PEDAL, FOOT	MISS	REPL			
7625	10/13/2016	10/13/16		2127005	CM	2	AXEL #2 SPEED SENSOR P/D	COMP		SENSOR, SPEED, AUTOMA' TRAIN CONTROL WITH NEOPREN HANDLE ASSEMBL EMERGET EXTERIOJ	INOP	REPL			
7625	10/14/2016	10/19/16	1617	2127505	LG	6	L2 door hanging up - door was not C/O/L but has to be cycled several times to fully close	COMP			OA	ADJU	L2	EXT. Emergency handle reseated.	-Internal logs show Emergency Lever Mismatch faults at the time of reported problem. -On equipment, confirmed L2 Door C/O/L. Found exterior Emergency handle was out of its keeper. Reseated handle, normalized the door. Tested L2 Door for proper operation, OAI.
7625	10/14/2016	2/3/17		2128852	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7625	10/15/2016	10/16/16		2129505	CM	6	L2 DOOR DOES NOT OPEN C/O/L OK TO RIDE FOR ONE CALENDAR DAY AS PER GF PERSAUD	COMP		SIDE DOOR, R1, L2	INOP	ADJU	L2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7625	10/18/2016	11/7/16		2130703	CM	8	F/E HVAC Fresh Air Damper Position Fault	COMP		CIRCUIT BREAKER CB213 F-END BLOWER AND FRESH AIR FAN MOTOR	TRIP	RESE			IEM description: There is a difference between the commanded and the actual position of the fresh air damper. ACCU is not receiving the correct damper position. Possible causes include faulty damper motor, untrimmed damper switching point, ACCU fault, or a wiring problem.
7625	10/28/2016	5/9/17		2135917	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7625	10/28/2016	5/9/17		2136841	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR							
7625	10/31/2016	11/8/16		2137594	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7625	10/31/2016	5/9/17		2138037	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7625	10/31/2016	5/9/17		2139795	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7625	11/8/2016	11/8/16		2146551	CM	3	L1 DBU HOSE P/D PARKING BRAKE CABLE BRACKET NPS	COMP		HOSE ASSEMBL DBU TO TRUCK FRAME, 0.500 IN I.D. X 23.625 IN	LOOS	TIGH			
7625	11/8/2016	11/8/16		2146565	CM	5	2 CASES OF EMERG WATER NEEDED(1 O/D 1 MISS)	COMP		Emergency Water	MISS	CREPL			
7625	12/2/2016	5/9/17		2161385	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							
7625	1/5/2017	5/9/17		2181688	CM	5	HORN RUBBER MISS	COMP	GFS						
7625	1/24/2017	2/3/17		2191669	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7625	2/3/2017	2/3/17		2200285	CM	7	L-4 VERT DAMPER LEAKING	COMP		DAMPER, SUSPENS PRIMARY VERTICAL (SHOCK) PLATE, OIL LEVEL. GEAR BOX ASSEMBL	LEAK	REPL	L4		
7625	2/3/2017	2/3/17		2200286	CM	7	#2 GEAR CASE SIGHT GLASS COVER MISS	COMP			MISS	CREPL			
7625	2/3/2017	5/9/17		2200314	CM	5	4 CASES WATER O.D.	COMP	IC						
7625	2/4/2017	3/21/17		2232554	CM	7	#1,2,4 WHEELS SHELLING	COMP		WHEEL	SHEL	TRUE	L1		
7625	2/4/2017	3/21/17		2232554	CM	7	#1,2,4 WHEELS SHELLING	COMP		WHEEL	SHEL	TRUE	L4		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7625	2/4/2017	3/21/17		2232554	CM	7	#1,2,4 WHEELS SHELLING	COMP		WHEEL	SHEL	TRUE	L2		
7625	2/13/2017	2/13/17		2209532	CM	8	DAMPERS POSITIONS SENSOR FAULTS.	COMP		DAMPER MOTOR ASSEMBL FRESH AIR DAMPER	DISC	RECO			
7625	3/3/2017	3/8/17		2223057	CM	9	Toilet O/S, vacuum fault	COMP		TOILET BOWL	CLOG	CLEA			
7625	3/9/2017	3/9/17		2226369	CM	9	TOILET O/S - BAF	COMP		ELBOW, SWIVEL, 1/8 IN THRD X 8 MM MALE/ PNEUFIT VALVE, SAFETY, 11 BAR	INOP	REPL			
7625	3/9/2017	5/9/17		2226445	CA	3	Campaign to change out safety valve C4563 on the "B" cars - M7	COMP			INOP	REPL			
7625	3/10/2017	3/10/17	1715	2228145	LG	5	Represented 1260 due to shortage of equipment	COMP	GFS						Found on the LI-1, turned to represented 1260 due to shortage of equipment
7625	3/27/2017	3/27/17		2236086	CA		AVRM - M7B Car - T92400	WAPPR							
7625	3/27/2017	3/27/17		2237299	CA	2	PTC-5 Dynamic testing Test Track 11 Car test and Commissioning	WAPPR							
7625	3/28/2017	4/5/17		2237957	CM	5	Non-Offensive Graffiti - Inside of F/E Storm Door	COMP		CAR INTERIOR	VAND	REMV			
7625	3/30/2017	3/30/17		2238745	CM	7	R2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	WL	CREPL	R2		
7625	4/5/2017	4/5/17		2244241	CM	9	Offensive graffiti edged into wall above toilet next to safety appliance	COMP		CAR INTERIOR	VAND	REMV			
7625	4/12/2017	4/13/17		2247989	CM	7	L2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	WL	CREPL	L2		
7625	4/21/2017	5/9/17		2251882	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7625	5/8/2017	5/9/17		2262555	RCM	X	1YR_RCM_M7B	COMP	IC						
7625	5/8/2017	5/9/17		2262555	RCM	X	1YR_RCM_M7B	COMP	IC						
7625	5/8/2017	5/9/17		2262555	RCM	X	1YR_RCM_M7B	COMP	IC						
7625	5/8/2017	5/8/17		2263075	RCM	5	12 Year Coupler System RCM, M7B (Phase 2)	COMP		COUPLER ASSY.,ELJ 122.	RCM	REPL			
7625	5/8/2017	5/8/17		2263081	RCM	9	PH 2 Toilet System RCM, M7B	COMP		WATER PUMP (PUMP ONLY)	RCM	REPL			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7625	5/8/2017	5/9/17		2263083	CM	8	Air Diffuser p/d	COMP		DIFFUSEF AIR, CAB CEILING	PD	CREPL			
7625	5/8/2017	5/9/17		2263088	CM	7	#3 Axle (2) Ground Straps	COMP		GROUND CABLE, GEAR UNIT-TO- TRUCK FRAME	PD	REPL			
7625	5/9/2017	5/9/17		2263800	CM	1	F/E PROP FILTER HOUSEING P/D	COMP		AIR IN TAKE ASSEMBL	PD	REPL			
7625	5/9/2017	5/9/17		2263813	CM	7	#2 gearcase cover missing	COMP		COVER, OIL, GEAR BOX ASSY	MISS	CREPL			
7625	5/30/2017	5/30/17		2273790	CM	7	L3 CONTACT SHOE P/D- TRAIN 905 (ENGINEER REPORTED TO CENTRAL CONTROL WHILE STANDING AT PLATFORM AT VALLEY STREAM)	COMP	OAI						
7625	5/31/2017	6/2/17		2274229	CM	7	Check for possible flat spots	COMP	GFS						no condemnable defects found.
7625	6/1/2017	6/1/17		2277732	CM	5	HORN BOOT RUBBER MISS	APPR							
7625	6/1/2017	6/1/17		2277733	CM	5	PRIORITY DISABLED FOLDING CHAIR L1 MISS	APPR							
7626	6/24/2016	6/24/16	1629	2053531	LG	5	Possibly offensive graffiti on parking brake cut out access door - needs to be cleaned	COMP	GFS					Graffiti removed.	
7626	7/22/2016	7/22/16		2073459	CA	2	PTC-4A ADU INSTALL (M7)	WAPPR							
7626	8/1/2016	8/2/16	474	2081634	LG	7	UNABLE TO DRAW POWER, MISSING CONTACT SHOES	COMP	NDF					NDF. All shoes in place, able to draw power.	
7626	8/5/2016	8/15/16		2084412	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7626	8/15/2016	8/15/16		2089566	CM	7	#2 axle 2 o clock brush holder flashed	COMP		GROUND BRUSH HOLDER	FLAS	REPL	2		
7626	8/15/2016	8/16/16		2089568	CM	7	#1,#3 wheels shelling	COMP		WHEEL	TTMM	TRUE	L2		
7626	8/15/2016	8/16/16		2089568	CM	7	#1,#3 wheels shelling	COMP		WHEEL	TTMM	TRUE	L4		
7626	8/15/2016	8/16/16		2089568	CM	7	#1,#3 wheels shelling	COMP		WHEEL	SHEL	TRUE	L3		
7626	8/15/2016	8/16/16		2089568	CM	7	#1,#3 wheels shelling	COMP		WHEEL	SHEL	TRUE	L1		
7626	8/15/2016	8/15/16		2089607	RCM	2	Phase 1 Relay, RCM, M7 A Car	COMP		MODIFIC, COMPLET	MC	MC			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7626	8/15/2016	8/15/16		2089684	CM	5	R/H 2 Seat (R16) Shell Back P/D- C/O A0027	COMP		TWO-PASSENG BACKSHE RIGHT-HAND	CRAC	PATC			
7626	9/13/2016	9/20/16		2107127	CM	1	PCUB Inverter Module Overtemp Faults ***Investigation Required	COMP		PROPULS CONTROL UNIT	INOP	REPL	BE		Internal logs show numerous Inverter Module overtemp U-V stage 1 and 2, Inverter module overtemp W-BR stage 1 and 2, RS485 fault (Still active, communication lost with other inverter) and brake chopper failure fault.
7626	9/21/2016	9/21/16		2110795	CA	2	PTC-3A MCP A - CAR FILTER INSTALL (M7)	WAPPR							
7626	10/3/2016	10/12/16		2120813	RCM	3	6 Year Air Brake Valve C/O, Car Body RCM, M7A	COMP	IC						
7626	10/14/2016	2/3/17		2128856	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7626	10/28/2016	5/9/17		2135534	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7626	10/28/2016	2/3/17		2136999	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		MODIFIC/ COMPLEI	MC	MC			
7626	10/31/2016	11/8/16		2137596	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7626	10/31/2016	5/9/17		2137882	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7626	10/31/2016	5/9/17		2139951	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7626	11/8/2016	11/8/16		2146552	CM	3	R1 & R2 PARKING BRAKE CABLES P/D	COMP	SSS						
7626	11/8/2016	11/8/16		2146566	CM	5	2 CASES OF EMERGENCY WATER NEEDED (1 O/D 1 MISS)	COMP		Emergency Water	MISS	CREPL			
7626	11/24/2016	11/29/16		2154615	CM	5	r1 exterior emerg glass phys damage	COMP		GLASS, EXTERIOR EMERGEN HANDLE	VAND	CREPL			
7626	11/27/2016	11/29/16		2155064	CM	5	No trainline brake release indication through coupler **Must ride open ended** **CPHP2 to be replaced**	COMP		CPHP2 COUPLER CABLE LARGE	CRAC	REPL			-On equipment, confirmed brakes release but missing trainline brake release indication. Found trainline brake release positive wire in CPHP2 cable open. Train to ride open ended until repairs can be made.
7626	12/1/2016	12/1/16		2159463	CM	5	ENGINEERS CAB SEAT INOP	COMP		SEAT, OPERATO	OA	ADJU	FE		
7626	12/2/2016	5/9/17		2160622	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7626	12/31/2016	1/1/17	6124	2176308	LG	5	The engineer reported that it is difficult to move the engineers seat is difficult to move up and down. ** Must Ride Buried **	COMP	SSS					Safe & Suitable for Service, inspected and adjusted seat.	
7626	1/17/2017	2/3/17		2188356	RCM	10	Event Recorder 1 Year Certification - CFR 229.27, M7A	COMP	IC						
7626	1/24/2017	2/3/17		2191671	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7626	2/3/2017	2/3/17		2199602	CM	7	R-1 DOGBONE X-PLY	COMP		ANTI ROLL BAR LINKAGE W/ BEARING ASSEMBLY	PD	REPL	R1		
7626	2/3/2017	2/4/17		2200287	CM	7	#1 WHEEL *NGTR* SHELLING 2 1/2"	COMP		WHEEL	SHEL	TRUE	L3		
7626	2/3/2017	2/4/17		2200287	CM	7	#1 WHEEL *NGTR* SHELLING 2 1/2"	COMP		WHEEL	SHEL	TRUE	L1		
7626	2/3/2017	2/4/17		2200287	CM	7	#1 WHEEL *NGTR* SHELLING 2 1/2"	COMP		WHEEL	TTMM	TRUE	L2		
7626	2/3/2017	2/3/17		2200311	CM	3	L-1 DBU (NO RELEASE WITH WHEEL) INOP	COMP		L1 BRAKE RELEASE CABLE DBU ACTUATOR 94.5 IN LG	NPS	TIGH			
7626	2/3/2017	5/9/17		2200315	CM	5	4 CASES WATER O'D'	COMP	GFS						
7626	2/3/2017	2/4/17		2200369	CM	7	AXLE #3 GROUND CABLE P/D	COMP		CABLE ASSEMBLY GROUND, GROUND BRUSH TO TRUCK FRAME PER LIRR AIR CONDITIC CONTROL UNIT - ACCU	LOOS	TIGH			
7626	2/3/2017	2/3/17		2200404	CM	8	f/e accu card inop #1 unloader feedback fault	COMP			INOP	REPL	FE		
7626	3/27/2017	3/27/17		2236237	CA		AVRM - M7A Car - T92400	WAPPR							
7626	4/12/2017	4/13/17		2247991	CM	7	R2 CONTACT SHOE WORN	COMP		SHOE, COI 3RD RAIL	WL	CREPL	R2		
7626	4/21/2017	5/9/17		2251884	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7626	5/8/2017	5/8/17		2263073	RCM	5	12 Year Coupler System RCM, M7A (Phase 2)	COMP		COUPLER ASSY.,ELI 122,	RCM	REPL			
7626	5/9/2017	5/9/17		2263485	CM	7	AXLE #2 2 OCLOCK BRUSH BOX HOLDER FLASHED.	COMP		ASSY, MOUNTIN BRUSH HOLDER, GEAR BOX ASSY	FLAS	REPL			
7695	6/27/2016	1/27/17		2054999	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	COMP		ANTENN/ 220 MHZ, MODEL HDLP-NB-220-TNC-BT 216-228	NEW	REPL			
7695	6/27/2016	1/27/17		2054999	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	COMP		ANTENN/ ARRAY, MODEL HDLP-MB-LL9G25-BT	NEW	REPL			
7695	6/27/2016	6/27/16		2055649	CA	2	PTC-4 OBC/ADU INSTALL (M7)	WAPPR							
7695	7/6/2016	7/6/16		2064038	CM	9	TOILET OS - DV1	COMP		VALVE, TRVSU	INOP	REPL			
7695	7/7/2016	10/14/16		2064754	CM	9	BATHROOM WALL MIRROR MISS	COMP	SSS						
7695	7/9/2016	8/2/16		2065824	CM	5	Eng side window difficult to operate **MUST RIDE BURIED**	COMP	OAI						LUBED...OAI.
7695	7/11/2016	8/15/16		2066440	CM	9	Toilet Servicing Defect COUPLER MISSING - EXTERIOR	COMP	NDF						
7695	8/2/2016	8/5/16		2081673	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7695	8/5/2016	8/5/16		2084582	CM	5	R/H 2 Seat (R12) Shell Back P/D- C/O A0027	COMP		TWO-PASSENG BACKSHE RIGHT-HAND MCP ASSEMBL ENGINEE] SIDE, B-CAR, BOMBARDI 3040983G	CRAC	PATC			
7695	8/12/2016	1/27/17		2088770	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	COMP				REPL			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7695	8/12/2016	1/27/17		2088770	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	COMP		MCP ASSEMBL OBSERVE SIDE, B-CAR, BOMBARDI 3040985G(NEW	REPL			
7695	9/13/2016	9/13/16		2107019	CM	9	TOILET OS- BAF	COMP		TOILET BOWL	CLOG	CLEA			
7695	10/14/2016	1/27/17		2129031	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7695	10/21/2016	10/27/16		2131654	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7695	10/27/2016	10/27/16		2134811	CM	5	emergency water expired	COMP		Emergency Water	MISS	CREPL			
7695	10/28/2016	1/27/17		2136024	CA		P3 Door w/TH Plate, RCM M7A, Position L1	COMP		THRESHO PLATE, STAINLES STEEL WELDME RIGHT-HAND	RCM	REPL	L1		
7695	10/28/2016	1/27/17		2136024	CA		P3 Door w/TH Plate, RCM M7A, Position L1	COMP		SIDE DOOR, L1, R2	OA	ADJU	L1		
7695	10/28/2016	1/27/17		2136024	CA		P3 Door w/TH Plate, RCM M7A, Position L1	COMP		SIDE DOOR GUIDE (BAR, VHMWPE 2.375 IN X 50.750 IN X 0.250 IN THK)	RCM	REPL			
7695	10/28/2016	1/27/17		2136024	CA		P3 Door w/TH Plate, RCM M7A, Position L1	COMP		FEMALE DOOR NOSING SEAL	RCM	REPL			
7695	10/28/2016	1/27/17		2136024	CA		P3 Door w/TH Plate, RCM M7A, Position L1	COMP		MALE DOOR NOSING SEAL	RCM	REPL			
7695	10/28/2016	1/27/17		2136735	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		THRESHO PLATE, STAINLES STEEL WELDME LEFT-HAND	RCM	REPL	L2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7695	10/28/2016	1/27/17		2136735	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		SIDE DOOR, R1, L2	OA	ADJU	L2		
7695	10/28/2016	1/27/17		2136735	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		SIDE DOOR GUIDE (BAR, VHMWPE 2.375 IN X 50.750 IN X 0.250 IN THK)	RCM	REPL			
7695	10/28/2016	1/27/17		2136735	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		FEMALE DOOR NOSING SEAL	RCM	REPL			
7695	10/28/2016	1/27/17		2136735	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		MALE DOOR NOSING SEAL	RCM	REPL			
7695	10/31/2016	4/26/17		2138146	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7695	10/31/2016	4/26/17		2139689	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7695	12/2/2016	4/26/17		2161597	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							
7695	12/5/2016	12/6/16		2163600	CM	7	L1 SHOE LEAD FLASHED-DEFECT CONFIRMED BY G/F PERSUAD. 2C SUBMITTED CHECK M/M CAB FOR NON COMPLIANCE	COMP		SHOE, COI 3RD RAIL	FLAS	CREPL	L1		
7695	12/8/2016	12/9/16	468	2165750	LG	7	POSSIBLE FLAT SPOTS, FELT ON CURVES	COMP	NDF					EQUIPMENT TESTED AND INSPECTED NO EXCEPTIONS TAKEN. EQUIPMENT SAFE AND SUITABLE FOR SERVICE	
7695	12/19/2016	12/29/16		2171034	CM	8	MARGINAL TEMP 76 AMBIENT TEMP 31	COMP		CIRCUIT BREAKER CB061 AUXILIARY INVERTER CONTROL	INOP	RESE			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7695	1/12/2017	1/27/17		2185459	PM	X	92 Day Periodic Inspection, M7B	COMP	IC							
7695	1/15/2017	1/15/17		2186851	CM	1	f end dead truck	COMP		CIRCUIT BREAKER CB002 F-END PROPULS CONTROL DEVICE ASSEMBLY COUPLER CENTER	TRIP	RESE				
7695	1/16/2017	1/27/17		2187198	CM	5	F-END DRAWHEAD CHAIN **CHAIN CLIP PHYSICAL DAMAGE**	COMP			MHM	RMH				
7695	1/20/2017	1/27/17		2190091	CM	5	L2 EMERGENCY WINDOW EXIT RANDOM TESTING	COMP	EWP							
7695	1/27/2017	3/13/17		2193942	CM	7	B/E SCRAPER SHOES INSTALLED	COMP	GFS							
7695	1/27/2017	1/27/17		2194235	CM	7	#2 PINION SEAL LEAKING	COMP		WHEEL & AXLE ASSY	LEAK	REPL	2			
7695	1/27/2017	1/27/17		2194271	CM	5	2 CASES WATER MISS	APPR		INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS)						
7695	1/27/2017	1/27/17		2194271	CM	5	2 CASES WATER MISS	APPR		INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS)						
7695	1/27/2017	1/27/17		2194271	CM	5	2 CASES WATER MISS	APPR		INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS)						
7695	1/27/2017	1/27/17		2194271	CM	5	2 CASES WATER MISS	APPR		INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS) INTERSHO TRANSFER (COMPONENT USED FOR ITS)						
7695	1/27/2017	1/27/17		2194312	RCM	2	Phase 1 Relay, RCM, M7 B Car	COMP			MC	MC				
7695	1/27/2017	1/27/17		2194316	RCM	X	3 Year ASU Dryer C/O,RCM, M7 (B Car)	COMP			RCM	REPL				
7695	1/27/2017	1/27/17		2194316	RCM	X	3 Year ASU Dryer C/O,RCM, M7 (B Car)	COMP	IC							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7695	1/27/2017	1/27/17		2194404	CM	8	F/E ACCU BOARD INOP, DAMPER MOTOR FAULTS , A0925	COMP		AIR CONDITIC CONTROL UNIT - ACCU	INOP	RMH	FE		card was replaced
7695	2/2/2017	2/3/17		2199078	CM	9	RESTROOM DOOR VERY DIFFICULT TO OPEN AND CLOSE. INVESTIGATION REQUIRED	COMP		TOILET DOOR HANGER ASSEMBL (BOLT AND BRACKET	PD	CREPL			
7695	2/20/2017	3/2/17		2212812	CM	5	ENGINEERS WPER	INOP	COMP	WIPER BLADE ASSY ,28 IN. LONG,	INOP	CREPL			
7695	3/3/2017	3/6/17		2223189	CM	9	NO FLUSH NO WATER	COMP	GFS					TOILET OAI	
7695	3/9/2017	4/26/17		2226657	CA	3	Campaign to change out safety valve C4563 on the "B" cars - M7	COMP	MC						
7695	3/19/2017	3/22/17		2231920	CM	7	R2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	MISS	CREPL	R2		
7695	3/27/2017	3/27/17		2235978	CA		AVRM - M7B Car - T92400	WAPPR							
7695	3/27/2017	3/27/17		2236675	CA	2	PTC-5 Dynamic testing Test Track 11 Car test and Commissioning	WAPPR							
7695	3/28/2017	3/28/17		2237947	CM	7	L-2 CONTACT SHOE WEAR LIMIT	COMP		SHOE,COI 3RD RAIL	WL	CREPL	L2		
7695	4/14/2017	4/26/17		2249070	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7695	4/26/2017	4/26/17		2254444	RCM	2	6yr ATC, RCM, M7 (B Car)	COMP	IC						
7695	4/26/2017	4/26/17		2254504	RCM	X	1YR_RCM_M7B	COMP	IC						
7695	4/26/2017	4/26/17		2254504	RCM	X	1YR_RCM_M7B	COMP	IC						
7695	4/26/2017	4/26/17		2254504	RCM	X	1YR_RCM_M7B	COMP	IC						
7695	4/26/2017	4/26/17		2254819	CM	1	LB-13 Spring tension weak B/E	COMP		LINE BREAKER UNIT LINE, CONTACT	OA	REPL			
7695	4/26/2017	4/26/17		2254942	CM	1	B/e LB 13 low voltage tips kissed	COMP			BJL	REPL			
7695	5/7/2017	5/7/17		2262150	RCM	3	6 Year Air Brake Valve C/O, WAPPR Car Body RCM, M7B								
7695	6/7/2017	6/8/17	3353	2281273	LG	10	NO PA NO IC T/L	COMP	OAI					Tested - OAI.	
7695	6/10/2017	6/10/17	7623	2283710	LG	5	Employee struck by train	APPR							
7696	7/22/2016	7/22/16		2073529	CA	2	PTC-4A ADU INSTALL (M7)	WAPPR							
7696	8/2/2016	8/5/16		2081675	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7696	9/21/2016	1/27/17		2110614	CA	2	PTC-3A MCP A - CAR FILTER INSTALL (M7)	COMP		VOICE RADIO INSTALL KIT, A-CAR, BOMBARDIER 3046687G	NEW	INST			
7696	10/11/2016	10/11/16	813	2125008	LG	6	R1 door C/O/L-Door lock error	COMP		SIDE DOOR, R1, L2	OA	ADJU	R1	Adjusted the R1 door and it operates as intended	-On equipment, found door operational. Upon inspection found cracked Door Threshold Plate. -CC Notified. Decision was made to C/O/L the door. Door C/O/L. 2C submitted.
7696	10/12/2016	10/15/16		2125452	CM	6	R1 Door - Male and Female Nosing Seals Worn - **TO BE REPLACED**	COMP		FEMALE DOOR NOSING SEAL	PD	REPL			
7696	10/12/2016	10/12/16		2125513	CM	6	R1 DOOR THRESHOLD PLATE CRACKED C/O/L OKTR FOR 1 CALENDAR DAY AS PER GF	COMP		SIDE DOOR GUIDE (BAR, VHMWPE 2.375 IN X 50.750 IN X 0.250 IN THK)	OA	ADJU			
7696	10/13/2016	10/14/16		2125846	CM	6	R1 DOOR THRESHOLD PLATE CRACKED	COMP		MODIFIED WIDE DOOR THRESHOLD PLATE	PD	REPL	R1		
7696	10/14/2016	1/27/17		2129033	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	SC						
7696	10/21/2016	10/27/16		2131656	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7696	10/28/2016	4/26/17		2135625	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7696	10/28/2016	1/30/17		2136434	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		THRESHOLD PLATE, STAINLESS STEEL WELDMENT LEFT-HAND SIDE DOOR, R1, L2	RCM	REPL	L2		
7696	10/28/2016	1/30/17		2136434	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		SIDE DOOR, R1, L2	OA	ADJU	L2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7696	10/28/2016	1/30/17		2136434	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		SIDE DOOR GUIDE (BAR, VHMWPE 2.375 IN X 50.750 IN X 0.250 IN THK)	RCM	REPL			
7696	10/28/2016	1/30/17		2136434	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		FEMALE DOOR NOSING SEAL	RCM	REPL			
7696	10/28/2016	1/30/17		2136434	CA		P3 Door w/TH Plate, RCM M7A, Position L2	COMP		MALE DOOR NOSING SEAL	RCM	REPL			
7696	10/31/2016	4/26/17		2138450	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7696	10/31/2016	1/30/17		2139387	CA		P3 Door w/TH Plate, M7, Position R2	COMP		THRESHO PLATE, STAINLES STEEL WELDME RIGHT-HAND SIDE DOOR, L1, R2	RCM	REPL	R2		
7696	10/31/2016	1/30/17		2139387	CA		P3 Door w/TH Plate, M7, Position R2	COMP		SIDE DOOR GUIDE (BAR, VHMWPE 2.375 IN X 50.750 IN X 0.250 IN THK)	OA	ADJU	R2		
7696	10/31/2016	1/30/17		2139387	CA		P3 Door w/TH Plate, M7, Position R2	COMP		SIDE DOOR GUIDE (BAR, VHMWPE 2.375 IN X 50.750 IN X 0.250 IN THK)	RCM	REPL			
7696	10/31/2016	1/30/17		2139387	CA		P3 Door w/TH Plate, M7, Position R2	COMP		FEMALE DOOR NOSING SEAL	RCM	REPL			
7696	10/31/2016	1/30/17		2139387	CA		P3 Door w/TH Plate, M7, Position R2	COMP		MALE DOOR NOSING SEAL	RCM	REPL			
7696	12/2/2016	4/26/17		2160802	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7696	12/8/2016	12/28/16	432	2165655	LG	6	Crew reports operating from 2 door stations. The split was between RSU's 7641 & 7696 @ PDM. TRAIN IS ON THE MOVE **MUST RIDE OPEN ENDED**	COMP	OAI					Tested T/L Door signals at the coupler, OAI. Inspected coupler cables, DCPs and associated wiring, NDF.	-Informed by GF about open yard. Car was open-ended at the time of inspection. Log W/O for 7641 previously closed. -On equipment, Tested T/L Door signals at the coupler, OAI. Inspected coupler cables, DCPs and associated wiring, NDF.
7696	1/12/2017	1/27/17		2185461	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7696	1/17/2017	1/27/17		2187366	RCM	10	Event Recorder 1 Year Certification - CFR 229.27, M7A	COMP	IC						
7696	1/27/2017	4/26/17		2193943	CM	7	B/E SCRAPER SHOES INSTALLED	COMP		SHOE,COI 3RD RAIL	WL	CREPL	L2		
7696	1/27/2017	1/27/17		2194236	CM	7	#1 GEAR CASE OIL CONT.	COMP		OIL,GEAR	RCM	CREPL			
7696	1/27/2017	1/30/17		2194238	CM	6	L-2 THRESHOLD PLATE CRACKED	COMP	SPC						
7696	1/27/2017	1/27/17		2194272	CM	5	4 CASES WATER O.D.	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7696	1/27/2017	1/27/17		2194272	CM	5	4 CASES WATER O.D.	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7696	1/27/2017	1/27/17		2194272	CM	5	4 CASES WATER O.D.	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7696	1/27/2017	1/27/17		2194272	CM	5	4 CASES WATER O.D.	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7696	1/27/2017	1/27/17		2194310	RCM	2	Phase 1 Relay, RCM, M7 A Car	COMP		MODIFIC/	MC	MC			
7696	1/27/2017	1/27/17		2194374	CM	7	AXLE #1 BRUSH BOX P/D	COMP		COMPLET GROUND BRUSH HOLDER	PD	REPL	1		
7696	3/13/2017	3/13/17		2228903	CM	7	L2 CONTACT SHOE WORN	COMP		SHOE,COI 3RD RAIL	WL	CREPL	L2		
7696	3/27/2017	3/27/17		2236147	CA		AVRM - M7A Car - T92400	WAPPR							
7696	3/28/2017	3/28/17		2237951	CM	7	R-2 CONTACT SHOE WEAR LIMIT	COMP		SHOE,COI 3RD RAIL	WL	CREPL	R2		

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7696	4/8/2017	4/8/17		2246286	CM	5	B/E storm door holder in the ceiling is missing	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7696	4/14/2017	4/26/17		2249072	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7696	4/26/2017	4/26/17		2254474	RCM	2	6yr ATC, RCM, M7 (A Car)	COMP	IC						
7696	4/26/2017	4/26/17		2254739	CM	5	TLR2 INTER CAR JUMP P/COMP D	COMP		CABLE, JUMPER HARNESS TRAINLIN NETWORK	IBD	INSU			
7696	5/7/2017	5/7/17		2262152	RCM	3	6 Year Air Brake Valve C/O, WAPPR Car Body RCM, M7A								
7743	6/10/2016	6/13/16	137	2047221	LG	9	Passenger locked in bathroom - crew had to pry the door open and could not close again - Tie wrapped closed	COMP		TOILET DOOR HANGER ASSEMBL (BOLT AND BRACKET SHOE, COI 3RD RAIL	OA	ADJU		REPLACED HARDWARE & ADJUSTED DOOR HANGER TESTED GFS	
7743	6/13/2016	6/13/16		2047773	CM	7	R2 CONTACT SHOE PIN MISSING	COMP			MISS	CREPL	R2		
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR IT'S)					

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7743	6/14/2016	6/14/16		2048502	CM	9	HAND DRYER INOP	APPR		INTERSH(TRANSFE (COMPON USED FOR ITS)					
7743	6/20/2016	7/6/16		2050887	RCM	7	Truck Drop and Install, M7B COMP RCM			TRUCK (COMPLE	RCM	REMV	FE		
7743	6/20/2016	7/6/16		2050887	RCM	7	Truck Drop and Install, M7B COMP RCM			TRUCK (COMPLE	RCM	REPL	BE		
7743	6/20/2016	7/6/16		2050887	RCM	7	Truck Drop and Install, M7B COMP RCM			TRUCK (COMPLE	RCM	REPL	FE		
7743	6/20/2016	7/6/16		2050887	RCM	7	Truck Drop and Install, M7B COMP RCM			TRUCK (COMPLE	RCM	REMV	BE		
7743	6/27/2016	6/27/16		2054665	CA	2	PTC-2 ROOF ANTENNA ARRAY INSTALL (M7 B-Car)	WAPPR							
7743	6/27/2016	6/27/16		2055979	CA	2	PTC-4 OBC/ADU INSTALL (M7)	WAPPR							
7743	7/5/2016	7/6/16		2063286	CM	3	PARKING BRAKE CABLE P/D (C-4652)	COMP		PARKING CABLE, TRUCK BOX TO QUICK DISCONN	PD	REPL			
7743	7/6/2016	7/6/16		2063981	RCM	5	Phase 1 Carbody, 5 year RCM, M7B	COMP		MODIFIC/ COMPLET	MC	MC			
7743	7/6/2016	7/6/16		2064032	RCM	2	6yr ATC, RCM, M7 (B Car)	WAPPR							
7743	7/6/2016	7/6/16		2064170	RCM	4	Phase 1 Auxilliary Power, RCM, M7B	COMP		BLOWER SUBASSY	RCM	REPL			
7743	7/6/2016	7/7/16		2064189	CM	5	Conuctors Flip Seat Cushion Missing.	COMP		OBSERVE FLIP UP SEAT ASSEMBL	MISS	RMH			REPLACED FROM FLOOR STOCK
7743	7/6/2016	7/7/16		2064190	CM	5	Cab Door Hold Back Magnet Missing - 4090825C	COMP		DOOR, CAB	PD	RMH			

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7743	8/3/2016	8/4/16	63	2083677	LG	3	No dump thru during the brake test (tappit valve stem missing)	COMP		PIPE, TAPPET, BRAKE, VALVE ASSEMBL	MISS	REPL		REPLACED TAPPET VALVE ASSEMBLY . INSPECTED TESTED EQUIPMENT SAFE AND SUITABLE FOR SERVICE.		
7743	8/12/2016	8/12/16		2088818	CA	2	PTC-3 MCP MOBILE COMM PKG INSTALL (M7B-Car)	WAPPR								
7743	8/22/2016	9/2/16		2092145	PM	X	92 Day Periodic Inspection, M7B	COMP	IC							
7743	9/30/2016	10/4/16		2116156	CM	9	toilet seat p/d	COMP		TOILET SEAT	LOOS	TIGH				
7743	10/14/2016	12/2/16		2127530	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	MC							
7743	10/28/2016	6/2/17		2136089	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR								
7743	10/28/2016	6/2/17		2136669	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR								
7743	10/31/2016	6/2/17		2138211	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR								
7743	10/31/2016	6/2/17		2139624	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR								
7743	11/18/2016	12/2/16		2151304	PM	X	92 Day Periodic Inspection, M7B	COMP	IC							
7743	12/2/2016	12/2/16		2160442	CM	5	4 waters are O/D	COMP		Emergency Water	MISS	CREPL				
7743	12/2/2016	6/2/17		2161795	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR								
7743	12/2/2016	12/2/16		2162166	CM	5	EXT BRAKE REL. LED OPEN	COMP		EXTERIOI RELEASE LIGHT (GREEN BIDIRECT LED)	INOP	CREPL				
7743	12/29/2016	12/30/16		2175378	CM	9	TOILET DOOR HANGER BOLTS P/D	COMP		TOILET DOOR HANGER BOLT (BOLT ONLY)	PD	CREPL				
7743	12/30/2016	2/1/17		2176147	CM	9	EXT KICK PLATE ON BATHROOM DOOR PD LOCKED OUT GANG FOREMAN ADVISED	COMP	NDF							

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7743	1/31/2017	2/9/17		2195814	CM	8	ACCU ANALOG CONDITIONER FAULT CODE 39	COMP	OAI						
7743	2/5/2017	3/3/17		2201112	CM	9	DOOR KICK PLATE P/D NEEDS TO BE REPAIRED P/D	COMP		DOOR ASSEMBL TOILET	PD	RMH			
7743	2/6/2017	2/8/17		2201837	CM	3	Air Compressor is continuously tripping	COMP	OAI						
7743	2/16/2017	2/26/17		2211451	CM	9	DOOR LOCK SENSOR SWITCH O/A	COMP	NDF						
7743	2/17/2017	3/3/17		2211693	PM	X	92 Day Periodic Inspection, M7B	COMP	IC						
7743	3/2/2017	3/2/17		2222078	CM	8	F/E ACCU FAULTS	COMP		WATER PUMP (PUMP ONLY)	INOP	REPL			
7743	3/2/2017	3/2/17		2222078	CM	8	F/E ACCU FAULTS	COMP		AIR CONDITIC CONTROL UNIT - ACCU	INOP	REPL	FE		
7743	3/3/2017	3/3/17		2223040	CM	5	1 CASE OF WATER MISSING.	COMP		Emergency Water	MISS	CREPL			
7743	3/4/2017	3/4/17		2223520	CM	6	DOOR BY PASS SEAL MISSING	COMP		DOOR BY-PASS WIRE SEAL	MISS	CREPL			
7743	3/4/2017	3/4/17		2223521	CM	3	SNOW SEAL MISSING	COMP		SNOW BRAKE SEAL PLASTIC	MISS	CREPL			
7743	3/6/2017	3/24/17		2224003	CM	5	ENGINEERS CAB DOOR DAMAGED	COMP		DOOR, CAB	PD	RMH		replace missing hardware and adjust bent hinge	
7743	3/6/2017	3/9/17		2224007	CM	9	TOILET OUT OF SERVICE (LOCK OUT)	COMP		TOILET BOWL VALVE, SAFETY, 11 BAR	CLOG	CLEA			
7743	3/9/2017	6/2/17		2226855	CA	3	Campaign to change out safety valve C4563 on the "B" cars - M7	COMP			INOP	REPL			
7743	3/21/2017	3/23/17		2232972	CM	5	L1 3seater,glue residue on seat.	COMP	SC						
7743	3/24/2017	3/28/17		2235018	CM	9	TOILET DOOR HANGER BOLTS SHEARED	COMP		TOILET DOOR HANGER BOLT (BOLT ONLY)	PD	CREPL			
7743	3/27/2017	3/27/17		2235810	CA		AVRM - M7B Car - T92400 WAPPR								

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7743	3/27/2017	3/27/17		2236873	CA	2	PTC-5 Dynamic testing Test Track 11 Car test and Commissioning	WAPPR								
7743	3/30/2017	6/2/17	5051	2238907	LG	5	The engineer reported scratches in the middle of the windshield making it difficult to see. ** Must Ride Buried **	COMP		ENGINEER WINDSHIELD GLASS ELECTRIC HEATED	DIST	REPL		windshield was distorted. windshield was replaced.	windshield was distorted. windshield was replaced.	
7743	4/10/2017	4/13/17		2247542	CM	9	TOILET DOOR O/A NEEDS EIC	COMP		TOILET DOOR BRACKET HANGER	LOOS	TIGH				
7743	4/10/2017	6/2/17		2247581	CM	8	B/S CONDENSER FAN MOTOR 1 OVLD OPEN MUST REPLACED NO ROOFTOP ACCESS AS PER WSY FREEZE TEAM	COMP		CONDENSER FAN MOTOR (MOTOR ONLY)	OPEN	RMH				
7743	4/11/2017	6/2/17		2247727	CM	8	MARGINAL TEMP 77 AMBIENT TEMP 85	COMP	NDF							
7743	4/14/2017	4/26/17		2249252	CM	9	TOILET DOOR JAMMED OPEN HALFWAY	COMP		DOOR, TOILET, INSTALL/	MISA	ADJU				
7743	4/26/2017	6/2/17		2254941	CM	9	TOILET DOOR GUIDE MISSING ; EXCESSIVE PLAY	COMP		DOOR, TOILET, INSTALL/	MISA	ADJU				
7743	5/19/2017	6/1/17		2268605	PM	X	92 Day Periodic Inspection, M7B	COMP	IC							
7743	5/25/2017	5/25/17		2272109	RCM	X	1YR_RCM_M7B	WAPPR								
7743	6/2/2017	6/2/17		2278280	CM	5	COUPLER TIME DELAY RELAY DELAY INOP (ISOLATED)	APPR		INTERSHO TRANSFER (COMPONENT USED FOR IT'S)						
7743	6/2/2017	6/2/17		2278280	CM	5	COUPLER TIME DELAY RELAY DELAY INOP (ISOLATED)	APPR		INTERSHO TRANSFER (COMPONENT USED FOR IT'S)						
7743	6/2/2017	6/2/17		2278357	CM	4	PICU BOARD INOP.	COMP		PCB, PICU SEE M701018K (A CAR) & M701018K (B CAR)	INOP	REPL				
7743	6/5/2017	6/5/17		2279942	CM	5	CAB WIPER BLADE TORN ***MUST RIDE BURIED	APPR								

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7744	6/14/2016	6/18/16		2048297	CM	8	CAR TEMP 63 AMB TEMP COMP 59	COMP		CIRCUIT BREAKER CB213 F-END BLOWER AND FRESH AIR FAN MOTOR	TRIP	RESE			CONNECT PIU SIMULATED ALL FUNCTIONS, RUN FULL SYSTEM CHECK FOUND NO BLOWERS ON F/E FOUND CB 213 TRIPPED. RESET CB 213 OAI. REPORTED BY KO FREEZE TEAM.
7744	6/20/2016	7/6/16		2050885	RCM	7	Truck Drop and Install, M7A RCM	COMP		TRUCK (COMPLE	RCM	REMV	FE		
7744	6/20/2016	7/6/16		2050885	RCM	7	Truck Drop and Install, M7A RCM	COMP		TRUCK (COMPLE	RCM	REPL	BE		
7744	6/20/2016	7/6/16		2050885	RCM	7	Truck Drop and Install, M7A RCM	COMP		TRUCK (COMPLE	RCM	REPL	FE		
7744	6/20/2016	7/6/16		2050885	RCM	7	Truck Drop and Install, M7A RCM	COMP		TRUCK (COMPLE	RCM	REMV	BE		
7744	7/6/2016	7/6/16		2063979	RCM	5	Phase 1 Carbody, 5 year RCM, M7A	COMP		MODIFIC/ COMPLET	MC	MC			
7744	7/6/2016	7/6/16		2063990	RCM	4	Battery Service RCM, M7A	COMP		BATTERY CELLS INSTALL/ ASSY, CENTER	RCM	REPL	NS		
7744	7/6/2016	7/6/16		2063990	RCM	4	Battery Service RCM, M7A	COMP		BATTERY CELLS INSTALL/ ASSY, CENTER	RCM	REPL	SS		
7744	7/6/2016	7/6/16		2064030	RCM	2	6yr ATC, RCM, M7 (A Car)	WAPPR							
7744	7/6/2016	7/6/16		2064168	RCM	4	Phase 1 Auxilliary Power, RCM, M7A	COMP		BLOWER SUBASSY	RCM	REPL			
7744	7/6/2016	7/7/16		2064186	CM	5	M/M's Seat P/D - A4286R	COMP		OPERATO SEAT INSTALL/ ASSEMBL	PD	REPL			
7744	7/6/2016	7/7/16		2064188	CM	5	Conuctors Flip Seat Shell & Cushion P/D.	COMP		SHELL, BOTTOM, ADA FLIP-UP SEAT, FIBER REINFORC PLASTICS	PD	REPR			REPLACED FROM FLOOR STOCK
7744	7/6/2016	7/7/16		2064210	CM	5	Cab Door Magnetic Hold Assembly Missing - 4090825C	COMP		DOOR, CAB	PD	RMH			
7744	7/22/2016	7/22/16		2073577	CA	2	PTC-4A ADU INSTALL (M7)	WAPPR							
7744	8/22/2016	9/2/16		2092147	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes
7744	9/2/2016	9/2/16		2101665	CM	5	Interior light balast inop	COMP		BALLAST ASSEMBL 72 VDC	INOP	CREPL			
7744	9/21/2016	9/21/16		2110398	CA	2	PTC-3A MCP A - CAR FILTER INSTALL (M7)	WAPPR							
7744	10/14/2016	12/2/16		2127534	CA	5	MOD, LLEPM HPPL Decal install, M7	COMP	MC						
7744	10/28/2016	6/2/17		2135733	CA		P3 Door w/TH Plate, RCM M7A, Position L1	WAPPR							
7744	10/28/2016	6/2/17		2136326	CA		P3 Door w/TH Plate, RCM M7A, Position L2	WAPPR							
7744	10/31/2016	6/2/17		2138723	CA		P3 Door w/TH Plate, M7, Position R1	WAPPR							
7744	10/31/2016	6/2/17		2139279	CA		P3 Door w/TH Plate, M7, Position R2	WAPPR							
7744	11/18/2016	12/2/16		2151306	PM	X	92 Day Periodic Inspection, M7A	COMP	IC						
7744	12/2/2016	12/2/16		2160443	CM	5	3 waters are O/D	COMP		Emergency Water	MISS	CREPL			
7744	12/2/2016	6/2/17		2161019	CA	5	To re-locate the seco switch - Phase 1 - Run wires in A and B cars	WAPPR							
7744	12/2/2016	12/19/16		2162185	CM	5	PBFR RELAY KISSED	COMP		PARKING BRAKE FLASHER RELAY (PBFR)	INOP	REPL			
7744	12/10/2016	12/13/16	8064	2167347	LG	5	R2 interior emergency glass broken	COMP		GLASS, INTERIOR EMERGEN HANDLE	CRAC	CREPL		R2 INTERIOR EMERGENCY GLASS REPLACED. EQUIPMENT GOOD FOR SERVICE	
7744	12/11/2016	12/11/16		2167447	CM	5	R2 INTERIOR EMERGENCY GLASS P/D	COMP		GLASS, INTERIOR EMERGEN HANDLE	CRAC	CREPL			
7744	12/13/2016	12/13/16	402	2168239	LG	6	S/S Door Panel Not Working - Door By-Pass Active	COMP	OAI					S/S DOORS TESTED AND INSPECTED NO EXCEPTIONS TAKEN. S/S DOORS OPERATING AS INTENDED.	Crew Reports that South Side Door Panel is not Working. Door By-Pass Active PW GF Notified and will Investigate

Car Case History Report

Start Date: 6/10/16 End Date: 6/10/17

RSU(s): 7695,7696,7403,7404,7417,7418,7625,7626,7049,7050,7743,7744 Work Type(s): ALL Status Date: ALL Location(s): ALL Status(es): ALL

RSU	WO Date	Status Date	Train #	Work Order #	Work Type	Sys Code	WO Description	WO Status	CNR Code	Comp Desc	Defect Code	Rep Code	Pos Code	Repair Text	WO Notes	
7744	1/17/2017	3/3/17		2187579	RCM	10	Event Recorder 1 Year Certification - CFR 229.27, M7A	COMP	IC							
7744	2/17/2017	3/3/17		2211695	PM	X	92 Day Periodic Inspection, M7A	COMP	IC							
7744	2/23/2017	2/24/17		2214254	CM	7	R2 CONTACT SHOE P/D	COMP		SHOE,COI	WL	CREPL	R2			
7744	3/3/2017	3/3/17		2223041	CM	5	1 CASE OF WATER MISSING.	COMP		Emergency Water	MISS	CREPL				
7744	3/4/2017	3/4/17		2223522	CM	6	DOOR BY PASS SEAL MISSING	COMP		DOOR BY-PASS WIRE SEAL	MISS	CREPL				
7744	3/4/2017	3/4/17		2223523	CM	3	SNOW SEAL MISSING	COMP		SNOW SEAL BRAKE SEAL	MISS	CREPL				
7744	3/6/2017	3/31/17		2224005	CM	8	FRESH AIR DAMPER POSITION FAULT	COMP		FRESH AIR DAMPER ASSEMBL	BJL	ADJU				
7744	3/27/2017	3/27/17		2236459	CA		AVRM - M7A Car - T92400	WAPPR								
7744	5/19/2017	6/1/17		2268607	PM	X	92 Day Periodic Inspection, M7A	COMP	IC							
7744	6/2/2017	6/2/17		2277746	CM	5	MM WIPER BLADE W/L	COMP		WIPER BLADE ASSY ,28 IN. LONG,	TORN	CREPL				